# Troubleshooting WS-X6348 Module Port Connectivity for Catalyst 6500/6000 Using CatOS

Document ID: 29422

### **Contents**

#### Introduction

#### **Prerequisites**

Requirements

Components Used

Conventions

#### **Background Information**

WS-X6348 Module Architecture

Known Issues

#### How to Troubleshoot Catalyst 6500/6000 WS-X6348 Module Port Connectivity

Step-by-step Instructions

Command Outputs to Collect Before You Contact Cisco Technical Support

**Related Information** 

### Introduction

This document discusses detailed troubleshooting for the WS–X6348 module on the Catalyst 6500/6000 that runs the CatOS and the command outputs to collect before you contact Cisco Technical Support.

## **Prerequisites**

## Requirements

There are no specific requirements for this document.

## **Components Used**

The information in this document is based on these software and hardware versions:

- Catalyst 6500 with Supervisor II with Multilayer Switch Feature Card 2 (MSFC2)
- WS-X6348 module
- CatOS version 6.3.9

The information in this document was created from the devices in a specific lab environment. All of the devices used in this document started with a cleared (default) configuration. If your network is live, make sure that you understand the potential impact of any command.

#### Conventions

Refer to the Cisco Technical Tips Conventions for more information on document conventions.

## **Background Information**

#### WS-X6348 Module Architecture

Each WS-X6348 card is controlled by a single Application-Specific Integrated Circuit (ASIC) that connects the module to both the 32 GB data bus backplane of the switch and to a set of four other ASICs which controls groups of 12 10/100 ports.

An understanding of this architecture is important as it can help to troubleshoot port problems. For example, if a group of 12 10/100 ports fails the online diagnostics, this typically indicates that one of the ASICs previously mentioned failed. See step 13 in order to learn more about the **show test** <*module#>*.

#### **Known Issues**

1. Cisco bug ID CSCdu03935 (registered customers only): 6348–RJ–45 Coil Pinnacle Header Checksum Error

You can see this error message:

```
%SYS-5-SYS_LCPERR5: Module 9: Coil Pinnacle Header Checksum Error - Port #37
```

If you only see this message and no other Coil related messages in the syslogs or in the output of the **show logging buff 1023** command, and the transmit is stuck on one port, not a group of 12 ports, complete these steps in order to fix the problem:

- a. Disable and enable the ports.
- b. Issue the **reset** < module #> command in order to soft–reset the module.
- c. Hard—reset the module with the **set module power up|down** < module#> command. If after the completion of one or more of these steps the card comes online and all the ports pass diagnostics, which is shown if you issue the **show test** < module#> command, and traffic starts to pass fine, then the Cisco bug ID CSCdu03935 (registered customers only) is possibly present. The fix is in these CatOS releases and later:
  - **♦** 5.5(18)
  - **♦** 6.3(10)
  - **♦** 7.4(3)
- 2. You can see a message similar to one or more of these in the syslogs or **show logging buff 1023** command output:
  - ◆ Coil Pinnacle Header Checksum
  - ♦ Coil Mdtif State Machine Error
  - ♦ Coil Mdtif Packet CRC Error
  - ♦ Coil Pb Rx Underflow Error
  - ♦ Coil Pb Rx Parity Error

If you see one or more of these messages, and you have a group of 12 ports stuck and does not pass traffic, complete these steps:

- a. Disable and enable the ports.
- b. Issue the **reset** < *module* #> command in order to soft–reset the module.
- c. Hard–reset the module with the **set module power up|down** *<module#>* command. After the completion of steps b and/or c, contact the Cisco Technical Support with the previous information if you encounter one or more of these issues:
  - ♦ The module does not come online.
  - ◆ The module comes online, but a group of 12 ports fails diagnostics, which is seen in the output from the **show test** <*module#*> command.

- ♦ The module is stuck in the other state when it boots up.
- ♦ All port LEDs on the module become amber.
- ♦ All ports are in the err-disabled state as seen when the **show** <*module*#> command is issued.

## How to Troubleshoot Catalyst 6500/6000 WS-X6348 Module Port Connectivity

Complete these steps in order to perform port connectivity troubleshooting on the Catalyst 6500/6000 WS-X6348 module.

## Step-by-step Instructions

Complete these steps:

1. Check the software version in use and make sure there are no known WS–X6348 issues with that code. Verify the module is a WS–X6348 and that the status is ok.

In the previous command output, check the status of the module. It can be in one of these four states:

- ♦ OK Everything is fine.
- ♦ power-deny Not enough power is available to power the module.
- ♦ other Most likely the Serial Communication Protocol (SCP) communication does not work
- ♦ faulty/unknown This indicates most likely a bad module or slot.
- err-disabled View the output from the **show logging buffer** command, as shown in step 3, in order to see if there are any messages on why the module is in the err-disabled state.
- 2. Verify that the configuration for the module and its ports are correct. Make sure that options such as the **set port host** command, are enabled when appropriate.

```
esc-6509-c (enable) show config 6
This command shows non-default configurations only.
Use 'show config all' to show both default and non-default configurations.
......
begin
!
# ***** NON-DEFAULT CONFIGURATION *****
!
!
#time: Sun Oct 20 2002, 12:17:49
!
# default port status is enable
!
```

```
!
#module 6 : 48-port 10/100BaseTX Ethernet
set vlan 175 6/1-2
end
esc-6509-c (enable)
```

3. Issue the **show logging buff 1023** command in order to check for any port–related error messages in the log.

The output for this command is intentionally not shown as it is specific to each switch.

4. Verify that dynamic Content Addressable Memory (CAM) entries are created for any traffic that enters the port to which you troubleshoot. Make sure that the CAM entry is associated with the correct VLAN.

```
esc-6509-c (enable) show cam dynamic 6/1
* = Static Entry. + = Permanent Entry. # = System Entry. R = Router Entry.
X = Port Security Entry $ = Dot1x Security Entry
VLAN Dest MAC/Route Des [CoS] Destination Ports or VCs / [Protocol Type]
175
     00-d0-06-26-f4-00
                                       6/1 [ALL]
175 00-e0-le-a4-88-af
                                       6/1 [ALL]
175 00-90-6d-fb-88-00
                                       6/1 [ALL]
175 08-00-2b-2f-f4-dc
175 aa-00-04-00-01-a4
                                       6/1 [ALL]
                               6/1 [ALL]
6/1 [ALL]
6/1 [ALL]
6/1 [ALL]
6/1 [ALL]
6/1 [ALL]
6/1 [ALL]
6/1 [ALL]
6/1 [ALL]
6/1 [ALL]
6/1 [ALL]
6/1 [ALL]
6/1 [ALL]
6/1 [ALL]
6/1 [ALL]
6/1 [ALL]
175 08-00-2b-2f-f3-b4
175 00-00-0c-0b-f8-98
175 00-00-0c-ff-ec-c9
      00-03-e3-48-a6-e0
175
      00-05-74-19-59-8a
175
      00-08-e2-c3-60-a8
175
      00-50-54-7c-f2-e0
175
      00-50-54-75-dd-74
175
      00-50-0b-6c-b8-00
175
      00-04-5a-6c-6a-3a
175
      00-00-0c-34-7b-16
175
175 00-00-0c-19-36 6/1 [ALL]
175 08-00-69-07-b1-c8 6/1 [ALL]
Total Matching CAM Entries Displayed =18
esc-6509-c (enable)
```

5. If a port is configured as a trunk, check to make sure it is in the correct status and that the appropriate VLANs are spanning—tree forwarding and not pruned by VLAN Trunk Protocol (VTP). For a dot1q trunk, also make sure that the native VLAN matches that of the device on the other side of the trunk.

```
esc-6509-e> (enable) show trunk 3/1
* - indicates vtp domain mismatch
Port Mode Encapsulation Status Native vlan
     trunking
3/1
     desirable dot1q
     Vlans allowed on trunk
______
3/1
     1-1005,1025-4094
     Vlans allowed and active in management domain
_____
     1-50,79-81,175-176,997-999
     Vlans in spanning tree forwarding state and not pruned
3/1 1-50,79-81,175-176,997-999
esc-6509-e> (enable)
```

6. Make sure that the port in question is forwarding for spanning—tree on the correct VLAN. Also, that portfast is enabled or disabled where appropriate.

7. If the port is connected to another Cisco device use Cisco Discovery Protocol (CDP) to check if the port can see the device.

**Note:** CDP must be enabled on the switch and the other Cisco device. Also note that CDP is Cisco proprietary, and will not work with non–Cisco devices.

In this example, port 6/1 on the Catalyst 6509 switch connects to Fast Ethernet interface 0/4 on a Catalyst 3500XL.

```
esc-6509-c (enable) show cdp neighbor 6/1 detail
Port (Our Port): 6/1
Device-ID: esc-cat3500xl-1
Device Addresses:
 IP Address: 172.16.176.200
Holdtime: 150 sec
Capabilities: TRANSPARENT_BRIDGE SWITCH
Version:
 Cisco Internetwork Operating System Software
 IOS (tm) C3500XL Software (C3500XL-C3H2S-M), Version 12.0(5.1)XW, MAINTENANCEE
 Copyright (c) 1986-2000 by cisco Systems, Inc.
 Compiled Thu 21-Dec-00 12:04 by devgoyal
Platform: cisco WS-C3548-XL
Port-ID (Port on Neighbors's Device): FastEthernet0/4
VTP Management Domain: sj-et
Native VLAN: unknown
Duplex: unknown
System Name: unknown
System Object ID: unknown
Management Addresses: unknown
Physical Location: unknown
esc-6509-c (enable)
```

Since CDP is Cisco proprietary, care must be taken. CDP packets are sent to a well–known multicast destination MAC address 01–00–0C–CC–CC–CC. A Cisco switch not configured for CDP, or a non–Cisco switch, typically treats CDP packets like any multicast and floods them throughout the VLAN. If two Cisco switches with CDP enabled are connected through a non–CDP–capable switch, a possible result is that those two CDP–enabled switches think that they are CDP neighbors when, in fact, there is actually another switch in between them.

8. Check the configuration, state, and health of the port in trouble. You can also issue the **show port** <*module#>* command in order to look at all the ports for a given module.

```
      esc-6509-c (enable)
      show port 6/1

      Port Name
      Status
      Vlan
      Duplex Speed Type

      ----- 6/1
      connected
      175
      a-full a-100
      10/100BaseTX
```

Port	AuxiliaryVlan AuxVlan-Status				InlinePowered Admin Oper Detected					
6/1	none	none		-	-	-				
Port	Security	Violation	Shutdown	n-Time	Age-Tir	ne Ma	ax-Addr	Trap	IfIndex	
6/1	disabled	shutdown		0		0	1	disabled	99	
Port	Num-Addr	Secure-Src	-Addr	Age-Le	eft Last	-Sr	c-Addr	Shutdo	own/Time-Le	ft
6/1	0		_		-			-	-	_
Port	Broado	ast-Limit	Multicas	st Unio	cast Tot	tal-I	Drop			
6/1		_		-	-			0		
Port	admin	Control R	dmin	oper			ause	TxPause		
6/1		off c						0		
Port		Channel Mode			Group Io					
6/1		auto sil			34	0				
Port	Align-Err	FCS-Err	Xmit-	-Err	Rcv-Eri	2	UnderSi	ize		
6/1		0	0	0		0		0		
Port	Single-Co	ol Multi-Co	ll Late-	-Coll	Excess-	-Col	Carri-	Sen Runts	Giants	
6/1		0	0	0		0		0	0	0
Port	Last-Time	-Cleared								
6/1	Sun Oct 1	3 2002, 16	37:58							

Status Can display the following states:

esc-6509-c (enable)

- ♦ connected
- ♦ notconnect
- ♦ connecting
- ♦ standby
- ♦ faulty
- ♦ inactive
- ♦ shutdown
- ♦ disabled
- ♦ err-disabled
- ♦ monitor
- ♦ active
- ♦ dot1p
- ♦ untagged
- ♦ inactive
- ♦ onhook

If a port is in the notconnect state, check the cabling as well as the device connected to the other end. If a port is in the *faulty* state, it indicates a hardware problem. Issue the **show test** <*module#>* command for module diagnostic results. If the port is in the inactive state, issue the **show vlan** 

command in order make sure that the VLAN of the port still exists and issue the **set port enable** <*module#/port>* in order to try to re–enable the port. VTP problems can sometimes cause a VLAN to be deleted, which results in ports associated with that VLAN to become inactive.

- ♦ Vlan This field displays trunk if it is a trunk port, or the VLAN number the port is a member of if it is an access port.
- speed and duplex These fields have an **a** in front of the value displayed, for example, a-full, if the value was obtained through auto-negotiation. If the port is hardcoded for speed and duplex the **a** is not present. While not in a connected state, an auto-negotiation-enabled port displays auto in these fields. Make sure that the device attached to this port has the same settings as the port in regards to either hard setting the speed and duplex or auto-negotiating the speed and duplex.
- ♦ If port security is enabled, make sure the appropriate MAC addresses are allowed to pass through the port, and that the port is not shut down due to a security violation.
- ♦ If broadcast suppression is enabled, check the number of dropped packets in order to make sure this is not the cause of traffic problems on the port.
- ♦ If flow control is enabled, ensure that the other side of the link supports flow control as well, and make sure that the settings match on both ends.
- ◆ If the port is configured as part of an EtherChannel, its state and the state of the other ports in the channel are displayed. Information on the neighbor device appears based on information obtained through CDP, if you assume that the CDP is enabled on both devices in the channel.
- ◆ FCS-Err The number of valid size frames with Frame Check Sequence (FCS) errors but no framing errors. This is typically a physical issue, for example, cabling, a bad port, or a bad Network Interface Card (NIC), but can also indicate a duplex mismatch.
- ◆ Align-Err This is the number of frames with alignment errors, which are frames that do not end with an even number of octets and have a bad Cyclic Redundancy Check (CRC), received on the port. These usually indicate a physical problem, for example, cabling, a bad port, or a bad NIC, but can also indicate a duplex mismatch. When the cable is first connected to the port, some of these errors can occur. Also, if there is a hub connected to the port, collisions between other devices on the hub can cause these errors.
- ◆ Xmit-Err and Rcv-Err This indicates that the internal port transmit (Tx) and receive (Rx) buffers are full. A common cause of Xmit-Err is traffic from a high bandwidth link that is switched to a lower bandwidth link, or traffic from multiple inbound links that is switched to a single outbound link. For example, if a large amount of bursty traffic comes in on a gigabit port and is switched out to a 100 Mbps port, this can cause the Xmit-Err field to increment on the 100 Mbps port. This is because that output buffer of the port is overwhelmed by the excess traffic due to the speed mismatch between the incoming and outgoing bandwidths.
- ◆ Late-coll (late collisions) The number of times that a collision is detected on a particular port late in the transmission process. For a 10 Mbit/s port, this is later than 512 bit-times into the transmission of a packet. Five hundred and twelve bit-times corresponds to 51.2 microseconds on a 10 Mbit/s system. This error can indicate a duplex mismatch among other things. For the duplex mismatch scenario, the late collision is seen on the half duplex side. As the half duplex side transmits, the full duplex side does not wait its turn and transmits simultaneously, which causes a late collision. Late collisions can also indicate an Ethernet cable or segment that is too long. Collisions should not be seen on ports configured as full duplex.
- ◆ Single-coll (single collision) The number of times one collision occurs before the port transmits a frame to the media successfully. Collisions are normal for ports configured as half duplex, but should not be seen on full duplex ports. If collisions are increasing dramatically, this points to a highly utilized link or possibly a duplex mismatch with the attached device.
- ♦ Multi-coll (multiple collision) This is the number of times multiple collisions occur before the port transmits a frame to the media successfully. Collisions are normal for ports configured as half duplex, but should not be seen on full duplex ports. If collisions increase

- dramatically, this points to a highly utilized link or possibly a duplex mismatch with the attached device.
- ◆ Excess-coll (excessive collisions) This is a count of frames for which transmission on a particular port fails due to excessive collisions. An excessive collision happens when a packet has a collision 16 times in a row. The packet is then dropped. Excessive collisions are typically an indication that the load on the segment needs to be split across multiple segments, but can also point to a duplex mismatch with the attached device. Collisions should not be seen on ports configured as full duplex.
- ♦ Carri-Sen (carrier sense) This occurs every time an Ethernet controller wants to send data on a half duplex connection. The controller senses the wire and checks if it is not busy before transmitting. This is normal on a half duplex Ethernet segment.
- ♦ Undersize The frames received that are smaller than the minimum IEEE 802.3 frame size of 64 bytes long, which excludes framing bits, but includes FCS octets, that are otherwise well formed, so it has a valid CRC. Check the device that sends out these frames.
- ♦ Runts The frames received that are smaller than the minimum IEEE 802.3 frame size (64 bytes for Ethernet), and with a bad CRC. This can be caused by a duplex mismatch and physical problems, such as a bad cable, port, or NIC on the attached device.
- ♦ Giants These are frames that exceed the maximum IEEE 802.3 frame size (1518 bytes for non–jumbo Ethernet), and have a bad FCS. Try to find the offending device and remove it from the network. In many cases it is the result of a bad NIC.
- ♦ Issue the clear counters [all | mod/port] command in order to reset the statistics for the show port, show Mac, and show counters commands.

Refer to the Catalyst 6500 Series Command Reference, 7.5 for more information and further explanation of the various fields in the **show port** command output.

9. Check that traffic counters are incrementing both inbound and outbound on the port. You can also issue the **show Mac**<*module#*> command in order to look at the MAC info for all ports for a given module.

esc-6509-c (enable) show Mac 6/1

Port Rcv-Unicast Rcv-Multicast Rcv-Broadcast 6/1 20890 894039 74883 Port Xmit-Unicast Xmit-Multicast Xmit-Broadcast 12845 73660 179 Port Rcv-Octet Xmit-Octet 79498714 8738501 MAC Dely-Exced MTU-Exced In-Discard Out-Discard \_\_\_\_\_ \_\_\_\_ 6/1 0 0 0 Port Last-Time-Cleared \_\_\_\_\_ 6/1 Sun Oct 13 2002, 16:37:58 esc-6509-c (enable)

◆ The previous output shows the total unicast, multicast, and broadcast packets received (Rcv) and transmitted (Xmit) on a port.

**Note:** If the port is an Inter–Switch Link Protocol (ISL) trunk, all traffic are multicast, for example, all ISL headers use the destination multicast address 01–00–0C–CC–CC–CC.

- ♦ Dely-Exced The number of frames discarded by this port due to an excessive transmit delay through the switch. This counter should never go up unless the port is under very high utilization.
- ♦ MTU Exceed This is an indication that one of the devices on that port or segment is transmitting more than the allowed frame size (1518 bytes for non–jumbo Ethernet).
- ♦ In-Discard The result of incoming valid frames that were discarded because the frame did not need to be switched. This can be normal if a hub is connected to a port and two devices on that hub exchange data. The switch port still sees the data but does not have to switch it, since the CAM table shows the MAC address of both devices associated with the same port, and so it is discarded. This counter can also increment on a port configured as a trunk if that trunk blocks for some VLANs, or on a port that is the only member of a VLAN.
- ♦ Out-Discard The number of outbound packets chosen to be discarded even though no packet errors are detected. One possible reason to discard such a packet can be to free up buffer space.
- ♦ Issue the clear counters [all | mod/port] command in order to reset the statistics for the show port, show Mac, and show counters commands.

Refer to the Catalyst 6500 Series Command Reference, 7.5 for more information and further explanation of the various fields in the **show Mac** command output.

10. Check the detailed statistics for a specific port.

es	c-6509-c (enable) show counters	6/1								
64 bit counters										
0	rxHCTotalPkts	=		364517						
1	txHCTotalPkts	=		35104						
2	rxHCUnicastPkts	=		10281						
3	txHCUnicastPkts	=		6678						
4	rxHCMulticastPkts	=		338957						
5	txHCMulticastPkts	=		28343						
6	rxHCBroadcastPkts	=		15279						
7	txHCBroadcastPkts	=		83						
8	rxHCOctets	=	2	29291862						
9	txHCOctets	=		3460655						
10	rxTxHCPkts64Octets	=		181165						
11	rxTxHCPkts65to1270ctets	=		201314						
12	rxTxHCPkts128to255Octets	=		5546						
13	rxTxHCPkts256to5110ctets	=		11425						
14	rxTxHCpkts512to1023Octets	=		81						
15	rxTxHCpkts1024to1518Octets	=		89						
16	txHCTrunkFrames	=		0						
17	rxHCTrunkFrames	=		0						
18	rxHCDropEvents	=		0						
32	bit counters									
0	rxCRCAlignErrors	=	0							
1	rxUndersizedPkts	=	0							
2	rxOversizedPkts	=	0							
3	rxFragmentPkts	=	0							
4	rxJabbers	=	0							
5	txCollisions	=	0							
6	ifInErrors	=	0							
7	ifOutErrors	=	0							
8	ifInDiscards	=	0							
9	ifInUnknownProtos	=	0							
10	ifOutDiscards	=	0							
11	txDelayExceededDiscards	=	0							
	txCRC	=	0							
13	linkChange	=	4							
14	wrongEncapFrames	=	0							
0	dot3StatsAlignmentErrors	=	0							
1	dot3StatsFCSErrors	=	0							
2	dot3StatsSingleColFrames	=	0							
3	dot3StatsMultiColFrames	=	0							

```
4 dot3StatsSQETestErrors
5 dot3StatsDeferredTransmisions
                                              Ω
6 dot3StatsLateCollisions
                                              O
7 dot3StatsExcessiveCollisions
                                              O
8 dot3StatsInternalMacTransmitErrors =
                                              0
9 dot3StatsCarrierSenseErrors =
                                              0
                                              0
10 dot3StatsFrameTooLongs
                                              0
11 dot3StatsInternalMacReceiveErrors =
                                              0
0 txPause
                                              0
1 rxPause
                                              0
0 rxTotalDrops
                                              0
1 rxFIFOFull
2 rxBadCode
Last-Time-Cleared
Sun Oct 20 2002, 16:23:06
esc-6509-c (enable)
```

This is a list of some of the non–generic counter details from the previous output:

- ♦ RxFragmentPkts The total number of packets received that do not end with an even number of octets (alignment error) or that has an FCS error, and is less than 64 octets in length, which excludes framing bits, but includes FCS octets.
- ♦ dot3StatsInternalMacReceiveErrors A count of frames for which reception on a particular port fails due to an internal MAC sublayer receive error. A frame is only counted if it is not counted by the corresponding instance of either dot3StatsFrameTooLongs, dot3StatsAlignmentErrors, or dot3StatsFCSErrors. In particular, an instance of this object can represent a count of receive errors on a particular port that are not otherwise counted.
- ♦ dot3StatsInternalMacTransmitErrors A count of frames for which transmission on a particular port fails due to an internal MAC sublayer transmit error. A frame is only counted if it is not counted by the corresponding instance of either dot3StatsLateCollisions, dot3StatsExcessiveCollisions, or dot3StatsCarrierSenseErrors.
- ♦ RxJabbers The total number of packets received that are longer than 1518 octets, which excludes framing bits, but incudes FCS octets, and do not end with an even number of octets (alignment error), or had an FCS error. The recommended action is to isolate the device that sends out these packets.
- ♦ txDelayExceededDiscards The number of frames discarded by this port due to an excessive transmit delay through the switch. This counter is the same as the Dely–Exced counter in the output from the **show Mac** command, and should never go up unless the port is under very high utilization.
- ◆ IfInUnknownProtos The number of inbound packets with unknown protocols.
- ◆ TxCRC This increments when frames are transmitted with a bad CRC, but it does not include frames aborted due to a late collision. This counter typically increments on an egress port when a frame is transmitted that is received as an ISL frame on an ingress port, but that carries an Ethernet packet with a bad CRC inside it, while the ISL packet itself has a good CRC. It can also be caused by bad switch hardware. A way to troubleshoot this is to send broadcast traffic on a port and see if the counter increments on all egress connected ports. If this happens independent of the port where you send traffic into, there is a failure in the switch hardware, most probably the chassis or supervisory module. If the counter is incrementing only when a certain module is used to send traffic into, this module has a hardware failure. If the counter is only incrementing on a few ports, the ports themselves have a problem. If the cause cannot be determined by the previous test, check the neighbor switches that are ISL connected, or check ISL connected end—devices. Contact Cisco Technical Support if you need further assistance.

- ♦ dot3StatsSQETestErrors A count of times that the SQE TEST ERROR message is generated by the physical signaling sublayer (PLS) for a particular interface. The SQE TEST ERROR message is defined in section 7.2.2.2.4 of the American National Standards Institute (ANSI)/IEEE 802.3−1985 and its generation is described in section 7.2.4.6 of the same document. This counter should never go up, since it is only of relevance to external Ethernet transceivers.
- ♦ dot3StatsCarrierSenseErrors The number of times that the carrier sense condition is lost or never asserted when you attempt to transmit a frame on a particular port. The count represented by an instance of this object is incremented at most once per transmission attempt, even if the carrier sense condition fluctuates during a transmission attempt. This counter is the same counter as the Carri−Sen field in the output of the **show port** command. This is normal on an half duplex Ethernet segment.
- ♦ linkChange The number of times the port toggles between a connected state to a non-connected state. If this counter is incrementing constantly it means there is something wrong with this port, the cable attached to this port, or the device at the other end of the cable.
- ♦ dot3StatsFrameTooLongs This is the count of frames received on a particular interface that exceeds the maximum permitted frame size. Check the device attached to the port.
- ♦ dot3StatsFCSErrors A count of valid frames received on a particular interface that end with an even number of octets but do not pass the FCS check. This is typically a physical issue, for example, cabling, bad port, or bad NIC card, but can also indicate a duplex mismatch. This is the same counter as the FCS-Err field in the output from the **show port** command.
- ♦ dot3StatsSingleColFrames A count of successfully transmitted frames on a particular port for which transmission is initially inhibited by exactly one collision. Collisions are normal for ports configured as half duplex, but should not be seen on full duplex ports. If collisions increase dramatically this points to a highly utilized link, or possibly a duplex mismatch with the attached device. This is the same counter as the Single-Coll field in the output from the **show port** command.
- ♦ dot3StatsMultiColFrames A count of successfully transmitted frames on a particular port for which transmission is initially inhibited by more than one collision. Collisions are normal for ports configured as half duplex, but should not be seen on full duplex ports. If collisions increase dramatically this points to a highly utilized link or possibly a duplex mismatch with the attached device. This is the same counter as the Multi-Coll field in the output from the **show port** command.
- ♦ dot3StatsExcessiveCollisions A count of frames for which transmission on a particular port fails due to excessive collisions. An excessive collision happens when a packet has a collision 16 times in a row. The packet is then dropped. Excessive collisions are typically an indication that the load on the segment needs to be split across multiple segments, but can also point to a duplex mismatch with the attached device. Collisions should not be seen on ports configured as full duplex. This is the same counter as the Excess-Coll field in the output from the **show port** command.
- ♦ dot3StatsLateCollisions The number of times that a collision is detected on a particular port late in the transmission process. For a 10 Mbit/sec port this is later than 512 bit—times into the transmission of a packet. 512 bit—times corresponds to 51.2 microseconds on a 10 Mbit/s system. A late collision is also considered a generic collision for purposes of other collision—related statistics. This counter is the same as the Late—Coll field in the output from the **show port** command, and can indicate a duplex mismatch among other things. For the duplex mismatch scenario, the late collision is seen on the half duplex side. As the half duplex side transmits, the full duplex side does not wait its turn and transmits simultaneously that causes a late collision. Late collisions can also indicate an Ethernet cable or segment that is too long. Collisions should not be seen on ports configured as full duplex.

- ♦ dot3StatsDeferredTx A count of frames for which the first transmission attempt on a particular port is delayed because the medium is busy. This count does not include frames involved in collisions. Deferred transmissions are normal in Ethernet, however, a high count can indicate a highly loaded segment.
- ◆ rxBadCode This is a count of received frames for which the preamble has a bad code. Check the device connected to the port.
- ♦ IfInDiscards This is a count of valid frames received, which are discarded by the forwarding process of the switch. This is the same counter as the In-Discard field in the output from the **show Mac** command. You see this when you receive traffic on a trunk for a specific VLAN while the switch does not have any other ports on that VLAN. You also see this counter increments when the destination address of the packet is learned on the port the packet is received on, or when a port is configured as a trunk and that trunk is blocking for VLANs.
- ◆ rxUndersizedPkts The total number of packets received that are less than 64 octets long, which excludes framing bits, but includes FCS octets, and are otherwise well formed. This counter is the same as the Undersize field in the output from the **show port** command. Check the device that sends out these frames.
- ♦ RxOversizePkts The total number of packets received that are longer than 1518 octets, which excludes framing bits, but includes FCS octets, and are otherwise well formed. Check the device connected to this port. This counter can increment when the device attached to the port has ISL encapsulation enabled, and the port itself does not. This counter also increments if you receive jumbo frames without the configuration of jumbo support on the port.
- ♦ dot3StatsAlignmentErrors The total number of packets received that have a length, which excludes framing bits, but includes FCS octets, of between 64 and 1518 octets, inclusive, but do not end with an even number of octets and have a bad FCS. This is the same counter as the Align-Err field in the output from the **show port** command. These errors usually indicate a physical problem, for example, bad port, or bad NIC card, but can also indicate a duplex mismatch. When the cable is first connected to the port, some of these errors can occur. Also, if there is a hub connected to the port, collisions between other devices on the hub can cause these errors.
- rxTotalDrops This counter includes a sum of these counters:
  - ♦ The number of bad packets because of a CRC error
  - ♦ A coding violation or sequence error.
  - ♦ The number of Color Blocking Logic (CBL) blocking drops
  - ♦ The number of instances of invalid encapsulation
  - ♦ The number of broadcast suppression drops
  - ♦ The number of drops because the packet length is less than 64 or greater than 1518 bytes

CBL refers to the spanning—tree state of a particular VLAN (color) on the port in question. If the port is in a spanning—tree blocking state for a particular VLAN, it is normal to drop packets received on that port for that VLAN.

11. Check for incrementing errors. Also, issue the **show logging buffer 1023** command, as shown in step 3, which syslogs any of these errors that occurs on a port. Some errors cause the module to be reset by firmware in order to recover. This command was introduced in CatOS release 5.5(12), 6.3(4), and 7.x.

esc-6509-c (enable) show intcounters 6/1

MasterInt : 0

PbUnderflow : 0

Parity : 0

InternalParity : 0

PacketCRC : 0

MdtifErr : 0

CpuifErr : 0

PnclChksum : 0

Issue the **show log** command in order to get the history of the module resets.

```
esc-6509-c (enable) show log 6

Module 6 Log:
Reset Count: 73
Reset History: Sun Oct 13 2002, 15:51:18
Sun Oct 13 2002, 08:44:51
Sat Oct 12 2002, 22:48:11
Fri Oct 11 2002, 23:47:30
```

12. The output from the **show spantree** [vlan] or **show spantree** [mod/port] can be used to verify the port is spanning-tree forwarding or blocking state. If the port is in blocking state, it does not forward traffic on that link.

```
esc-6509-c (enable) show spantree 175
VLAN 175
Spanning tree mode
Spanning tree type
Spanning tree enabled
                                             PVST+
                                             ieee
                                          00-30-94-93-e5-80
Designated Root
Designated Root Priority 1
Designated Root Cost 76
Designated Root Port 6/1
Root Max Age 20 sec Hello Time 2 sec Forward Delay 15 sec
Bridge ID MAC ADDR 00-d0-02-ea-1c-ae
Bridge ID Priority 32768
Bridge Max Age 20 sec Hello Time 2 sec Forward Delay 15 sec
                                         Vlan Port-State Cost Prio Portfast Channel_id
Port

      175
      forwarding
      4
      32 disabled 0

      175
      forwarding
      19
      32 disabled 0

      175
      blocking
      100
      32 disabled 0

      175
      forwarding
      4
      32 enabled 0

  3/1
  6/1
  6/2
16/1
```

13. Issue the **show test** <*module#>* command in order to check the results of the online diagnostic test performed at switch boot time or when a module is reset. The results of these tests can be used to determine if a hardware component failure is detected on the module. It is important to set the diagnostic mode to complete, otherwise all or some of the diagnostic tests are skipped. If a hardware component failure has occurred between now and the last switch or module reset, the diagnostics must be run again through a switch or module reset in order to detect the failure.

Complete these steps in order to run the diagnostic tests for a module:

a. Set the diagnostic mode to complete.

```
esc-6509-c (enable) set test diag complete Diagnostic level set to complete.
```

b. Reset the module.

```
esc-6509-c (enable) reset 6   
This command will reset module 6 and may disconnect your telnet session. Do you want to continue (y/n) [n]? y
```

c. View the diagnostic test result for the ports on the module for any indication of a failure. Also check for failures in groups of 12 ports, which suggests a Coil ASIC failure or Pinnacle port failure.

```
esc-6509-c (enable) show test 6
```

```
Diagnostic mode: complete (mode at next reset: complete)
Module 6: 48-port 10/100BaseTX Ethernet
Line Card Status for Module 6 : PASS
Port Status:
 Ports 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23
       25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47
      Line Card Diag Status for Module 6 (. = Pass, F = Fail, N = N/A)
Loopback Status [Reported by Module 2] :
 Ports 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23
 Ports 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47
InlineRewrite Status :
 Ports 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23
 Ports 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47
 ______
esc-6509-c (enable)
```

## **Command Outputs to Collect Before You Contact Cisco Technical Support**

The Output Interpreter Tool (registered customers only) (OIT) supports certain **show** commands. Use the OIT to view an analysis of **show** command output.

This list of commands was used in the previous troubleshooting of the WS–X6348 module connectivity issues in this document. Use these commands in order to log the troubleshooting output collected before you open a casein order to provide to the TAC engineer for analysis.

- show module < module #>
- show config <module#>
- show logging buffer 1023
- show cam dynamic <module#/port>
- show trunk < module #/port>
- show spantree < module #/port>
- show cdp neighbor < module #/port> detail

Repeat these three commands three times in order monitor counter increments, steps 8 through 10 only.

- show port < module #/port>
- show mac < module #/port>
- show counters < module #/port>
- show intcounters < module#/port> (Introduced in CatOS release 5.5(12), 6.3(4), and 7.x.)

```
show log <module#>
• set test diag complete

reset <module#>
```

**show test** < module #>

This is list of additional commands, which can be collected before you open a case with Cisco Technical Support for further troubleshooting by the TAC engineers or development engineers. These commands are hidden commands and should be used exactly as shown in order to troubleshoot the WS–X6348 module issues by the TAC engineers. You can alternatively provide these commands at the request of the TAC engineer who handles the case.

- show asicreg < module #/port> pinnacle errcounters
- show asicreg <module#/port> pinnacle pointers
- show asicreg <module#/port> pinnacle all
- show asicreg < module #/port> coil errcounters
- show asicreg < module #/port > coil pointers
- show asicreg < module #/port> coil 129
- show asicreg < module #/port> coil all
- show asicreg <module#/port> mii\_phy all

**Note**: This Command Line Interface (CLI) is currently does not work from CatOS release 6.3(8) and later. Refer to Cisco bug ID CSCdz26435 (registered customers only) for more information.

- **show ltl** <*module#/port>*
- show cbl <module#>

## **Related Information**

- Troubleshooting Catalyst 6500/6000 Series Switches Running CatOS on the Supervisor Engine and Cisco IOS on the MSFC
- Troubleshooting Hardware and Related Issues on the MSFC, MSFC2, and MSFC2a
- LAN Product Support Pages
- LAN Switching Support Page
- Technical Support & Documentation Cisco Systems

Contacts & Feedback | Help | Site Map

© 2014 – 2015 Cisco Systems, Inc. All rights reserved. Terms & Conditions | Privacy Statement | Cookie Policy | Trademarks of Cisco Systems, Inc.

Updated: Apr 24, 2007 Document ID: 29422