



Cisco Nexus 9000 ACI-Mode Switches Release Notes, Release 16.0(5)

Introduction

The Cisco NX-OS software for the Cisco Nexus 9000 series switches is a data center, purpose-built operating system designed with performance, resiliency, scalability, manageability, and programmability at its foundation. It provides a robust and comprehensive feature set that meets the requirements of virtualization and automation in data centers.

This release works only on Cisco Nexus 9000 Series switches in ACI mode.

This document describes the features, issues, and limitations for the Cisco NX-OS software. For the features, issues, and limitations for the Cisco Application Policy Infrastructure Controller (APIC), see the [Cisco Application Policy Infrastructure Controller Release Notes, Release 6.0\(5\)](#).

For more information about this product, see "Related Content."

Date	Description
September 30, 2024	Added CSCwm66473 to the list of Open Issues.
June 3, 2024	Release 16.0(5j) became available. Added the resolved bugs for this release.
April 8, 2024	In the Compatibility Information section, added: <ul style="list-style-type: none">If you are using Cisco Nexus 9500 switches in the ACI-mode with the N9K-SUP-A or N9K-SUP-A+ supervisor, because of increased memory usage associated with scalability enhancements in the Cisco ACI 6.0(5) release, do not install Cisco ACI 6.0(5) in your Cisco ACI fabrics. We are working on an optimization in a near-future Cisco ACI 6.0 maintenance release that will allow the N9K-SUP-A and N9K-SUP-A+ supervisors to operate in a normal memory condition. Contact your Cisco account team for additional information.
February 28, 2024	Release 16.0(5h) became available.

Supported Hardware

Table 1. Modular Spine Switches

Product ID	Description
N9K-C9408	Cisco Nexus 9408 modular chassis switch with up to 128 200/100-Gigabit (256 100-Gigabit by 200G-to-2x100G breakout) ports using N9K-X9400-16W or 64 400/200/100-Gigabit (256 100-Gigabit by 400G-to-4x100G breakout) ports using N9K-X9400-8D.
N9K-C9504	Cisco Nexus 9504 switch chassis
N9K-C9508	Cisco Nexus 9508 switch chassis
N9K-C9508-B1	Cisco Nexus 9508 chassis bundle with 1 supervisor module, 3 power supplies, 2 system controllers, 3 fan trays, and 3 fabric modules
N9K-C9508-B2	Cisco Nexus 9508 chassis bundle with 1 supervisor module, 3 power supplies, 2 system controllers, 3 fan trays, and 6 fabric modules
N9K-C9516	Cisco Nexus 9516 switch chassis

Table 2. Modular Spine Switch Line Cards

Product ID	Description	Maximum Quantity			
		Cisco Nexus 9408	Cisco Nexus 9504	Cisco Nexus 9508	Cisco Nexus 9516
N9K-X9400-8D	Cisco Nexus 9400 8-port 400 Gigabit QSFP-DD linecard expansion module	8	N/A	N/A	N/A
N9K-X9400-16W	Cisco Nexus 9400 16-port 200 Gigabit linecard expansion module	8	N/A	N/A	N/A
N9K-X9716D-GX	Cisco Nexus 9500 16-port 400 Gigabit Ethernet QSFP line card	N/A	4	8	16
N9K-X9736C-FX	Cisco Nexus 9500 36-port 40/100 Gigabit Ethernet Cloud Scale line card	N/A	4	8	16
N9K-X9736Q-FX	Cisco Nexus 9500 36-port 40 Gigabit Ethernet Cloud Scale line card	N/A	4	8	16
N9K-X9732C-EX	Cisco Nexus 9500 32-port, 40/100 Gigabit Ethernet Cloud Scale line card Note: The N9K-X9732C-EX line card cannot be used when a fabric module is installed in FM slot 25.	N/A	4	8	16

Table 3. Modular Spine Switch Fabric Modules

Product ID	Description	Minimum	Maximum
N9K-C9504-FM-G	Cisco Nexus 9508 cloud scale fabric module (400G capable)	4	5
N9K-C9508-FM-G	Cisco Nexus 9508 cloud scale fabric module (400G capable)	4	5
N9K-C9504-FM-E	Cisco Nexus 9504 cloud scale fabric module	4	5
N9K-C9508-FM-E	Cisco Nexus 9508 cloud scale fabric module	4	5
N9K-C9508-FM-E2	Cisco Nexus 9508 cloud scale fabric module	4	5
N9K-C9516-FM-E2	Cisco Nexus 9516 cloud scale fabric module	4	5

Table 4. Modular Spine Switch Fans

Product ID	Description
N9K-C9504-FAN2	Nexus 9500 4-slot fan tray (gen 2)
N9K-C9504-FAN-PWR	Nexus 9500 4-slot fan tray power card blank
N9K-C9504-FAN	Fan tray for Cisco Nexus 9504 chassis
N9K-C9508-FAN2	Nexus 9500 8-slot fan tray (gen 2)
N9K-C9508-FAN-PWR	Nexus 9500 8-slot fan tray power card blank

Product ID	Description
N9K-C9508-FAN	Fan tray for Cisco Nexus 9508 chassis
N9K-C9516-FAN	Fan tray for Cisco Nexus 9516 chassis

Table 5. Modular Spine Switch Supervisor and System Controller Modules

Product ID	Description
N9K-C9400-SUP-A	Cisco Nexus 9400 Series supervisor module
N9K-SUP-A+	Cisco Nexus 9500 Series supervisor module
N9K-SUP-B+	Cisco Nexus 9500 Series supervisor module
N9K-SUP-A	Cisco Nexus 9500 Series supervisor module
N9K-SUP-B	Cisco Nexus 9500 Series supervisor module
N9K-SC-A	Cisco Nexus 9500 Series system controller

Table 6. Fixed Spine Switches

Product ID	Description
N9K-C9364D-GX2A	Cisco Nexus 9300 platform switch with 64 400/100-Gigabit QSFP-DD ports and 2 1/10 SFP+ ports.
N9K-C9348D-GX2A	Cisco Nexus 9300 platform switch with 48 400/100-Gigabit QSFP-DD ports and 2 1/10 SFP+ ports.
N9K-C9332D-GX2B	Cisco Nexus 9300 platform switch with 32p 400/100-Gigabit QSFP-DD ports and 2p 1/10 SFP+ ports.
N9K-C93600CD-GX	Cisco Nexus 9300 platform switch with 28 10/40/100-Gigabit Ethernet QSFP28 ports (ports 1-28) and 8 10/40/100/400-Gigabit QSFP-DD ports (ports 29-36).
N9K-C9316D-GX	Cisco Nexus 9300 platform switch with 16 10/40/100/400-Gigabit QSFP-DD ports (ports 1-16).
N9K-C9332C	Cisco Nexus 9300 platform switch with 32 40/100-Gigabit QSFP28 ports and 2 SFP ports. Ports 25-32 offer hardware support for MACsec encryption.
N9K-C9364C-GX	Cisco Nexus 9300 platform switch with 64 100-Gigabit Ethernet QSFP28 ports, two management ports (one 10/100/1000BASE-T port and one SFP port), one console port (RS-232), and one USB port.
N9K-C9364C	Cisco Nexus 9300 platform switch with 64 40/100-Gigabit QSFP28 ports and two 1/10-Gigabit SFP+ ports. The last 16 of the QSFP28 ports are colored green to indicate that they support wire-rate MACsec encryption.

Table 7. Fixed Spine Switch Power Supply Units

Product ID	Description
NXA-PAC-2KW-PI	Nexus 9000 2KW AC power supply, port-side intake Note: This power supply is supported only by the Cisco Nexus 9364C-GX ACI-mode switch.
N9K-PAC-1200W	1200W AC power supply, port side intake pluggable Note: This power supply is supported only by the Cisco Nexus 93120TX and 9336PQ ACI-mode switches
N9K-PAC-1200W-B	1200W AC power supply, port side exhaust pluggable Note: This power supply is supported only by the Cisco Nexus 93120TX and 9336PQ ACI-mode switches
NXA-PAC-1200W-PE	1200W AC power supply, port side exhaust pluggable, with higher fan speeds for NEBS compliance
NXA-PAC-1200W-PI	1200W AC power supply, port side intake pluggable, with higher fan speeds for NEBS compliance
NXA-PAC-1100W-PE2	1100W AC power supply, port side exhaust pluggable
NXA-PAC-1100W-PI2	1100W AC power supply, port side intake pluggable
NXA-PAC-750W-PE	750W AC power supply, port side exhaust pluggable, with higher fan speeds for NEBS compliance Note: This power supply is supported only on release 14.2(1) and later.
NXA-PAC-750W-PI	750W AC power supply, port side intake pluggable, with higher fan speeds for NEBS compliance Note: This power supply is supported only on release 14.2(1) and later.
NXA-PDC-2KW-PI	Nexus 9000 2KW DC power supply, port-side intake Note: This power supply is supported only by the Cisco Nexus 9364C-GX ACI-mode switch.
NXA-PDC-1100W-PE	1100W AC power supply, port side exhaust pluggable
NXA-PDC-1100W-PI	1100W AC power supply, port side intake pluggable
NXA-PDC-930W-PE	930W AC power supply, port side exhaust pluggable
NXA-PDC-930W-PI	930W AC power supply, port side intake pluggable
NXA-PHV-2KW-PI	Nexus 9000 2KW AC power supply, port-side intake Note: This power supply is supported only by the Cisco Nexus 9364C-GX ACI-mode switch.
NXA-PHV-1100W-PE	1100W HVAC/HVDC power supply, port-side exhaust
NXA-PHV-1100W-PI	1100W HVAC/HVDC power supply, port-side intake
N9K-PUV-1200W	1200W HVAC/HVDC dual-direction airflow power supply

Table 8. Fixed Spine Switch Fans

Product ID	Description
N9K-C9300-FAN3	Burgundy port side intake fan
N9K-C9300-FAN3-B	Blue port side exhaust fan
N9K-C9400-FAN-PI	Burgundy port side intake fan
NXA-FAN-160CFM-PE	Blue port side exhaust fan
NXA-FAN-160CFM-PI	Burgundy port side intake fan
NXA-FAN-35CFM-PE	Blue port side exhaust fan
NXA-FAN-35CFM-PI	Burgundy port side intake fan

Table 9. Modular Leaf Switches

Product ID	Description
N9K-C9408	Cisco Nexus 9408 modular chassis switch with up to 128 200/100-Gigabit (256 100-Gigabit by 200G-to-2x100G breakout) ports using N9K-X9400-16W or 64 400/200/100-Gigabit (256 100-Gigabit by 400G-to-4x100G breakout) ports using N9K-X9400-8D.

Table 10. Modular Leaf Switch Line Cards

Product ID	Description	Maximum Quantity		
		Cisco Nexus 9504	Cisco Nexus 9508	Cisco Nexus 9516
N9K-X9400-8D	Cisco Nexus 9400 8-port 400 Gigabit QSFP-DD linecard expansion module	4	8	16
N9K-X9400-16W	Cisco Nexus 9400 16-port 200 Gigabit linecard expansion module	4	8	16

Table 11. Modular Leaf Switch Supervisor and System Controller Modules

Product ID	Description
N9K-C9400-SUP-A	Cisco Nexus 9400 Series supervisor module

Table 12. Fixed Leaf Switches

Product ID	Description
N9K-C9364D-GX2A	Cisco Nexus 9300 platform switch with 64 400/100-Gigabit QSFP-DD ports and 2 1/10 SFP+ ports.
N9K-C9348D-GX2A	Cisco Nexus 9300 platform switch with 48 400/100-Gigabit QSFP-DD ports and 2 1/10 SFP+ ports.
N9K-C9332D-GX2B	Cisco Nexus 9300 platform switch with 32p 400/100-Gigabit QSFP-DD ports and 2p 1/10

Product ID	Description
	SFP+ ports.
N9K-C9316D-GX	Cisco Nexus 9300 platform switch with 16 10/40/100/400-Gigabit QSFP-DD ports (ports 1-16).
N9K-C9364C-GX	Cisco Nexus 9300 platform switch with 64 100-Gigabit Ethernet QSFP28 ports, two management ports (one 10/100/1000BASE-T port and one SFP port), one console port (RS-232), and one USB port.
N9K-C93600CD-GX	Cisco Nexus 9300 platform switch with 28 10/40/100-Gigabit Ethernet QSFP28 ports (ports 1-28) and 8 10/40/100/400-Gigabit QSFP-DD ports (ports 29-36).
N9K-C93180YC-FX3	Cisco Nexus 9300 platform switch with 48 100M/1/10/25-Gigabit Ethernet SFP28 ports, 6 40/100-Gigabit QSFP28 ports, two management ports (one 10/100/1000BASE-T and one SFP+), one console port (RS-232), and one USB port.
N9K-C93180YC-FX3H	Cisco Nexus 9300 platform switch with 24 100M/1/10/25-Gigabit Ethernet SFP28 ports, 6 40/100-Gigabit QSFP28 ports, one management port (10/100/1000BASE-T), one console port (RS-232), and one USB port.
N9K-C93108TC-FX3H	Cisco Nexus 9300 platform switch with 24 100M/1/10-GBASE-T (copper) ports, 6 40/100-Gigabit QSFP28 ports, two management ports (one 10/100/1000BASE-T and one SFP+), one console port (RS-232), and one USB port.
N9K-C93108TC-FX3P	Cisco Nexus 9300 platform switch with 48 100M/1/10-GBASE-T (copper) ports, 6 40/100-Gigabit QSFP28 ports, two management ports (one 10/100/1000BASE-T and one SFP+), one console port (RS-232), and one USB port.
N9K-C93108TC-FX3	Cisco Nexus 9300 platform switch with 48 100M/1/10-GBASE-T (copper) ports, 6 40/100-Gigabit QSFP28 ports, two management ports (one 10/100/1000BASE-T and one SFP+), one console port (RS-232), and one USB port.
N9K-C9348GC-FX3	Cisco Nexus 9300 platform switch with 48 100M/1-GBASE-T (copper) ports, 4 1/10/25-Gigabit SFP28 ports, two 40/100G QSFP28 ports, two management ports (one 10/100/1000BASE-T and one SFP+), one console port (RS-232), and one USB port.
N9K-C93240YC-FX2	Cisco Nexus 9300 platform switch with 48 1/10/25-Gigabit Ethernet SFP28 ports and 12 40/100-Gigabit Ethernet QSFP28 ports. The N9K-C93240YC-FX2 is a 1.2-RU switch. Note: 10/25G-LR-S with QSA is not supported.
N9K-C93216TC-FX2	Cisco Nexus 9300 platform switch with 96 1/10GBASE-T (copper) front panel ports and 12 40 /100-Gigabit Ethernet QSFP28 spine-facing ports
N9K-C93360YC-FX2	Cisco Nexus 9300 platform switch with 96 1/10/25-Gigabit front panel ports and 12 40 /100-Gigabit Ethernet QSFP spine-facing ports. Note: The supported total number of fabric ports and port profile converted fabric links is 64.
N9K-C9336C-FX2-E	Cisco Nexus 9336C-FX2 Top-of-rack (ToR) switch with 36 fixed 40/100-Gigabit Ethernet QSFP28 spine-facing ports. Note: 1-Gigabit QSA is not supported on ports 1/1-6 and 1/33-36. The port profile feature supports downlink conversion of ports 31 through 34. Ports 35 and 36 can only be used as uplinks.
N9K-C9336C-FX2	Cisco Nexus 9336C-FX2 Top-of-rack (ToR) switch with 36 fixed 40/100-Gigabit Ethernet QSFP28 spine-facing ports. Note: 1-Gigabit QSA is not supported on ports 1/1-6 and 1/33-36. The port profile feature supports downlink conversion of ports 31 through 34. Ports 35 and 36 can only be used as

Product ID	Description
	uplinks.
N9K-C93108TC-FX	<p>Cisco Nexus 9300 platform switch with 48 1/10GBASE-T (copper) front panel ports and 6 fixed 40/100-Gigabit Ethernet QSFP28 spine-facing ports.</p> <p>Note: Incoming FCOE packets are redirected by the supervisor module. The data plane-forwarded packets are dropped and are counted as forward drops instead of as supervisor module drops.</p>
N9K-C93108TC-FX-24	<p>Cisco Nexus 9300 platform switch with 24 1/10GBASE-T (copper) front panel ports and 6 fixed 40/100-Gigabit Ethernet QSFP28 spine-facing ports.</p> <p>Note: Incoming FCOE packets are redirected by the supervisor module. The data plane-forwarded packets are dropped and are counted as forward drops instead of as supervisor module drops.</p>
N9K-C93180YC-FX	<p>Cisco Nexus 9300 platform switch with 48 1/10/25-Gigabit Ethernet SFP28 front panel ports and 6 fixed 40/100-Gigabit Ethernet QSFP28 spine-facing ports. The SFP28 ports support 1-, 10-, and 25-Gigabit Ethernet connections and 8-, 16-, and 32-Gigabit Fibre Channel connections.</p> <p>Note: Incoming FCOE packets are redirected by the supervisor module. The data plane-forwarded packets are dropped and are counted as forward drops instead of as supervisor module drops.</p>
N9K-C93180YC-FX-24	<p>Cisco Nexus 9300 platform switch with 24 1/10/25-Gigabit Ethernet SFP28 front panel ports and 6 fixed 40/100-Gigabit Ethernet QSFP28 spine-facing ports. The SFP28 ports support 1-, 10-, and 25-Gigabit Ethernet connections and 8-, 16-, and 32-Gigabit Fibre Channel connections.</p> <p>Note: Incoming FCOE packets are redirected by the supervisor module. The data plane-forwarded packets are dropped and are counted as forward drops instead of as supervisor module drops.</p>
N9K-C9348GC-FXP	<p>Cisco Nexus 9348GC-FXP switch with 48 100/1000-Megabit 1GBASE-T downlink ports, 4 10-/25-Gigabit SFP28 downlink ports, and 2 40-/100-Gigabit QSFP28 uplink ports.</p>
N9K-C93108TC-EX	<p>Cisco Nexus 9300 platform switch with 48 1/10GBASE-T (copper) front panel ports and 6 40/100-Gigabit QSFP28 spine facing ports.</p>
N9K-C93108TC-EX-24	<p>Cisco Nexus 9300 platform switch with 24 1/10GBASE-T (copper) front panel ports and 6 40/100-Gigabit QSFP28 spine facing ports.</p>
N9K-C93180LC-EX	<p>Cisco Nexus 9300 platform switch with 24 40-Gigabit front panel ports and 6 40/100-Gigabit QSFP28 spine-facing ports.</p> <p>The switch can be used as either a 24 40G port switch or a 12 100G port switch. If 100G is connected the Port1, Port 2 will be HW disabled.</p>
N9K-C93180YC-EX	<p>Cisco Nexus 9300 platform switch with 48 1/10/25-Gigabit front panel ports and 6-port 40/100 Gigabit QSFP28 spine-facing ports.</p>
N9K-C93180YC-EX-24	<p>Cisco Nexus 9300 platform switch with 24 1/10/25-Gigabit front panel ports and 6-port 40/100 Gigabit QSFP28 spine-facing ports.</p>

Table 13. Fixed Leaf Switch Power Supply Units

Product ID	Description
NXA-PAC-2KW-PE	Nexus 9000 2KW AC power supply, port-side exhaust

Product ID	Description
	Note: This power supply is supported only by the Cisco Nexus 9364C-GX ACI-mode switch.
NXA-PAC-2KW-PI	Nexus 9000 2KW AC power supply, port-side intake Note: This power supply is supported only by the Cisco Nexus 9364C-GX ACI-mode switch.
N9K-PAC-1200W	1200W AC power supply, port side intake pluggable Note: This power supply is supported only by the Cisco Nexus 93120TX and 9336PQ ACI-mode switches
N9K-PAC-1200W-B	1200W AC power supply, port side exhaust pluggable Note: This power supply is supported only by the Cisco Nexus 93120TX and 9336PQ ACI-mode switches
N9k-PAC-3000W-B	3000W AC power supply, port side intake
N9K-PAC-650W	650W AC power supply, port side intake pluggable
N9K-PAC-650W-B	650W AC power supply, port side exhaust pluggable
NXA-PAC-1200W-PE	1200W AC power supply, port side exhaust pluggable, with higher fan speeds for NEBS compliance
NXA-PAC-1200W-PI	1200W AC power supply, port side intake pluggable, with higher fan speeds for NEBS compliance
NXA-PAC-1100W-PE2	1100W AC power supply, port side exhaust pluggable
NXA-PAC-1100W-PI2	1100W AC power supply, port side intake pluggable
NXA-PAC-750W-PE	750W AC power supply, port side exhaust pluggable, with higher fan speeds for NEBS compliance Note: This power supply is supported only on release 14.2(1) and later.
NXA-PAC-750W-PI	750W AC power supply, port side intake pluggable, with higher fan speeds for NEBS compliance Note: This power supply is supported only on release 14.2(1) and later.
NXA-PAC-650W-PE	650W AC power supply, port side exhaust pluggable
NXA-PAC-650W-PI	650W AC power supply, port side intake pluggable
NXA-PAC-500W-PE	500W AC Power supply, port side exhaust pluggable
NXA-PAC-500W-PI	500W AC Power supply, port side intake pluggable
NXA-PAC-350W-PE	350W AC power supply, port side exhaust pluggable
NXA-PAC-350W-PI	350W AC power supply, port side intake pluggable
NXA-PDC-2KW-PE	Nexus 9000 2KW DC power supply, port-side exhaust Note: This power supply is supported only by the Cisco Nexus 9364C-GX ACI-mode switch.
NXA-PDC-2KW-PI	Nexus 9000 2KW DC power supply, port-side intake

Product ID	Description
	Note: This power supply is supported only by the Cisco Nexus 9364C-GX ACI-mode switch.
NXA-PDC-1100W-PE	1100W AC power supply, port side exhaust pluggable
NXA-PDC-1100W-PI	1100W AC power supply, port side intake pluggable
NXA-PDC-930W-PE	930W AC power supply, port side exhaust pluggable
NXA-PDC-930W-PI	930W AC power supply, port side intake pluggable
NXA-PDC-715W-PI	715W DC power supply, port side intake pluggable Note: This power supply is supported only by the Cisco Nexus 93108TC-FX3P ACI-mode switch.
NXA-PDC-440W-PE	440W DC power supply, port side exhaust pluggable, with higher fan speeds for NEBS compliance Note: This power supply is supported only by the Cisco Nexus 9348GC-FXP and 9348GC-FX3 ACI-mode switches.
NXA-PDC-440W-PI	440W DC power supply, port side intake pluggable, with higher fan speeds for NEBS compliance Note: This power supply is supported only by the Cisco Nexus 9348GC-FXP and 9348GC-FX3 ACI-mode switches.
NXA-PHV-2KW-PE	Nexus 9000 2KW AC power supply, port-side exhaust Note: This power supply is supported only by the Cisco Nexus 9364C-GX ACI-mode switch.
NXA-PHV-2KW-PI	Nexus 9000 2KW AC power supply, port-side intake Note: This power supply is supported only by the Cisco Nexus 9364C-GX ACI-mode switch.
NXA-PHV-1100W-PE	1100W HVAC/HVDC power supply, port-side exhaust
NXA-PHV-1100W-PI	1100W HVAC/HVDC power supply, port-side intake
NXA-PHV-350W-PE	350W HVAC/HVDC power supply, port-side exhaust
NXA-PHV-350W-PI	350W HVAC/HVDC power supply, port-side intake
N9K-PUV-1200W	1200W HVAC/HVDC dual-direction airflow power supply
N9K-PUV-3000W-B	3000W AC power supply, port side exhaust pluggable
UCSC-PSU-930WDC V01	Port side exhaust DC power supply compatible with all leaf switches
UCS-PSU-6332-DC	930W DC power supply, reversed airflow (port side exhaust)

Table 14. Fixed Leaf Switch Fans

Product ID	Description
N9K-C9300-FAN2	Burgundy port side intake fan
N9K-C9300-FAN2-B	Blue port side exhaust fan

Product ID	Description
N9K-C9300-FAN3	Burgundy port side intake fan
N9K-C9300-FAN3-B	Blue port side exhaust fan
N9K-C9400-FAN-PI	Burgundy port side intake fan
NXA-FAN-160CFM2-PE	Blue port side exhaust fan
NXA-FAN-160CFM2-PI	Burgundy port side intake fan
NXA-FAN-160CFM-PE	Blue port side exhaust fan
NXA-FAN-160CFM-PI	Burgundy port side intake fan
NXA-FAN-30CFM-B	Burgundy port side intake fan
NXA-FAN-30CFM-F	Blue port side exhaust fan
NXA-SFAN-30CFM-PE	Blue port side exhaust fan
NXA-SFAN-30CFM-PI	Burgundy port side intake fan
NXA-FAN-35CFM-PE	Blue port side exhaust fan
NXA-SFAN-35CFM-PE	Blue port side exhaust fan
NXA-FAN-35CFM-PI	Burgundy port side intake fan
NXA-SFAN-35CFM-PI	Burgundy port side intake fan
NXA-FAN-65CFM-PE	Blue port side exhaust fan
NXA-SFAN-65CFM-PE	Blue port side exhaust fan
NXA-FAN-65CFM-PI	Burgundy port side intake fan
NXA-SFAN-65CFM-PI	Burgundy port side intake fan

No Longer Supported Hardware

The following hardware is not supported:

Product Type	Product ID
Spine switch	N9K-C9336PQ
Modular spine switch line card	N9K-X9736PQ
Modular spine switch fabric module	N9K-C9504-FM N9K-C9508-FM N9K-C9516-FM

Product Type	Product ID
Leaf Switch	N9K-C93120TX
	N9K-C93128TX
	N9K-C9332PQ
	N9K-C9372PX
	N9K-C9372PX-E
	N9K-C9372TX
	N9K-C9372TX-E
	N9K-C9396PX
	N9K-C9396TX
Expansion Modules	N9K-M12PQ
	N9K-M6PQ
	N9K-M6PQ-E

Prior to upgrading your fabric to release 15.0(1) or later, replace these hardware elements in your fabric with other supported hardware. For modular spine switches, replace all unsupported modular line cards and fabric modules because these old generation line cards and fabric modules cannot be operated with newer line cards and fabric modules in the same chassis.

If you attempt to upgrade one of the unsupported hardware to the 15.0(1) release or later, the hardware will unsuccessfully attempt to boot three times, after which the switch will be reverted to the release that was previously installed on it. Therefore, the unsupported hardware will not upgrade to release 15.0(1) or later and the Cisco ACI fabric will operate with inconsistent firmware releases in each switch, which is why we recommend that you replace the unsupported hardware prior to performing the upgrade.

Supported FEX Models

For tables of the FEX models that the Cisco Nexus 9000 Series ACI Mode switches support, see the following webpage:

https://www.cisco.com/c/en/us/td/docs/switches/datacenter/nexus9000/hw/interoperability/fexmatrix/fex_tables.html

For more information on the FEX models, see the Cisco Nexus 2000 Series Fabric Extenders Data Sheet at the following location:

<https://www.cisco.com/c/en/us/products/switches/nexus-2000-series-fabric-extenders/datasheet-listing.html>

New Hardware Features

- The Cisco Nexus 9348GC-FX3 (N9K-C9348GC-FX3) is a 1-rack unit (RU) switch that supports 696 Gbps of bandwidth and over 517 Mpps. The 48 1GBASE-T downlink ports on the 9348GC-FX3 can be configured to work as 100-Mbps or 1-Gbps ports. The 4 ports of SFP28 can be configured as

1/10/25-Gbps and the 2 ports of QSFP28 can be configured as 40- and 100-Gbps ports, or a combination of 10-, 25-, 40, and 100-Gbps connectivity, offering flexible migration options.

- The Cisco Nexus 93108TC-FX3 (N9K-C93108TC-FX3) is a 1-rack unit (RU) switch that supports 2.16 Tbps of bandwidth and 1.2 Bpps. The 48 10GBASE-T downlink ports on the 93108TC-FX3 can be configured to work as 100-Mbps, 1-Gbps, or 10-Gbps ports. The uplink can support up to six 40- and 100-Gbps ports, or a combination of 10-, 25-, 40, and 100-Gbps connectivity, offering flexible migration options.

New Software Features

For new software features, see the [Cisco Application Policy Infrastructure Controller Release Notes, Release 6.0\(5\)](#).

Changes in Behavior

For the changes in behavior, see the [Cisco ACI Releases Changes in Behavior](#) document.

Open Issues

Click the bug ID to access the Bug Search tool and see additional information about the bug. The "Exists In" column of the table specifies the 16.0(5) releases in which the bug exists. A bug might also exist in releases other than the 16.0(5) releases.

Bug ID	Description	Exists in
CSCw66473	When using a N9K-C93108TC-FX3 in ACI mode, a diagnostic failure is displayed for RTC-TEST.	16.0(5h) through 16.0(7e).
CSCvg85886	When an ARP request is generated from one endpoint to another endpoint in an isolated EPG, an ARP glean request is generated for the first endpoint.	16.0(5h) and later
CSCvw89840	Traffic originating from a vPC TEP is dropped for Layer 2 multicast and unknown unicast traffic when pod redundancy is triggered.	16.0(5h) and later
CSCvy31805	The PBR destination group for bypass action is not properly programmed with PBR service graph for service devices behind I3out and with "bypass" action enabled to redirect to another service node in the graph. Now on bypass switchover, the traffic doesn't get redirected to the next service node in the chain.	16.0(5h) and later
CSCwc61780	N9K-C9408 ASIC SFP+ ports on N9K-C9400-SUP-A card are not supported.	16.0(5h) and later
CSCwd89607	When endpoint rogue detection or endpoint loop control is enabled with first hop security, the fabric might flag incorrect endpoint moves. This might lead to loss of traffic or the disabling of bridge domain learning.	16.0(5h) and later
CSCwf45328	BGP generates a core after deleting and restoring an SR MPLS infra L3Out node profile. This issue occurred with a scale configuration (800 VRF instances).	16.0(5h) and later
CSCwf74167	An endpoint does not receive a DHCP response when First-Hop Security (FHS) is enabled.	16.0(5h) and later

Bug ID	Description	Exists in
CSCwf78322	Customer sees the following fault for a spine switch: F920312 or customer notices low memory condition in fixed spines with 16GB memory	16.0(5h) and later
CSCwf80004	Upon upgrade to the 16.0(3) release from an earlier release, using SSH to connect to the switch does not succeed. The SSH client end displays the "connection refused" message.	16.0(5h) and later
CSCwf80004	Upon upgrade to the 16.0(5) release from an earlier release, using SSH to connect to the switch does not succeed. The SSH client end displays the "connection refused" message.	16.0(5h) and later
CSCwf87280	All the conditions for priority flow control (PFC) are met, such as consistent congestion or PFC frames received. But, PFC frames are not generated on the front panel interface to slow down the sender.	16.0(5h) and later
CSCwf93802	Traffic loss is observed because an endpoint is not synced from leaf1 to leaf2.	16.0(5h) and later
CSCwh15088	4X25G-CU (<=3m) links do not come on certain ports of GX2 platforms with AN on-enforce. When auto-negotiation is enabled on 25G speed on GX2 retimer ports, the link does not come up.	16.0(5h) and later
CSCwh39489	The ACI-mode switch 16.0(3) release and later causes high memory utilization of 16GB modular spine switch supervisors. The Cisco APIC raises a fault with either of the following fault codes: F4341 F4342	16.0(5h) and later
CSCwi01017	This bug is only applicable when scale of the switch config is high. Repeated tech-support collection causes the log files to be completely deleted from under /mnt/ifc/log/.	16.0(5h) and later
CSCwi87437	MFDM MTS buffer is stuck, causing the MFDM process to not process updates coming from other processes. This can impact broadcast programming on the downstream component, which causes a BUM issue.	16.0(5h) and later
CSCwi89535	A leaf switch crashes due to the following reason: Reason: Reset triggered due to HA policy of ResetService: sdkhal hap resetVersion : xxx	16.0(5h) and later
CSCwj16816	Virtual machines behind remote leaf switches are not able to resolve to a bridge domain gateway when spine switch connectivity is lost.	16.0(5h) and later
CSCwj19730	A port gets stuck on an old VLAN.	16.0(5h) and later
CSCwj23667	- Enabling MACsec between ACI and Nexus devices. - The MACsec session needs to be established. - CDP neighbors are not available for the interface, but the LLDP neighbors are correct.	16.0(5h) and later

Bug ID	Description	Exists in
CSCwj30440	The supervisor of a leaf switch silently reloads.	16.0(5h) and later
CSCwj40048	When running " show power inline" from the default shell, ibash, " not well-formed (invalid token)" is returned and not the expected interface power usage	16.0(5h) and later
CSCwj44601	The Infoblox servers are in across pods and they form a cluster using VRRP. When PBR vzAny is enabled, the Infoblox cluster stops working. When PBR vzAny is disabled, the Infoblox cluster starts working again.	16.0(5h) and later
CSCwj49728	After reloading, a spine switch advertises its routes to the Inter Pod Network (IPN) with a MED 200 for approximately 10 minutes. This prevents IPN traffic from being routed to the reloaded spine switch immediately after the reload. Approximately 10 minutes after the reload, this MED value 200 is removed. However, there are some cases where this MED 200 may not be set. If MED 200 is not applied to its routes, traffic may be routed to a spine switch that is not yet ready, resulting in dropped packets.	16.0(5h) and later
CSCwj50547	N9K-C93360YC-FX2 running 16.0(3e) ACI code crashes and generates LLDP core file.	16.0(5h) and later
CSCwj51461	A host has connectivity loss when the destination host fail overed using UCS Fabric Failover. Issue happens when PVLAN and Micro segmentation are enabled on EPG with Proxy-ARP flag.	16.0(5h)
CSCwj51461	A host has connectivity loss when the destination host fail overed using UCS Fabric Failover. Issue happens when PVLAN and Micro segmentation are enabled on EPG with Proxy-ARP flag.	16.0(5h) and later
CSCwj51767	There is a kernel panic resulting in a switch reset or crash: Reason: Kernel Panic System version: 15.2(8e) Service: system crash	16.0(5h) and later
CSCwj59815	FM-G fabric modules (potentially other modules as well) fail to initialize when inserted into a switch running 16.0(2h). From the fabric modules' console logs, the partitions appear to be different than what is seen on other fabric modules that have been successfully initialized.	16.0(5h) and later
CSCwj67989	When configuring a /32 subnet for " IP Data-plane Learning disabled" under an EPG, the subnet is deployed to a leaf switch with the EPG as well as the EPGs' consumed source EPG by the contract. As a result, it adds a remote endpoint (XR EP) to the hardware and causes any received iVXLAN packet with an inner destination to hit the /32 endpoint, which gets dropped by the loop prevention ACL. This /32 endpoint may become stale even after the /32 EPG subnet has been deleted from the Cisco APIC.	16.0(5h) and later
CSCwj76543	N9K-X9736C-FX line cards may randomly reload, which can impact traffic due to the type of reload that occurs.	16.0(5h) and later
CSCwj87708	An ACI-mode spine switch forwards traffic to the wrong service leaf switch and causes traffic loss when using active/standby Layer 1 policy-based redirect and a failover occurs.	16.0(5h) and later

Bug ID	Description	Exists in
CSCwj94677	Auto-negotiation does not work on a Cisco N9K-C9408 switch that has one of the following line-card expansion modules (LEMs): <ul style="list-style-type: none"> • N9K-X9400-8D • N9K-X9400-16W 	16.0(5h) and later
CSCwk23291	A Cisco ACI-mode switch regularly sends UDP packets from port 1534 to the broadcast address of the out-of-band management interface. This can be observed by using the tcpdump command from any switch whose out-of-band management interface address belongs to same subnet. This kind of broadcast will not reach the Cisco ACI-mode switch OS because iptables by default deny it.	16.0(5h) and later
CSCwk37834	A leaf switch will crash due to aclqos hap reset.	16.0(5h) and later
CSCwk39458	A leaf switch crashes due to FCPC hap reset.	16.0(5h) and later
CSCwk47025	When querying for OID 1.3.6.1.2.1.1.2.0 for N9K-C9332D-GX2B, the incorrect value is returned by the switch if role is spine: <ul style="list-style-type: none"> - If role is spine: it will return 1.3.6.1.4.1.9.12.3.1.3.1570 (Nexus 9336PQ) - If role is leaf: it will return 1.3.6.1.4.1.9.12.3.1.3.2403 (Nexus 9332D-GX2B) 	16.0(5h) and later

Resolved Issues

Click the bug ID to access the Bug Search tool and see additional information about the bug. The "Fixed In" column of the table specifies whether the bug was resolved in the base release or a patch release.

Bug ID	Description	Fixed in
CSCwj59815	FM-G fabric modules (potentially other modules as well) fail to initialize when inserted into a switch running 16.0(2h). From the FM's console logs, we can observe that the partitions appear to be different than what is seen on other FM's that have been successfully initialized.	16.0(5j)
CSCwd65255	If an EPLD update is triggered on an affected SUP, the SUP will not automatically boot. The supervisor's STS LED may be blinking yellow and console may not be responsive.	16.0(5h)
CSCwe90254	When a TechSupport file for a 9500 chassis with FM-E2 fabric modules is collected, the CLI commands needed to be run for the NX-OS TechSupport are wrong.	16.0(5h)
CSCwf15461	Whenever an EPG is configured with multiple physical domains using overlapping VLAN pools, following some configuration such as deleting/adding a pool to a domain or adding/removing a domain in an EPG, the fabric encapsulation (VXLAN ID used for VLAN encapsulation) might be mismatched. F3274 will be seen and traffic to a vPC server might be impacted in that EPG.	16.0(5h)
CSCwf53105	"vsh" process generates multiple core files on switches after starting OnDemand Techsupport collection for leaf switches.	16.0(5h)
CSCwf57396	The 30 second input rate and 30 second output rate show values beyond 30 seconds for an interface that is disabled.	16.0(5h)

Bug ID	Description	Fixed in
CSCwf58246	In the case of large network instability with a lot of flaps, the APIC may disable hardware learning and disable COOP to endpoint notification on a leaf switch. This can lead to a COOP entry on a spine switch pointing to a "wrong" location. This is a very rare scenario.	16.0(5h)
CSCwf88948	After a system controller switchover, there is no ping/ssh response from the spine switch in-band management for several minutes. It seems that there is an issue with path between SUP and linecard.	16.0(5h)
CSCwf92861	EVPN type 5 routes get stuck at the overlay-1 EVPN table with a refcount of 1. Because of this, the cleanup thread cannot clean up the VRF instance and remains stuck at deletion.	16.0(5h)
CSCwf95702	The vsh -c 'show ntp peer-status' command may show an already-deleted NTP server entry. Sometimes, it may cause issue with NTP getting synced to the latest added server. This behavior is not consistent.	16.0(5h)
CSCwh03684	HAL has high CPU utilization.	16.0(5h)
CSCwh07391	Traffic coming from ISN or IPN may get misclassified as iTraceroute or will not preserve CoS correctly. On any FM that was reloaded, dot1p preserve may have not been set correctly post reload.	16.0(5h)
CSCwh13845	After a spine switch stateful reload/upgrade, you may observe traffic drops in the ACI fabric. In case there are remote leaf switches, you may see remote leaf switches not forming a tunnel with the spine switches. On the upgraded/stateful reloaded spine switches, check the output of " show coop internal info global" . If you observe the "Local Adjacency" as "Citizen" , then you have hit this defect.	16.0(5h)
CSCwh15691	fvL3EpDef is not removed after adjacency gets updated.	16.0(5h)
CSCwh18633	Multicast convergence is slower than expected. Applications that use multicast for time sensitive tasks, for example, keep alive for HA, will be impacted and cause subsequent service impact.	16.0(5h)
CSCwh19186	Configuring a MAC address of " FF:FF:FF:FF:FF:FF" under the L3Out SVI MAC Exception Group causes all MAC addresses learned in the associated external bridge domain to be excluded from rogue endpoint control. All MAC addresses from such SVIs will be marked as rogue for 30 seconds only if they move 3,000 times in 10 minutes.	16.0(5h)
CSCwh21375	When an SNMP GET is sent with the OID " iso.3.6.1.2.1.1.2.0" on a leaf/spine switch, the leaf/spine switch reponds with the faulty value 1.3.6.1.4.1.9.12.3.1.3.1570.	16.0(5h)
CSCwh21417	A switch's power supply is functioning properly even though the following error message persists: LOG_LOCAL0-2-SYSTEM_MSG [E4204936][transition][critical][sys] %PLATFORM-2-PS_UNSUPPORTED: Detected an unsupported power supply 2 Unknown for CISCO Multilayer Switch (Serial number LIT233023Z5)	16.0(5h)

Bug ID	Description	Fixed in
CSCwh26304	<p>++ The temperature data measured by the sensors are not displayed in GUI correctly for PID: N9K-C9364C-GX.</p> <p>++ the customer wants to see the temperature data under the next menu item: ../Fabric/Inventory/PodN/Node-XXX/Chassis/Supervisor Modules/Slot1/Equipment Sensors/1..5/Stats</p> <p>++ Show Topology view does not show anything! (Normalized Temperature, Current Temperature) as per the images attached to the case by comparing them with another model where there are no issues.</p> <p>++ Show Table View shows the data (Normalized Temperature, Current Temperature), but the Timestamp field does not show a meaningful value: 0NaN/NaN/NaN NaN:NaN:NaN</p>	16.0(5h)
CSCwh29782	A Cisco Nexus 9000 switch in the ACI-mode cannot negotiate on a 1G link due to the "Remote Fault seen" error.	16.0(5h)
CSCwh46624	There is a Layer 1 connectivity issue between a N9K-C93180YC-FX3 device and Dell Power Edge FX2s server chassis. The servers have an Intel X710 NIC. The 10G ports fail to come when the Dell side I/O module is flapped. This issue is not specific to port/SFP/speed and may happen with 25G or other port types with other remote devices.	16.0(5h)
CSCwh46885	When the fabric nodes are using ACI release 15.2(7g), the N9K-C9348 switch fails during the POAP DHCP discover phase.	16.0(5h)
CSCwh48737	Bounce entry for an endpoint may point to wrong TEP address, leading to connectivity failures.	16.0(5h)
CSCwh60203	There is unexpected behavior with the DHCP relay when using DHCP relay with the "DHCP server preference" feature. The issue is triggered by deleting one of the bridge domains that use the DHCP relay label. This causes the Cisco APIC to remove the DHCP server's SVI from all switches involved in the change, which means that all other bridge domains on those switches can no longer do DHCP relay.	16.0(5h)
CSCwh64732	The hardware is DOM-capable (Y), but DOM information is not showing up for the command: "show int ethernet 1/X transceiver details"	16.0(5h)
CSCwh67412	ACI displays fan speed percentage incorrectly.	16.0(5h)
CSCwh71704	When one of the vPC peers reloads and comes up, the non-reloaded peer is seen to be suspending the vPC interfaces.	16.0(5h)
CSCwh72876	The EPM process crashed when there was no disk space was available at /var/sysmgr/tmp_logs/.	16.0(5h)
CSCwh73346	After removing service graph association from a shared L3Out contract, traffic will be dropped on the border leaf switch.	16.0(5h)
CSCwh73782	Traffic that is forwarded by a spine switch toward a leaf switch is dropped by one of the spine switch's fabric modules. On this fabric module where packets are dropped, the TEP of the destination leaf switch is not programmed in FIB and HAL.	16.0(5h)
CSCwh75559	tcpdump on the tahoe0 interface randomly has incorrect time stamps (sometimes an old time stamp).	16.0(5h)
CSCwh76977	The device reloaded unexpectedly because of "sdkhal hap reset" after the "show platform internal hal l3 intfdb" command was executed in command-line interface in vsh_lc mode.	16.0(5h)

Bug ID	Description	Fixed in
CSCwh76996	While inserting or reloading a leaf switch, its vPC peer will try to bring up the vPC when the peer IP is 0.0.0.0.	16.0(5h)
CSCwh77467	SDKHAL crashes are seen on an ACI spine N9K-C9364D-GX2A switch running 15.2(7g). A core file is also generated.	16.0(5h)
CSCwh77567	If there is a single endpoint move local-to-remote or remote-to-local within the detection interval, then the move count is not reset. This may lead to an endpoint being incorrectly marked as rogue on the node.	16.0(5h)
CSCwh78987	Breakout ports configured as port channel members are no longer part of the port channel post clean reload.	16.0(5h)
CSCwh79632	Uplink ports flap frequently on leaf switch. Eth1/51 may be observed to flap more frequently than other ports.	16.0(5h)
CSCwh81430	After reloading a Cisco 93108TC-FX3P switch that was upgraded to a release earlier than 5.2(8h), random copper/RJ45 interfaces might not come up. This can occur for port 1/48 on multiple leaf switches in the fabric. A fault F0532 is raised for these ports on the APIC GUI, with the reason being shown as "not-connected".	16.0(5h)
CSCwh84746	An endpoint moves between POD1 and POD2. On POD3, the endpoint is going to the FREEZE state and on POD1 and POD2 its not moving to the FREEZE state after the move stops.	16.0(5h)
CSCwh91351	<p>There is an issue with FX3 switches and the following scenario:</p> <ul style="list-style-type: none"> * Leaf 207-208 on a vPC. * The source and destination are connected to these pairs through a vPC. * The source and destination are on different VRF instances. So, VRF leaking is in place to communicate with these two endpoints. <p>When return traffic hits leaf switch 207, communication is successful. When return traffic hits leaf switch 208, communication is dropped. When communication is dropped, it hits rule 5048.</p>	16.0(5h)
CSCwh92659	An endpoint may become out of sync between spine switches in different pods. Each spine switch may point to a local pod TEP as the tunnel next hop for the leaf switches. The issue does not get cleared until the incorrect pod spine switches age/delete their COOP entry.	16.0(5h)
CSCwi04853	While configuring the "Spine Supervisor Module On-Demand Diag" from the APIC GUI, the spine switch will unexpectedly reboot due to a device_test hap reset. After the switch reboots, F0404 will be raised for each diagnostic.	16.0(5h)
CSCwi05613	This issue can be seen when BGP L3Outs have import or export route maps configured using match statements based on regular expressions (for example matching of regex: (65[2-3]01:102..). If BGP regex communities are configured, both the deny and permit statements are not always honored and there are unexpected results. From the BGP and routing table perspective, routes come in with an extended community value that are being permitted incorrectly or denied incorrectly based on the ACI route map that is configured.	16.0(5h)

Bug ID	Description	Fixed in
CSCwi17513	This issue occurs when a border leaf switch reboots and rejoins the fabric after reloading. At this point, both port tracking and PIM overload timers are active, preventing the rebooted border leaf switch from sending PIM hellos. After the PIM overload timer expires, the border leaf switch starts sending PIM hello through the fabric tunnel interface and stripe-winners on other border leaf switches are recalculated. If at this point the L3Out is still down due to port tracking, it can happen that for some VRF instances, the PIM join over the fabric tunnel interface to the other border leaf switch is not sent. This leads to a multicast traffic loss until the next PIM join is sent.	16.0(5h)
CSCwi18214	A leaf switch repeatedly reloads due to policyelem abnormal exit and HAP reset.	16.0(5h)
CSCwi21299	When there is an FCOE interface flap or speed change due to inserting an SFP, this affects the dataplane of other FCOE interfaces that share the same MAC address.	16.0(5h)
CSCwi31656	<ol style="list-style-type: none"> SPAN traffic does not go out from the destination SPAN port after the peer interface flaps. MAC credit goes to zero for the SPAN destination port after the peer interface flaps. You also might see the native interface that is part of same MAC address hardware in which the SPAN destination port is configured stop sending control plane packets because the CPU buffer is exhausted by the SPAN destination port. 	16.0(5h)

Known Issues

Click the bug ID to access the Bug Search tool and see additional information about the bug. The "Exists In" column of the table specifies the 16.0(5) releases in which the bug exists. A bug might also exist in releases other than the 16.0(5) releases.

Bug ID	Description	Exists in
CSCuo37016	When configuring the output span on a FEX Hif interface, all the layer 3 switched packets going out of that FEX Hif interface are not spanned. Only layer 2 switched packets going out of that FEX Hif are spanned.	16.0(5h) and later
CSCup65586	The show interface command shows the tunnel's Rx/Tx counters as 0.	16.0(5h) and later
CSCup82908	The show vpc brief command displays the wire-encap VLAN Ids and the show interface .. trunk command displays the internal/hardware VLAN IDs. Both VLAN IDs are allocated and used differently, so there is no correlation between them.	16.0(5h) and later
CSCup92534	Continuous "threshold exceeded" messages are generated from the fabric.	16.0(5h) and later
CSCuq39829	Switch rescue user ("admin") can log into fabric switches even when TACACS is selected as the default login realm.	16.0(5h) and later
CSCuq46369	An extra 4 bytes is added to the untagged packet with Egress local and remote SPAN.	16.0(5h) and later
CSCuq77095	When the command show ip ospf vrf <vrf_name> is run from bash on the border leaf switch, the checksum field in the output always shows a zero value.	16.0(5h) and later

Bug ID	Description	Exists in
CSCug92447	When modifying the L2Unknown Unicast parameter on a Bridge Domain (BD), interfaces on externally connected devices may bounce. Additionally, the endpoint cache for the BD is flushed and all endpoints will have to be re-learned.	16.0(5h) and later
CSCur81822	The access-port operational status is always "trunk" .	16.0(5h) and later
CSCus18541	An MSTP topology change notification (TCN) on a flood domain (FD) VLAN may not flush endpoints learned as remote where the FD is not deployed.	16.0(5h) and later
CSCus43167	Any TCAM that is full, or nearly full, will raise the usage threshold fault. Because the faults for all TCAMs on leaf switches are grouped together, the fault will appear even on those with low usage. Workaround: Review the leaf switch scale and reduce the TCAM usage. Contact TAC to isolate further which TCAM is full.	16.0(5h) and later
CSCut59020	If Backbone and NSSA areas are on the same leaf switch, and default route leak is enabled, Type-5 LSAs cannot be redistributed to the Backbone area.	16.0(5h) and later
CSCuu66310	If a bridge domain "Multi Destination Flood" mode is configured as "Drop" , the ISIS PDU from the tenant space will get dropped in the fabric.	16.0(5h) and later
CSCuv57302	Atomic counters on the border leaf switch do not increment for traffic from an endpoint group going to the Layer 3 out interface.	16.0(5h) and later
CSCuv57315	Atomic counters on the border leaf switch do not increment for traffic from the Layer 3 out interface to an internal remote endpoint group.	16.0(5h) and later
CSCuv57316	TEP counters from the border leaf switch to remote leaf switch nodes do not increment.	16.0(5h) and later
CSCux97329	With the common pervasive gateway, only the packet destination to the virtual MAC is being properly Layer 3 forwarded. The packet destination to the bridge domain custom MAC fails to be forwarded. This is causing issues with certain appliances that rely on the incoming packets' source MAC to set the return packet destination MAC.	16.0(5h) and later
CSCuy02543	Bidirectional Forwarding Detection (BFD) echo mode is not supported on IPv6 BFD sessions carrying link-local as the source and destination IP address. BFD echo mode also is not supported on IPv4 BFD sessions over multihop or VPC peer links.	16.0(5h) and later
CSCuy06749	Traffic is dropped between two isolated EPGs.	16.0(5h) and later
CSCuy22288	The iping command's replies get dropped by the QOS ingress policer.	16.0(5h) and later
CSCuy61018	The default minimum bandwidth is used if the BW parameter is set to "0" , and so traffic will still flow.	16.0(5h) and later
CSCuz13529	With the N9K-C93180YC-EX switch, drop packets, such as MTU or storm control drops, are not accounted for in the input rate calculation.	16.0(5h) and later
CSCuz47058	SAN boot over a virtual port channel or traditional port channel does not work.	16.0(5h) and later
CSCvb39965	Slow drain is not supported on FEX Host Interface (HIF) ports.	16.0(5h) and later

Bug ID	Description	Exists in
CSCvd11146	Bridge domain subnet routes advertised out of the Cisco ACI fabric through an OSPF L3Out can be relearned in another node belonging to another OSPF L3Out on a different area.	16.0(5h) and later
CSCvn94400	There is a traffic blackhole that lasts anywhere from a few seconds to a few mins after a border leaf switch is restored.	16.0(5h) and later
CSCvp04772	During an upgrade on a dual-SUP system, the standby SUP may go into a failed state.	16.0(5h) and later
CSCvq71034	There is a policy drop that occurs with L3Out transit cases.	16.0(5h) and later
CSCvr12912	A switch reloads due to a sysmgr heartbeat failure and sysmgr HAP reset.	16.0(5h) and later
CSCvr61096	<p>In a port group that has ports of mixed speeds, the first port in the port group that has valid optics present and is not in the admin down state is processed. The ports that come up later are brought up if they are using the same speed; otherwise, they are put in the hw-disabled state.</p> <p>For example, if ports 14 and 15 are up and are using the 100G speed, then if ports 13 and 16 are using the 40G speed, these ports will be put in the hw-disabled state. After reloading or upgrading, you might not have the same interfaces in the port group in the UP state and in the hw-disabled state as you did before the reload or upgrade.</p>	16.0(5h) and later
CSCvt61851	When MPLS VRF stats (egress) is compared with Layer 2 interface egress stats, we can find that the packet count matches for both while there could be a discrepancy with the bytes count.	16.0(5h) and later
CSCvu02371	The DEI value in a Layer 2 header of spanned Tx packets from an MPLS interface might not have the same value as the actual data path packet.	16.0(5h) and later
CSCvu42069	The event log shows VTEP tunnel down and up events. The down time and up time are the same, and there is no fault message.	16.0(5h) and later
CSCvx62362	When a service device is connected behind an L3Out in 2-arm mode with both legs on the same leaf switch, tracking packets get dropped.	16.0(5h) and later
CSCvy06135	The leaf switch techsupport with a specified time range fails when the space "/mnt/ifs/log" gets filled up by more than 80%.	16.0(5h) and later
CSCwv71586	400G port is automatically broken out into 4 breakout ports. After performing online insertion and removal (OIR) of a 400G transceiver, one of the breakout ports has the "SFP not inserted" or "SFP missing" state.	16.0(5h) and later
CSCvz84284	Upon deletion of a VRF instance that has a micro-BFD port channel in the "up" state, all the member ports of the port channel that were in the "up" state prior to the VRF instance deletion go to the "down" state. The micro-BFD port channels never transition back to the "up" state.	16.0(5h) and later
CSCwa78857	Cisco APIC allows you to configure any number of DHCP relay addresses. However, the maximum number of relay address that can be supported is 16 from a switch. If a 17th DHCP provider is added to the DHCP label, it will not be used even if one of first 16 DHCP providers is removed.	16.0(5h) and later

Bug ID	Description	Exists in
CSCwd64518	A virtual machine has connectivity loss when the destination virtual machine is migrated using vMotion. This issue happens only if microsegmentation is enabled on the EPG.	16.0(5h) and later
CSCwd95467	With N9K-X9400-16W LEM, a pair of odd and even number ports such as port 1/1 and 1/2 must work as the same link type: downlink or fabric link because of CSCwd95467. This consideration is not applicable to N9K-X9400-8D.	16.0(5h) and later
CSCwe08179	A peer vPC leg goes down after swapping a 16 port LEM with an 8 port LEM. The following error shows in the "show vpc" output: "Peer does not have corresponding vPC". The leg on the peer switch immediately comes up, but traffic is still disrupted.	16.0(5h) and later
CSCwe33967	After deleting or adding a VRF instance, the BGP peer session picks up the default timer values instead of the configured values. This is evidenced by the holdIntvl and kaIntvl values in the bgpPeerEntry managed object in the policy engine. The issue happens intermittently.	16.0(5h) and later
CSCwe41508	<p>As a result of new features, certain PIDs running ACI release 6.0(5) software in 32-bit architecture will see increase in memory consumption and their process virtual address space.</p> <p>This particular issue is seen with a trigger of 500 bridge domain (BD) deletions and addition in a scale configuration of 64k fvrspace scale, 1980 BDs along with 123k policycam entries. In release 6.0(5) with a 32-bit image, process memory could run close to the limit of 4GB."</p> <p>In this scenario, EPM is running at 3.9GB. During the vlan creation as part of the above trigger, EPM attempts to retrieve sclass corresponding to the vlan through DME and DME access is failing. Memory map failures are seen through the instance of EPM.</p> <p>The DME failure may be due to mmap failures.</p>	16.0(5h) and later
CSCwe97510	When AN On-Enforce is enabled on QDD-4ZQ100G-COPPER breakouts on switches with -GX or -GX2 in the product ID, the links do not come up.	16.0(5h) and later
CSCwf88389	After an SVI member port flap, ECMP hashing no longer uses the flapped SVI's path and instead uses other SVI paths.	16.0(5h) and later
CSCwf90351	With the rogue endpoint feature, a MAC address gets flagged as rogue. A leaf switch ignores any further moves of the rogue endpoint for 15 minutes, which can cause an outage. Traffic coming from a FEX vPC carries the Physical Tunnel Endpoint (PTEP) as the source IP address of the outer header (SIPo) instead of the FEX vPC Tunnel Endpoint (TEP).	16.0(5h) and later
N/A	Load balancers and servers must be Layer 2 adjacent. Layer 3 direct server return is not supported. If a load balancer and servers are Layer 3 adjacent, then they have to be placed behind the Layer 3 out, which works without a specific direct server return virtual IP address configuration.	16.0(5h) and later
N/A	IPN should preserve the CoS and DSCP values of a packet that enters IPN from the ACI spine switches. If there is a default policy on these nodes that change the CoS value based on the DSCP value or by any other mechanism, you must apply a policy to prevent the CoS value from being changed. At the minimum, the remarked CoS value should not be 4, 5, 6, or 7. If CoS is changed in the IPN, you must configure a DSCP-CoS translation policy in the APIC for the pod that translates queuing class information of the packet into the DSCP value in the outer header of the iVXLAN packet. You can also embed CoS by enabling CoS preservation. For more information, see the Cisco APIC and QoS KB article.	16.0(5h) and later

Bug ID	Description	Exists in
N/A	<p>The following properties within a QoS class under "Global QoS Class policies" should not be changed from their default value and is only used for debugging purposes:</p> <p>MTU (default - 9216 bytes)</p> <p>Queue Control Method (default - Dynamic)</p> <p>Queue Limit (default - 1522 bytes)</p> <p>Minimum Buffers (default - 0)</p>	16.0(5h) and later
N/A	<p>The modular chassis Cisco ACI spine nodes, such as the Cisco Nexus 9508, support warm (stateless) standby where the state is not synched between the active and the standby supervisor modules. For an online insertion and removal (OIR) or reload of the active supervisor module, the standby supervisor module becomes active, but all modules in the switch are reset because the switchover is stateless. In the output of the show system redundancy status command, warm standby indicates stateless mode.</p>	16.0(5h) and later
N/A	<p>When a recommissioned APIC controller rejoins the cluster, GUI and CLI commands can time out while the cluster expands to include the recommissioned APIC controller.</p>	16.0(5h) and later
N/A	<p>If connectivity to the APIC cluster is lost while a switch is being decommissioned, the decommissioned switch may not complete a clean reboot. In this case, the fabric administrator should manually complete a clean reboot of the decommissioned switch.</p>	16.0(5h) and later
N/A	<p>Before expanding the APIC cluster with a recommissioned controller, remove any decommissioned switches from the fabric by powering down and disconnecting them. Doing so will ensure that the recommissioned APIC controller will not attempt to discover and recommission the switch.</p>	16.0(5h) and later
N/A	<p>Multicast router functionality is not supported when IGMP queries are received with VxLAN encapsulation.</p>	16.0(5h) and later
N/A	<p>IGMP Querier election across multiple Endpoint Groups (EPGs) or Layer 2 outsiders (External Bridged Network) in a given bridge domain is not supported. Only one EPG or Layer 2 outside for a given bridge domain should be extended to multiple multicast routers if any.</p>	16.0(5h) and later
N/A	<p>The rate of the number of IGMP reports sent to a leaf switch should be limited to 1000 reports per second.</p>	16.0(5h) and later
N/A	<p>Unknown IP multicast packets are flooded on ingress leaf switches and border leaf switches, unless "unknown multicast flooding" is set to "Optimized Flood" in a bridge domain. This knob can be set to "Optimized Flood" only for a maximum of 50 bridge domains per leaf switch.</p> <p>If "Optimized Flood" is enabled for more than the supported number of bridge domains on a leaf switch, follow these configuration steps to recover:</p> <p>Set "unknown multicast flooding" to "Flood" for all bridge domains mapped to a leaf switch.</p> <p>Set "unknown multicast flooding" to "Optimized Flood" on needed bridge domains.</p>	16.0(5h) and later
N/A	<p>Traffic destined to Static Route EP VIPs sourced from N9000 switches (switches with names that end in -EX) might not function properly because proxy route is not programmed.</p>	16.0(5h) and later

Bug ID	Description	Exists in
N/A	An iVXLAN header of 50 bytes is added for traffic ingressing into the fabric. A bandwidth allowance of (50/50 + ingress_packet_size) needs to be made to prevent oversubscription from happening. If the allowance is not made, oversubscription might happen resulting in buffer drops.	16.0(5h) and later
N/A	An IP/MAC Ckt endpoint configuration is not supported in combination with static endpoint configurations.	16.0(5h) and later
N/A	An IP/MAC Ckt endpoint configuration is not supported with Layer 2-only bridge domains. Such a configuration will not be blocked, but the configuration will not take effect as there is no Layer 3 learning in these bridge domains.	16.0(5h) and later
N/A	An IP/MAC Ckt endpoint configuration is not supported with external and infra bridge domains because there is no Layer 3 learning in these bridge domains.	16.0(5h) and later
N/A	An IP/MAC Ckt endpoint configuration is not supported with a shared services provider configuration. The same or overlapping prefix cannot be used for a shared services provider and IP Ckt endpoint. However, this configuration can be applied in bridge domains having shared services consumer endpoint groups.	16.0(5h) and later
N/A	An IP/MAC Ckt endpoint configuration is not supported with dynamic endpoint groups. Only static endpoint groups are supported.	16.0(5h) and later
N/A	No fault will be raised if the IP/MAC Ckt endpoint prefix configured is outside of the bridge domain subnet range. This is because a user can configure bridge domain subnet and IP/MAC Ckt endpoint in any order and so this is not error condition. If the final configuration is such that a configured IP/MAC Ckt endpoint prefix is outside all bridge domain subnets, the configuration has no impact and is not an error condition.	16.0(5h) and later
N/A	Dynamic deployment of contracts based on instrImmedcy set to onDemand/lazy not supported; only immediate mode is supported.	16.0(5h) and later
N/A	When a server and load balancer are on the same endpoint group, make sure that the Server does not generate ARP/GARP/ND request/response/solicits. This will lead to learning of LB virtual IP (VIP) towards the Server and defeat the purpose of DSR support.	16.0(5h) and later
N/A	Direct server return is not supported for shared services. Direct server return endpoints cannot be spread around different virtual routing and forwarding (VRF) contexts.	16.0(5h) and later
N/A	Configurations for a virtual IP address can only be /32 or /128 prefix.	16.0(5h) and later
N/A	Client to virtual IP address (load balancer) traffic always will go through proxy-spine because fabric data-path learning of a virtual IP address does not occur.	16.0(5h) and later
N/A	GARP learning of a virtual IP address must be explicitly enabled. A load balancer can send GARP when it switches over from active-to-standby (MAC changes).	16.0(5h) and later
N/A	Learning through GARP will work only in ARP Flood Mode.	16.0(5h) and later

Compatibility Information

- For the supported optics per device, see the [Cisco Optics-to-Device Compatibility Matrix](#).

- 100mb optics, such as the GLC-TE, are supported in 100mb speed only on -EX, -FX, -FX2, and -FX3 switches, such as the N9K-C93180YC-EX and N9K-C93180YC-FX, and only on front panel ports 1/1-48. 100mb optics are not supported any other switches. 100mb optics cannot be used on EX or FX leaf switches on port profile converted downlink ports (1/49-52) using QSA.
- This release supports the hardware and software listed on the ACI Ecosystem Compatibility List, and supports the Cisco AVS, release 5.2(2)SV3(3.10).
- To connect the N2348UPQ to ACI leaf switches, the following options are available:
 - Directly connect the 40G FEX ports on the N2348UPQ to the 40G switch ports on the ACI leaf switches
 - Break out the 40G FEX ports on the N2348UPQ to 4x10G ports and connect to the 10G ports on all other ACI leaf switches

Note: A fabric uplink port cannot be used as a FEX fabric port.

- To connect the Cisco APIC (the controller cluster) to the Cisco ACI fabric, it is required to have a 10G interface on the ACI leaf switch.
- We do not qualify third party optics in Cisco ACI. When using third party optics, the behavior across releases is not guaranteed, meaning that the optics might not work in some NX-OS releases. Use third party optics at your own risk. We recommend that you use Cisco SFPs, which have been fully tested in each release to ensure consistent behavior.
- On Cisco ACI platforms, 25G copper optics do not honor auto-negotiation, and therefore auto-negotiation on the peer device (ESX or standalone) must be disabled to bring up the links.
- 10G GLC-T transceivers cannot be used for the initial bring up between the Cisco APIC and a leaf switch. The fabric discovery process cannot occur because the transceiver needs the SFP media type to be pushed from the Cisco APIC to bring up the link.
- You cannot use the 100 megabit speed of a switch's QSFP28 ports.
- If you are using 10G copper cables, when you configure a link level policy, you must set the **Physical Media Type** to "SFP 10G TX."
- If you are using Cisco Nexus 9500 switches in the ACI-mode with the N9K-SUP-A or N9K-SUP-A+ supervisor, because of increased memory usage associated with scalability enhancements in the Cisco ACI 6.0(5) releases, do not install Cisco ACI 6.0(5) in your Cisco ACI fabrics. We are working on an optimization in a near-future Cisco ACI 6.0 maintenance release that will allow the N9K-SUP-A and N9K-SUP-A+ supervisors to operate in a normal memory condition. Contact your Cisco account team for additional information.
- Do not use dual-rate optics (SFP-10/25G-LR-S and SFP-10/25G-CSR-S) for a Cisco APIC-to-switch fabric connection.

Table 15. Modular Spine Switch Fabric Module Compatibility Information

Product ID	N9K-C9504-FM-G	N9K-C9508-FM-G	N9K-C9504-FM-E	N9K-C9508-FM-E	N9K-C9508-FM-E2	N9K-C9516-FM-E2
N9K-X9716D-GX	4	4	No	No	4	4
N9K-X9736C-FX	5	5	5	5	5	5

Product ID	N9K-C9504-FM-G	N9K-C9508-FM-G	N9K-C9504-FM-E	N9K-C9508-FM-E	N9K-C9508-FM-E2	N9K-C9516-FM-E2
N9K-X9736Q-FX	5	5	5	5	5	5
N9K-X9732C-EX	No	No	4	4	4	4

Table 16. Modular Spine Switch Line Card Compatibility Information

Product ID	Compatibility Information
N9K-X9716D-GX	If you connect a Cisco N9K-X9716D-GX breakout port to a non-Cisco ACI peer, such as a standalone switch capable of 100G, the link comes up and LLDP is detected. However, this is an unsupported scenario, but no fault is generated.

Table 17. Fixed Spine Switches Compatibility Information

Product ID	Compatibility Information
N9K-C9408	<p>This switch has the following limitations:</p> <ul style="list-style-type: none"> You cannot use the 200G speed nor 2x100G breakout speed in this release. This consideration is applicable to both N9K-X9400-16W and N9K-X9400-8D LEMs. PTP and SyncE are not supported. With the N9K-X9400-16W LEM, the pair of port in the same row must be used as either 40/100G or 10G with QSA. For example, if 1/1 is used as 10G with QSA, 1/2 can be used as 10G with QSA but not as 40/100G. If a 40/100G optic is inserted to 1/2, the port becomes hw-disabled. This consideration is not applicable to N9K-X9400-8D LEM. The SFP management port on the supervisor module does not work. Each chassis supports up to 32 high power optics in total: QDD-400G-ZR-S and QDD-400G-ZRP-S
N9K-C9364C	<p>You can deploy multipod or Cisco ACI Multi-Site separately (but not together) on the Cisco N9K-9364C switch starting in the 3.1 release. You can deploy multipod and Cisco ACI Multi-Site together on the Cisco N9K-9364C switch starting in the 3.2 release.</p> <p>A 930W-DC PSU (NXA-PDC-930W-PE or NXA-PDC-930W-PI) is supported in redundancy mode if 3.5W QSFP+ modules or passive QSFP cables are used and the system is used in 40C ambient temperature or less; for other optics or a higher ambient temperature, a 930W-DC PSU is supported only with 2 PSUs in non-redundancy mode.</p> <p>1-Gigabit QSA is not supported on ports 1/49-64.</p> <p>This switch supports the following PSUs:</p> <ul style="list-style-type: none"> NXA-PAC-1200W-PE NXA-PAC-1200W-PI N9K-PUV-1200W NXA-PDC-930W-PE NXA-PDC-930W-PI
N9K-C9364D-GX2A	Ports 65 and 66 do not support flow telemetry nor NetFlow.
N9K-C9348D-GX2A	Ports 65 and 66 do not support flow telemetry nor NetFlow.
N9K-C9332D-GX2B	<p>The following information applies to this switch:</p> <ul style="list-style-type: none"> Ports 33 and 34 do not support the following things: <ul style="list-style-type: none"> 10G GLC-T optics 100M speed

Product ID	Compatibility Information
	<ul style="list-style-type: none"> ◦ Flow telemetry ◦ NetFlow ◦ MACsec, PTP, and SyncE ◦ PFC and no-drop classes ◦ FC and FCoE mode ● Port-side exhaust (PE) fans are not supported.

Table 18. Fixed Leaf Switches Compatibility Information

Product ID	Compatibility Information
N9K-C9408	<p>This switch has the following limitations:</p> <ul style="list-style-type: none"> ● You cannot use the 200G speed nor 2x100G breakout speed in this release. This consideration is applicable to both N9K-X9400-16W and N9K-X9400-8D LEMs. ● Only ports 1 to 6 support port profiles for both the 8D and 16C line-card Ethernet modules (LEM). ● If a port profile is already configured on a LEM and you replace that LEM with a different LEM type, the switch sets the status of the new LEM to "lem-type-mismatch" and Cisco APIC raises the following fault: "Module operational state changed to LEM type mismatch, please make sure no other lem-type port profile is configured in this slot." To use the new LEM type, you must reload the chassis. ● PTP and SyncE are not supported. ● With the N9K-X9400-16W LEM, the pair of port in the same row must be used as either 40/100G or 10G with QSA. For example, if 1/1 is used as 10G with QSA, 1/2 can be used as 10G with QSA but not as 40/100G. If a 40/100G optic is inserted to 1/2, the port becomes hw-disabled. This consideration is not applicable to N9K-X9400-8D LEM. ● You cannot configure breakout on even ports of the N9K-X9400-16W LEM. ● After you configure breakout on an odd port of the N9K-X9400-16W LEM, the next even port will be HW-disabled. ● You see the LEM type mismatch status if you swap LEMs when a port profile configuration exists. ● The SFP management port on the supervisor module does not work. ● Some ARP to gateway packets get dropped with the reason of "ACL_DROP." ● Each chassis supports up to 32 high power optics in total: QDD-400G-ZR-S and QDD-400G-ZRP-S ● FEXes are not supported.
N9K-C9364C-GX	<p>This switch has the following limitations:</p> <ul style="list-style-type: none"> ● For ports 1-64, every 4 ports 1-4,5-8...60-64 is referred as a quad. Each quad can be operated only with a fixed speed. For example: Ports 1-4 can operate only on 10G or 40/100G. Similarly, ports 60-64 can operate only on 10G or 40/100G. ● You cannot use mixed speeds of 10G and 40G, 10G and 100G, or 40G and 100G in a quad (1-4,5-8...21-24). Based on the port bring up sequence, the port in the quad where a speed mismatch is detected will be HW disabled. ● If there is a speed mismatch in a quad even when the ports are configured in the disabled state, the working links in that quad might get into the HW disabled state upon upgrading and reloading because the mixed speed is brought up first before the admin down configuration is pushed. As a result, you must manually perform the shut and no shut commands on the ports to bring up the links. ● Breakout of 4x25G or 4x10G ports is not supported. ● There is a lane selector button on the hardware. The button is used for the breakout port LED status. Because breakout is not supported, this button does nothing. ● The maximum number of downlinks is 30 x 4 ports 10/25G (breakout) + 2 ports (1/61-62) = 122 ports. Ports 1/63 and 1/64 are reserved for fabric links and even numbers from 1/1 to 1/60 are error-disabled. ● 1G and 100MB speeds are not supported.
N9K-C93600CD-GX	<p>This switch has the following limitations:</p>

Product ID	Compatibility Information
	<ul style="list-style-type: none"> • Auto-negotiation is not supported with 10G speed on ports 1 through 24. • For ports 1 through 24, every 4 ports (1-4, 5-8, 9-12, and so on, referred to as a "quad") will operate at a fixed speed. That is, all 4 ports will operate in 10G or 40/100G; you cannot mix the speeds. • Mixed speeds of 10G and 40G or 10G and 100G in a quad is not supported. Based on the port bring up sequence, the port in the quad where the speed mismatch is detected will be HW disabled. • If there is a speed mismatch in a quad even though the ports are configured in the disabled state, the working links in that quad might get into the HW disabled state upon upgrading or reloading, as the mixed speed is brought up first before admin down config is pushed. To avoid this issue, you must manually use the shut and no shut commands on the working ports to bring up the links. For more information, see bug CSCvr61096. • Ports 25-26 and ports 27-28 (port groups of 2 ports each) will operate in a fixed speed within the respective group, and you cannot mismatch the speed. • Uplink ports 29 to 36 do not have a mixed speed restriction; you can toggle the speed for the bidirectional ports. • For ports 1 to 28, even if you convert any ports to uplink with bidirectional optics, you cannot toggle the speed, as it will introduce mixed speeds and will disturb the neighboring ports. • For ports 1 to 28, if any of the ports are converted to uplink with bidirectional optics, the ports will stay in the not connected state if the peer is a 40G link. • 4x10 and 4x25 breakout is supported on ports 25-28 and 29-34 (port profile converted downlinks). • Ports 25-26 and 27-28 form respective port pairs, and each pair can operate with 4x10, 10G, or 4x25G speed. • The Hardware Abstraction Layer (HAL) will spike and the console can hang if a port channel or vPC exists when overlying breakout ports are deleted. To avoid this issue, delete the PC or vPC before deleting the overlying breakout policy. • The maximum number of downlinks is 12 x 4 ports 10/25G (breakout) + 10 x 4 ports 10/25G (breakout) = 88 ports. Ports 35 and 36 are reserved for fabric links and 12 ports are error-disabled. • 1G and 100M speeds are not supported.
N9K-C9364D-GX2A	Ports 65 and 66 do not support flow telemetry nor NetFlow.
N9K-C9348D-GX2A	Ports 65 and 66 do not support flow telemetry nor NetFlow.
N9K-C9332D-GX2B	<p>The following information applies to this switch:</p> <ul style="list-style-type: none"> • Ports 33 and 34 do not support the following things: <ul style="list-style-type: none"> ◦ 10G GLC-T optics ◦ 100M speed ◦ Flow telemetry ◦ NetFlow ◦ MACsec, PTP, and SyncE ◦ PFC and no-drop classes ◦ FC and FCoE mode • Port-side exhaust (PE) fans are not supported.
N9K-C9316D-GX	Auto-negotiation and forward error correction are not supported when you use this switch is as a leaf switch.
N9K-C93180YC-FX3	<p>The following information applies to this switch:</p> <ul style="list-style-type: none"> • The following ports are not supported: <ul style="list-style-type: none"> ◦ Antenna ◦ GNSS ◦ GPS ◦ PPS ◦ PTP GM

Product ID	Compatibility Information
	<ul style="list-style-type: none"> When using the SFP-10G-T-X optic on a port, you must either leave the physically adjacent ports empty or only deploy direct attach cables (DACs) to those ports. If you insert a non-DAC optic in a port that is physically adjacent to a port that is capable of supporting a 10G GLC-T optic, and later you insert a GLC-T optic into the GLC-T-capable port, the GLC-T optic will be hw-disabled. To bring up the GLC-T port, you must shut down the non-DAC port, then run the shut and no shut commands on the GLC-T port. When using this switch as a FEX, QoS stats (as shown by the "show queuing interface ethernet" CLI command) are not supported on the parent Cisco ACI leaf switch.
N9K-C9336C-FX2	<p>The following information applies to this switch:</p> <ul style="list-style-type: none"> On older N9K-C9336C-FX2 switches, auto-negotiation does not work on port eth1/4. You can check whether your switch is older by using the following command: <pre>ifav124-leaf5# cat /sys/kernel/cisco_board_info/hw_change_bits</pre> <p>0x0</p> <p>The output of "0x0" indicates an older switch that has this limitation.</p> You can apply a breakout configuration on ports 1 through 34, which can give up to 136 (34*4) server or downlink ports. Port profiles and breakouts are not supported on the same port. However, you can apply a port profile to convert a fabric port to a downlink, and then apply a breakout configuration. If you apply a breakout configuration on 34 ports, you must configure a port profile on the ports first, which requires you to reboot the leaf switch. If you apply a breakout configuration to a leaf switch for multiple ports at the same time, it can take up to 10 minutes for the hardware of 34 ports to be programmed. The ports remain down until the programming completes. The delay can occur for a new configuration, after a clean reboot, or during switch discovery. Ports 7 through 32 have a link bring up time of less than 2 seconds with QSFP-100G-LR4 and QSFP-40/100G-SRBD optics. For all other ports, the link up time for these optics is between 5 to 14 seconds. In the following situations, the link bring up time will also be greater than 2 seconds: <ul style="list-style-type: none"> After reloading the leaf switch When using port optical insertion and removal (OIR) When performing bulk flaps of ports on the leaf switch
N9K-C93240YC-FX2	<p>The following information applies when this switch is configured with port-side intake airflow:</p> <ul style="list-style-type: none"> Ports 2, 6, 8, 12, 14, 18, 20, 24, 26, 30, 32, 36, 38, 42, 44, and 48 are capable of supporting the 10G GLC-T optic. After you configure these ports to use 10G GLC-T, these ports will be the only ports on the switch that can support 10G GLC-T. Without being configured for 10G GLC-T, these ports behave as normal switch ports. If you configure port 12 for 10G GLC-T, then ports 9 and 15 must either be left empty or must deploy only DACs. Ports 49 through 60 can be configured to use 10G GLC-T or can be normal ports, regardless of the configuration of the other ports. <p>The following information applies when this switch is configured with port-side exhaust airflow:</p> <ul style="list-style-type: none"> Ports 6, 12, 18, 24, 30, 36, 42, and 48 are capable of supporting the 10G GLC-T optic. After you configure these ports to use 10G GLC-T, these ports will be the only ports on the switch that can support 10G GLC-T. Without being configured for 10G GLC-T, these ports behave as normal switch ports. If you configure port 12 for 10G GLC-T, then ports 9, 11, and 15 must either be left empty or must deploy only DACs. Ports 49 through 60 can be configured to use 10G GLC-T or can be normal ports, regardless of the configuration of the other ports. <p>The following information applies regardless of the airflow direction:</p> <ul style="list-style-type: none"> When using the SFP-10G-T-X optic on a port, you must either leave the physically adjacent ports empty or only deploy direct attach cables (DACs) to those ports. If you insert a non-DAC optic in a port that is physically adjacent to a port that is capable of supporting a 10G GLC-T optic, and later you insert a GLC-T optic into the GLC-T-capable port, the GLC-T optic

Product ID	Compatibility Information
	will be hw-disabled. To bring up the GLC-T port, you must shut down the non-DAC port, then run the shut and no shut commands on the GLC-T port.
N9K-C93360YC-FX2	<p>The following information applies to this switch:</p> <ul style="list-style-type: none"> • Ports 1, 4, 5, 8, 41, 44, 45, 48, 49, 52, 53, 56, 57, 60, 61, 64, 65, 68, 69, 72, 73, 76, 77, 80, 81, 84, 85, 88, 89, 92, 93, and 96 are capable of supporting the 10G GLC-T optic. After you configure these ports to use 10G GLC-T, these ports will be the only ports on the switch that can support 10G GLC-T. Without being configured for 10G GLC-T, these ports behave as normal switch ports. • If you configure port 60 for 10G GLC-T, then ports 58, 59, and 62 must either be left empty or must deploy only DACs. • Ports 97 through 108 can be configured to use 10G GLC-T or can be normal ports, regardless of the configuration of the other ports. • When using the SFP-10G-T-X optic on a port, the you must either leave the physically adjacent ports empty or only deploy direct attach cables (DACs) to those ports. • If you insert a non-DAC optic in a port that is physically adjacent to a port that is capable of supporting a 10G GLC-T optic, and later you insert a GLC-T optic into the GLC-T-capable port, the GLC-T optic will be hw-disabled. To bring up the GLC-T port, you must shut down the non-DAC port, then run the shut and no shut commands on the GLC-T port.
N9K-C9348GC-FXP	<p>This switch supports the following PSUs:</p> <ul style="list-style-type: none"> • NXA-PAC-350W-PI • NXA-PAC-350W-PE • NXA-PAC-1100W-PI • NXA-PAC-1100W-PE <p>The following information applies to this switch:</p> <ul style="list-style-type: none"> • Incoming FCOE packets are redirected by the supervisor module. The data plane-forwarded packets are dropped and are counted as forward drops instead of as supervisor module drops. • This switch does not support the 10G GLC-T optic. • The PSU SPROM is not readable when the PSU is not connected. The model displays as "UNKNOWN" and status of the module displays as "shutdown."
N9K-C93180YC-FX-24	This switch does not support the 10G GLC-T optic.
N9K-C93180YC-FX	<p>The following information applies to this switch:</p> <ul style="list-style-type: none"> • Auto-negotiation is not supported if you convert port 51 or 52 to a downlink and you have 40/100G copper cables connected. • Ports 1, 4, 5, 8, 9, 12, 13, 16, 37, 40, 41, 44, 45, and 48 are capable of supporting the 10G GLC-T and SFP-10G-T-X optics. After you configure these ports to use 10G GLC-T or SFP-10G-T-X, these ports will be the only ports on the switch that can support 10G GLC-T or SFP-10G-T-X. Without being configured for 10G GLC-T nor SFP-10G-T-X, these ports behave as normal switch ports. • If you configure port 12 for 10G GLC-T, then ports 10, 11, and 14 must either be left empty or must deploy only DACs. • Ports 49 through 54 can be configured to use 10G GLC-T or can be normal ports, regardless of the configuration of the other ports. • When using the SFP-10G-T-X optic on a port, the you must either leave the physically adjacent ports empty or only deploy direct attach cables (DACs) to those ports. • If you insert a non-DAC optic in a port that is physically adjacent to a port that is capable of supporting a 10G GLC-T optic, and later you insert a GLC-T optic into the GLC-T-capable port, the GLC-T optic will be hw-disabled. To bring up the GLC-T port, you must shut down the non-DAC port, then run the shut and no shut commands on the GLC-T port.
N9K-C93180YC-EX-24	This switch does not support the 10G GLC-T optic.
N9K-C93180YC-EX	<p>The following information applies to this switch:</p> <ul style="list-style-type: none"> • The following FEC modes are not supported on N9K-C93180YC-EX ports 1 through 48 when running in 25G speed:

Product ID	Compatibility Information
	<ul style="list-style-type: none"> ◦ cl91-rs-fec ◦ cons16-rs-fec ◦ ieee-rs-fec • Auto-negotiation is not supported if you convert port 51 or 52 to a downlink and you have 40/100G copper cables connected. • Ports 1, 4, 5, 8, 9, 12, 13, 16, 37, 40, 41, 44, 45, and 48 are capable of supporting the 10G GLC-T and SFP-10G-T-X optics. After you configure these ports to use 10G GLC-T or SFP-10G-T-X, these ports will be the only ports on the switch that can support 10G GLC-T or SFP-10G-T-X. Without being configured for 10G GLC-T nor SFP-10G-T-X, these ports behave as normal switch ports. • If you configure port 12 for 10G GLC-T, then ports 10, 11, and 14 must either be left empty or must deploy only DACs. • Ports 49 through 54 can be configured to use 10G GLC-T or can be normal ports, regardless of the configuration of the other ports. • When using the SFP-10G-T-X optic on a port, the you must either leave the physically adjacent ports empty or only deploy direct attach cables (DACs) to those ports. • If you insert a non-DAC optic in a port that is physically adjacent to a port that is capable of supporting a 10G GLC-T optic, and later you insert a GLC-T optic into the GLC-T-capable port, the GLC-T optic will be hw-disabled. To bring up the GLC-T port, you must shut down the non-DAC port, then run the shut and no shut commands on the GLC-T port.
N9K-C93180LC-EX	<p>This switch has the following limitations:</p> <ul style="list-style-type: none"> • The top and bottom ports must use the same speed. If there is a speed mismatch, the top port takes precedence and bottom port will be error disabled. Both ports both must be used in either the 40 Gbps or 10 Gbps mode. • Ports 26 and 28 are hardware disabled. • This release supports 40 and 100 Gbps for the front panel ports. The uplink ports can be used at the 100 Gbps speed. • Port profiles and breakout ports are not supported on the same port.

Table 19. CloudSec Support

Product ID	Hardware Type	CloudSec Support
N9K-C9332C	Switch	Yes, only on the last 8 ports
N9K-C9364C	Switch	Yes, only on the last 16 ports
N9K-X9736C-FX	Line Card	Yes, only on the last 8 ports

- The following additional CloudSec compatibility restrictions apply:
 - CloudSec only works with spine switches in Cisco ACI and only works between sites managed by Cisco ACI Multi-Site.
 - For CloudSec to work properly, all of the spine switch links that participate in Cisco ACI Multi-Site must have MACsec/CloudSec support.

Usage Guidelines

- The current list of protocols that are allowed (and cannot be blocked through contracts) include the following. Some of the protocols have SrcPort/DstPort distinction. See the [Cisco Application Policy Infrastructure Controller Release Notes, Release 6.0\(5\)](#) for policy information.

- UDP DestPort 161: SNMP. These cannot be blocked through contracts. Creating an SNMP ClientGroup with a list of Client-IP Addresses restricts SNMP access to only those configured Client-IP Addresses. If no Client-IP address is configured, SNMP packets are allowed from anywhere.
 - TCP SrcPort 179: BGP
 - TCP DstPort 179: BGP
 - OSPF
 - UDP DstPort 67: BOOTP/DHCP
 - UDP DstPort 68: BOOTP/DHCP
 - IGMP
 - PIM
 - UDP SrcPort 53: DNS replies
 - TCP SrcPort 25: SMTP replies
 - TCP DstPort 443: HTTPS
 - UDP SrcPort 123: NTP
 - UDP DstPort 123: NTP
- Leaf switches and spine switches typically have memory utilization of approximately 70% to 75%, even in a new deployment where no configuration has been pushed. This amount of memory utilization is due to the Cisco ACI-specific processes, which take up more memory compared to a standalone Nexus deployment. The memory utilization is not a problem unless it exceeds 90%. You can open a Cisco TAC case to troubleshoot proactively when memory utilization is more than 85%.
 - Leaf and spine switches from two different fabrics cannot be connected regardless of whether the links are administratively kept down.
 - If you replace a switch where a Cisco APIC is connected, make sure that the Cisco APIC has two connections: one active/backup to the replaced switch and another to a different switch. Otherwise, the Cisco APIC will not join the cluster after you replace the switch.
 - Only one instance of OSPF (or any multi-instance process using the managed object hierarchy for configurations) can have the write access to operate the database. Due to this, the operational database is limited to the default OSPF process alone and the multipodInternal instance does not store any operational data. To debug an OSPF instance ospf-multipodInternal, use the command in VSH prompt. Do not use ibash because some ibash commands depend on Operational data stored in the database.
 - When you enable or disable Federal Information Processing Standards (FIPS) on a Cisco ACI fabric, you must reload each of the switches in the fabric for the change to take effect. The configured scale profile setting is lost when you issue the first reload after changing the FIPS configuration. The switch remains operational, but it uses the default port scale profile. This issue does not happen on subsequent reloads if the FIPS configuration has not changed.
 - FIPS is supported on Cisco NX-OS release 15.2(2) or later. If you must downgrade the firmware from a release that supports FIPS to a release that does not support FIPS, you must first disable FIPS on the Cisco ACI fabric and reload all of the switches in the fabric.

- You cannot use the breakout feature on a port that has a port profile configured on a Cisco N9K-C93180LC-EX switch. With a port profile on an access port, the port is converted to an uplink, and breakout is not supported on an uplink. With a port profile on a fabric port, the port is converted to a downlink. Breakout is currently supported only on ports 1 through 24.
- On Cisco 93180LC-EX Switches, ports 25 and 27 are the native uplink ports. Using a port profile, if you convert ports 25 and 27 to downlink ports, ports 29, 30, 31, and 32 are still available as four native uplink ports. Because of the threshold on the number of ports (which is maximum of 12 ports) that can be converted, you can convert 8 more downlink ports to uplink ports. For example, ports 1, 3, 5, 7, 9, 13, 15, 17 are converted to uplink ports and ports 29, 30, 31 and 32 are the 4 native uplink ports, which is the maximum uplink port limit on Cisco 93180LC-EX switches.
 - When the switch is in this state and if the port profile configuration is deleted on ports 25 and 27, ports 25 and 27 are converted back to uplink ports, but there are already 12 uplink ports on the switch in the example. To accommodate ports 25 and 27 as uplink ports, 2 random ports from the port range 1, 3, 5, 7, 9, 13, 15, 17 are denied the uplink conversion; the chosen ports cannot be controlled by the user. Therefore, it is mandatory to clear all the faults before reloading the leaf node to avoid any unexpected behavior regarding the port type. If a node is reloaded without clearing the port profile faults, especially when there is a fault related to limit-exceed, the ports might be in an unexpected mode.
- When using a 25G Mellanox cable that is connected to a Mellanox NIC, you can set the ACI leaf switch port to run at a speed of 25G or 10G.
- You cannot enable auto-negotiation on the spine switch or leaf switch side with 40G or 100G CR4 optics. For 40G copper transceivers, you must disable auto-negotiation and set the speed to 40G. For 100G copper transceivers, you must disable auto-negotiation on the remote end and set the speed to 100G.
- You cannot enable auto-negotiation on an active QSFP to SFP/SFP+ Adapter (QSA) module. You can enable auto-negotiation only on a passive QSA module. The following example CLI command shows an active QSA module:

```
module-1# show platform internal usd port info | grep -A 10 "Eth1/42"
```

```
Port 107.0 (Eth1/42) : Admin UP Link DOWN Cfg_Fec Disabled Fec Disabled Fcot Copper retimer
0x116c0100
```

```
AN_cfg Yes AN_operSt No In_debounce 0, Debounce-Time 100000 usecs SM sm qsa: Yes
```

The following example CLI command shows a passive QSA module:

```
module-1# show platform internal usd port info | grep -A 10 "Eth1/43"
```

```
Port 109.0 (Eth1/43) : Admin UP Link UP Cfg_Fec Disabled Fec Disabled Fcot Copper retimer
0x116c0100
```

```
AN_cfg Yes AN_operSt No In_debounce 0, Debounce-Time 100000 usecs SM sm qsa: Passive
```

- You can enable auto-negotiation for 10G, 25G, 40G, or 100G on downlink ports on a Cisco ACI leaf switch. However, you cannot enable auto-negotiation on spine ports and uplink ports on a Cisco ACI leaf switch. Therefore, if the Inter-Pod Network (IPN) is connected to the spine ports using copper cables, you should disable auto-negotiation on the peer node that is the IPN port. Similarly, if a remote leaf switch is connected to the IPN using copper cables on the uplink port, you should disable auto-negotiation on the peer node that is the IPN port.

-
- A 25G link that is using the IEEE-RS-FEC mode can communicate with a link that is using the CL16-RS-FEC mode. There will not be a FEC mismatch and the link will not be impacted.
 - When the provider edge router is an IOS XR device, the router does not support route re-origination from one EVPN stitching site to another EVPN stitching site.

Related Content

See the [Cisco Application Policy Infrastructure Controller \(APIC\)](#) page for the documentation.

Documentation Feedback

To provide technical feedback on this document, or to report an error or omission, send your comments to apic-docfeedback@cisco.com. We appreciate your feedback.

Legal Information

Cisco and the Cisco logo are trademarks or registered trademarks of Cisco and/or its affiliates in the U.S. and other countries. To view a list of Cisco trademarks, go to this URL:

<http://www.cisco.com/go/trademarks>. Third-party trademarks mentioned are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (1110R)

Any Internet Protocol (IP) addresses and phone numbers used in this document are not intended to be actual addresses and phone numbers. Any examples, command display output, network topology diagrams, and other figures included in the document are shown for illustrative purposes only. Any use of actual IP addresses or phone numbers in illustrative content is unintentional and coincidental.

© 2024 Cisco Systems, Inc. All rights reserved.