

排除接入點與控制器的關聯故障

目錄

[簡介](#)

[必要條件](#)

[需求](#)

[採用元件](#)

[基於控制器的AP註冊流程](#)

[使用案例1](#)

[使用案例2](#)

[使用案例3](#)

[使用案例4](#)

簡介

本檔案介紹使用案例，以瞭解存取點(AP)和無線LAN控制器(WLC)之間控制和布建無線存取點(CAPWAP)/輕量存取點通訊協定(LWAPP)通道中斷的原因。

必要條件

需求

思科建議您瞭解AP和控制器配置，以及路由和交換的基本知識。

採用元件

本文件所述內容不限於特定軟體和硬體版本。

本文中的資訊是根據特定實驗室環境內的裝置所建立。文中使用到的所有裝置皆從已清除（預設）的組態來啟動。如果您的網路運作中，請確保您瞭解任何指令可能造成的影響。

基於控制器的AP註冊流程

AP通過上述過程向控制器註冊：

1. 從AP向WLC發出的CAPWAP發現消息請求。
2. 從WLC到AP的發現響應消息。
3. AP根據收到的CAPWAP響應選擇WLC加入。
4. 從AP傳送到WLC的加入請求。
5. 控制器驗證AP並傳送加入響應。

向WLC註冊時在AP上捕獲的日誌：

Press RETURN to get started!

Translating "CISCO-CAPWAP-CONTROLLER"...domain server (255.255.255.255)

%CAPWAP-5-CHANGED: CAPWAP changed state to DISCOVERY

status of voice_diag_test from WLC is false

%SSH-5-ENABLED: SSH 2.0 has been enabled

Logging LWAPP message to 255.255.255.255.

%CDP_PD-4-POWER_OK: 15.4 W power - NEGOTIATED inline power source

%LINK-3-UPDOWN: Interface Dot11Radio1, changed state to up

%LINK-3-UPDOWN: Interface Dot11Radio0, changed state to up

%LINEPROTO-5-UPDOWN: Line protocol on Interface Dot11Radio1, changed state to up

%SYS-6-LOGGINGHOST_STARTSTOP: Logging to host 255.255.255.255 started - CLI initiated

%LINEPROTO-5-UPDOWN: Line protocol on Interface Dot11Radio0, changed state to up Translating "CISCO-LWAPP-CONTROLLER"...don

%CAPWAP-5-DTLSREQSEND: DTLS connection request sent peer_ip:

peer_port: 5246

%CAPWAP-5-CHANGED: CAPWAP changed state to

%CAPWAP-5-DTLSREQSUCC: DTLS connection created successfully peer_ip:

peer_port: 5246

%CAPWAP-5-SENDJOIN: sending Join Request to

%CAPWAP-5-CHANGED: CAPWAP changed state to JOIN

%CAPWAP-5-CHANGED: CAPWAP changed state to CFG

%LWAPP-3-CLIENTERRORLOG: Operator changed mode for 802.11g. Rebooting.

%LINK-5-CHANGED: Interface Dot11Radio0, changed state to administratively down

%SYS-5-RELOAD: Reload requested by CAPWAP CLIENT. Reload Reason: Operator changed mode for 802.11g.

%LINEPROTO-5-UPDOWN: Line protocol on Interface Dot11Radio0, changed state to down IOS Bootloader - Starting system.

使用案例1

1. AP與WLC取消關聯，並且從交換機驗證後，顯示AP沒有IP。

通過控制檯連線到AP時記錄：

```
LINEPROTO-5-UPDOWN: Line protocol on Interface Dot11Radio0, changed state to up
```

%CAPWAP-3-ERRORLOG: Not sending discovery request AP does not have an Ip !!

解決方案：

如果DHCP伺服器位於遠端位置，請修復在VLAN下配置的IP幫助地址的可達性問題。如果本地配置了DHCP，請確保沒有DHCP衝突。在AP上配置靜態IP:

登入到AP並鍵入以下命令：

```
capwap ap ip address <ip> <mask>
capwap ap ip default-gateway <ip>
```

此外，您還可以指定控制器IP位址：

```
capwap ap controller ip address
```

2.請注意，存在具有IP地址的AP，但無法與WLC通訊可能是控制器IP的解析故障。

來自AP的日誌，出現域名系統(DNS)解析失敗的問題：

```
<Date & time> %CAPWAP-3-ERRORLOG: Could Not resolve CISCO-CAPWAP-CONTROLLER.local domain
Not in Bound state.
```

解決方案：

檢查內部DNS伺服器可訪問性（如果可接受），確保通過DHCP推送的控制器IP地址可訪問。

Break-fix：在AP上手動配置控制器。

```
"capwap ap {primary-base | secondary-base | tertiary-base}controller-name controller-ip-address"
```

3.您看到AP已在控制器上註冊，但您仍然看不到所需的服務集識別符號(SSID)廣播。

```
(4402-d) >config wlan apgroup interface-mapping add <ap group name> <wlandi> <interfacename>
```

解決方案：

請在AP組下新增無線LAN(WLAN)。

使用案例2

請注意，在交換機的思科發現協定(CDP)鄰居上未看到AP，並且AP連線的交換機處於錯誤禁用狀態。

從Switch：捕獲

```
Dec 9 08:42:35.836 UTC: RSTP(10): sending BPDU out Te3/0/47STP: pak->vlan_id: 10
```

```
Dec 9 08:42:35.836 UTC: %PM-4-ERR_DISABLE: bpduguard error detected on Te3/0/47, putting Te3/0/47 in err-disable stateSTP: pak->vlan_id: 1
```

```
Dec 9 09:47:32.651 UTC: %ILPOWER-5-DETECT: Interface Te3/0/47: Power Device detected: IEEE PD
```

```
Dec 9 09:47:33.651 UTC: %ILPOWER-5-POWER_GRANTED: Interface Te3/0/47: Power granted
```

```
Dec 9 09:47:53.545 UTC: %PM-4-ERR_DISABLE: bpduguard error detected on Te3/0/47, putting Te3/0/47 in err-disable state
```

```
Dec 9 09:48:10.955 UTC: %ILPOWER-5-DETECT: Interface Te3/0/47: Power Device detected: IEEE PD
```

```
Dec 9 09:48:11.955 UTC: %ILPOWER-5-POWER_GRANTED: Interface Te3/0/47: Power granted
```

```
Dec 9 09:48:32.114 UTC: %PM-4-ERR_DISABLE: bpduguard error detected on Te3/0/47, putting Te3/0/47 in err-disable state
```

解決方案：

在任何情況下，AP都不會傳送網橋協定資料單元(BPDU)防護，這是交換機端的問題。將AP移動到另一個空間埠，並複製介面配置以及必要的物理檢查。

使用案例3


在遠端辦公室設定中，經常會看到AP和控制器之間的CAPWAP隧道隨機中斷，需要檢查的最重要引數是重新傳輸和重試間隔。

AP重新傳輸間隔和重試間隔可以在全域性級別和AP級別配置。全域性配置將這些配置引數應用到所有AP。也就是說，所有AP的重傳間隔和重試計數是一致的。

來自WLC的問題日誌：

*spamApTask6: Jun 01 17:17:55.426: %LWAPP-3-AP_DEL: spam_lrad.c:6088 1c:d1:e0:43:1d:20: Entry deleted for AP: 10.209.36.5 (5256) reason : AP

解決方案：如果問題在所有站點出現，則增加 **Retransmit count** 和 **Retransmit interval** 在wireless Global configuration下。當所有AP出現問題時增加值的選項。

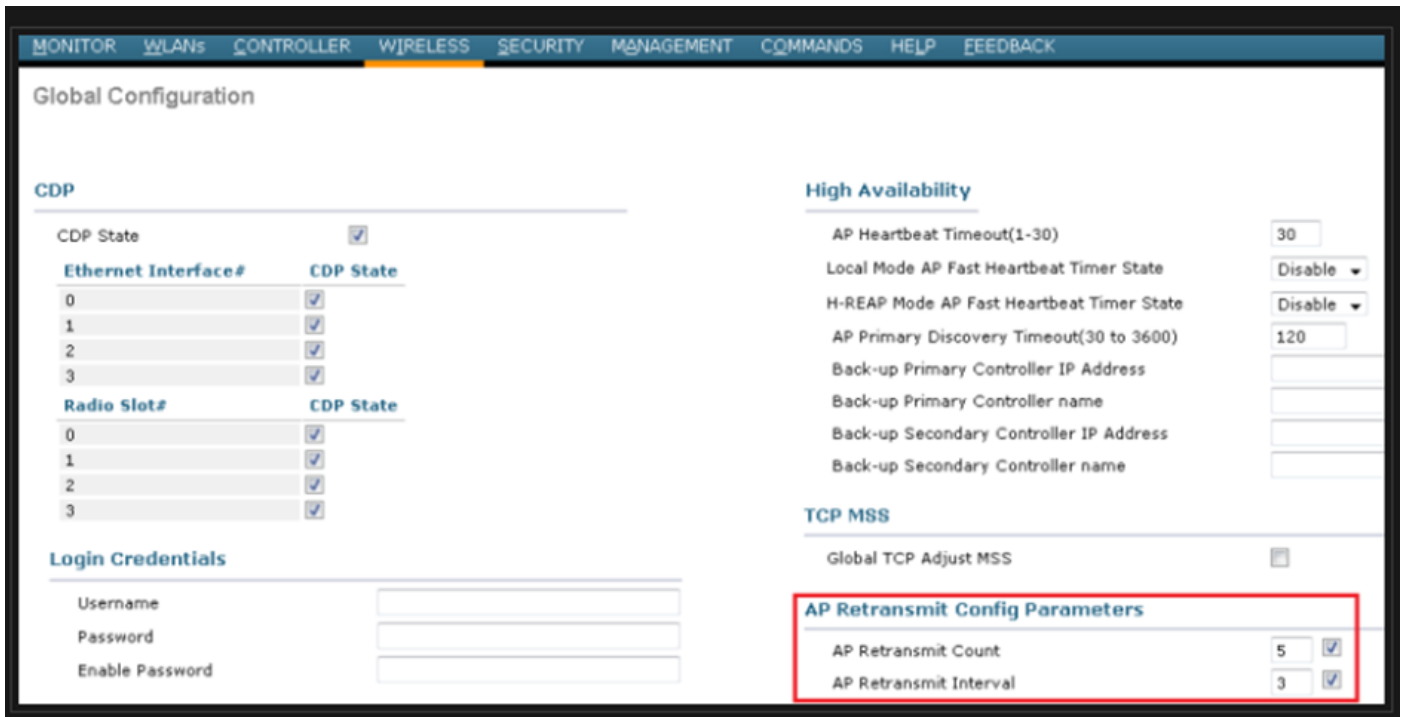

用於在「全域性配置」下更改AP重新傳輸配置引數的選項

如果問題僅針對一個遠端站點，則增加 **Retransmit count** 和 **Retransmit interval** 在特定的AP上解決了問題。



用於更改特定AP下的AP重新傳輸配置引數的選項

使用案例4

AP與WLC完全解除關聯，且無法重新加入控制器，這可能會與數位憑證相關。

有關Cisco WLC和AP方面的裝置證書的一些簡略說明：

- 預設情況下，思科提供的每個裝置都附帶一個有效期為10年的證書。
- 此憑證用於在Cisco WLC和AP之間執行驗證。
- 在證書的幫助下，AP和WLC建立一個安全的資料包傳輸層安全(DTLS)隧道。

遇到兩種與證書相關的問題：

問題1：舊版AP (不想加入WLC)。

通過控制檯連線到AP有助於確定問題，日誌如下所示：

```
*Sep 13 18:26:24.000: %CAPWAP-5-DTLSREQSEND: DTLS connection request sent peer_ip: 10.1.1.1 peer_port: 5246
*Sep 13 18:26:24.000: %CAPWAP-5-CHANGED: CAPWAP changed state to
*Sep 13 18:26:24.099: %PKI-3-CERTIFICATE_INVALID_EXPIRED: Certificate chain validation has failed.
The certificate (SN: XXXXXXXXXXXXXXXX) has expired. Validity period ended on 19:56:24 UTC Aug 12 2018
*Sep 13 18:26:24.099: %LWAPP-3-CLIENTERRORLOG: Peer certificate verification failed
*Sep 13 18:26:24.099: %CAPWAP-3-ERRORLOG: Certificate verification failed!
```

問題2：較新的AP不想加入較舊的WLC。

AP的控制檯顯示的錯誤可能如下所示：

```
[*09/09/2019 04:55:26.3299] CAPWAP State: DTLS Teardown
[*09/09/2019 04:55:30.9385] CAPWAP State: Discovery
[*09/09/2019 04:55:30.9385] Did not get log server settings from DHCP.
[*09/09/2019 04:55:41.0000] CAPWAP State: DTLS Setup
[*09/09/2019 04:55:41.3399] Bad certificate alert received from peer.
[*09/09/2019 04:55:41.3399] DTLS: Received packet caused DTLS to close connection
```

解決方案：

1. NTP通過CLI禁用和手動設定時間：

```
(Cisco Controller)> config time ntp delete 1
```

```
(Cisco Controller)> config time manual 09/30/18 11:30:00
```

2. NTP通過GUI禁用和手動設定時間：

導航至 **Controller > NTP > Server > Commands > Set Time** 以便刪除列出的NTP伺服器。

The screenshot displays the Cisco GUI interface for configuring the system time. The top navigation bar includes 'MONITOR', 'WLANs', 'CONTROLLER', 'WIRELESS', 'SECURITY', 'MANAGEMENT', 'COMMANDS', and 'HELP'. The 'COMMANDS' tab is active. On the left, a 'Commands' sidebar lists various actions, with 'Set Time' highlighted. The main content area is titled 'Set Time' and shows the 'Current Time' as 'Tue Jan 31 17:47:08 2023'. Below this, there are three sections: 'Date', 'Time', and 'Timezone'. The 'Date' section includes dropdown menus for 'Month' (set to January), 'Day' (set to 31), and 'Year' (set to 2023). The 'Time' section includes dropdown menus for 'Hour' (set to 17), 'Minutes' (set to 47), and 'Seconds' (set to 8). The 'Timezone' section includes input fields for 'Delta' (hours: 0, mins: 0) and a dropdown menu for 'Location' (set to -Select Location-).

在GUI上手動設定時間的位置

2. 停用控制器上的製造商安裝憑證(MIC)。此命令僅在最新版本上被接受。

```
(Cisco Controller)> config ap cert-expiry-ignore mic enable
```

關於此翻譯

思科已使用電腦和人工技術翻譯本文件，讓全世界的使用者能夠以自己的語言理解支援內容。請注意，即使是最佳機器翻譯，也不如專業譯者翻譯的內容準確。Cisco Systems, Inc. 對這些翻譯的準確度概不負責，並建議一律查看原始英文文件（提供連結）。