cisco.



Cisco Nexus 9000 Series NX-OS Software Upgrade and Downgrade Guide, Release 10.5(x)

First Published: 2024-07-27

Americas Headquarters

Cisco Systems, Inc. 170 West Tasman Drive San Jose, CA 95134-1706 USA http://www.cisco.com Tel: 408 526-4000 800 553-NETS (6387) Fax: 408 527-0883 THE SPECIFICATIONS AND INFORMATION REGARDING THE PRODUCTS REFERENCED IN THIS DOCUMENTATION ARE SUBJECT TO CHANGE WITHOUT NOTICE. EXCEPT AS MAY OTHERWISE BE AGREED BY CISCO IN WRITING, ALL STATEMENTS, INFORMATION, AND RECOMMENDATIONS IN THIS DOCUMENTATION ARE PRESENTED WITHOUT WARRANTY OF ANY KIND, EXPRESS OR IMPLIED.

The Cisco End User License Agreement and any supplemental license terms govern your use of any Cisco software, including this product documentation, and are located at: https://www.cisco.com/c/en/us/about/legal/cloud-and-software/software-terms.html. Cisco product warranty information is available at https://www.cisco.com/c/en/us/products/ warranty-listing.html. US Federal Communications Commission Notices are found here https://www.cisco.com/c/en/us/products/us-fcc-notice.html.

IN NO EVENT SHALL CISCO OR ITS SUPPLIERS BE LIABLE FOR ANY INDIRECT, SPECIAL, CONSEQUENTIAL, OR INCIDENTAL DAMAGES, INCLUDING, WITHOUT LIMITATION, LOST PROFITS OR LOSS OR DAMAGE TO DATA ARISING OUT OF THE USE OR INABILITY TO USE THIS MANUAL, EVEN IF CISCO OR ITS SUPPLIERS HAVE BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES.

Any products and features described herein as in development or available at a future date remain in varying stages of development and will be offered on a when-and if-available basis. Any such product or feature roadmaps are subject to change at the sole discretion of Cisco and Cisco will have no liability for delay in the delivery or failure to deliver any products or feature roadmap items that may be set forth in this document.

Any Internet Protocol (IP) addresses and phone numbers used in this document are not intended to be actual addresses and phone numbers. Any examples, command display output, network topology diagrams, and other figures included in the document are shown for illustrative purposes only. Any use of actual IP addresses or phone numbers in illustrative content is unintentional and coincidental.

The documentation set for this product strives to use bias-free language. For the purposes of this documentation set, bias-free is defined as language that does not imply discrimination based on age, disability, gender, racial identity, ethnic identity, sexual orientation, socioeconomic status, and intersectionality. Exceptions may be present in the documentation due to language that is hardcoded in the user interfaces of the product software, language used based on RFP documentation, or language that is used by a referenced third-party product.

Cisco and the Cisco logo are trademarks or registered trademarks of Cisco and/or its affiliates in the U.S. and other countries. To view a list of Cisco trademarks, go to this URL: https://www.cisco.com/c/en/us/about/legal/trademarks.html. Third-party trademarks mentioned are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (1721R)

© 2024 Cisco Systems, Inc. All rights reserved.



CONTENTS

PREFACE	Preface vii Audience vii
	Document Conventions vii
	Related Documentation for Cisco Nexus 9000 Series Switches viii
	Documentation Feedback viii
	Communications, Services, and Additional Information viii
	Cisco Bug Search Tool ix
	Documentation Feedback ix
CHAPTER 1	New and Changed Information 1
	New and Changed Information 1
CHAPTER 2	Upgrading or Downgrading the Cisco Nexus 9000 Series NX-OS Software 3
	About the Software Image 3
	About ISSU 5
	Recommendations for Upgrading the Cisco NX-OS Software 6
	Prerequisites for Upgrading the Cisco NX-OS Software 6
	Prerequisites for Downgrading the Cisco NX-OS Software 7
	Cisco NX-OS Software Upgrade Guidelines 7
	ISSU Platform Support 18
	Cisco NX-OS Software Downgrade Guidelines 28
	Upgrade Paths 30
	Upgrade Patch Instructions 30
	Enhanced ISSU 40
	Upgrading the Cisco NX-OS Software 43
	Upgrade Process for vPCs 48
	Opgrade 1100055101 VI C5 40

Upgrade Process for a vPC Topology on the Primary Switch Upgrade Process for a vPC Topology on the Secondary Switch Downgrading to an Earlier Software Release Cisco NX-OS Upgrade History

CHAPTER 3 Optionality in Cisco NX-OS Software 53

Optionality in Cisco NX-OS Software 53 Using Modular Packages 54 Booting the NX-OS Image in Base or Full Mode **55** Information About RPMs 56 Format of the RPM 56 Optional RPMs and Their Associated Features 57 Guidelines for NX-OS Feature RPM Installation 59 Guidelines for Third-Party RPM Installation 60 Using Install CLIs for Feature or Third-Party RPM Operation 60 Using Install CLIs for Digital Signature Support 63 Querying All Installed RPMs 63 Installing the RPMs Using One Step Procedure 64 Installing the RPMs Using Two Steps Procedure 65 Upgrading the RPMs Using One Step 66 Downgrading the RPMs 68 Uninstalling the RPMs 69 Removing the RPMs 69 Information About DNF Commands 70 Performing Package Operations Using the DNF Commands 70 Finding the Base Version RPM of the Image 70 Checking the List of the Installed RPMs **71** Getting Details of the Installed RPMs 72 Installing the RPMs 72 Upgrading the RPMs 74 Downgrading the RPMs 77 Deleting the RPMs **78** Support for DNF Groups 79 Finding Repositories 82

	Finding the Installed DNF Version 83
	Mapping the NX-OS CLI to the DNF Commands 83
	Configuring an FTP server and Setting up a Local FTP YUM Repository 84
	Creating an FTP Server on Red Hat Enterprise Linux 7 (RHEL7) Virtual Machine 85
	Creating a Local FTP YUM Repository 86
	Configuring a Switch to Reach an FTP Server 88
	Creating User Roles for Install Operation 89
	Compacting Cisco NX-OS Software Images 89
CHAPTER 4	Converting from Cisco NX-OS to ACI Boot Mode and from ACI Boot Mode Back to Cisco NX-OS 91 Converting to ACI Boot Mode 91 Converting a Replacement Standby Supervisor to ACI Boot Mode 94 Converting Back to Cisco NX-OS 95
	Using SCP on the ACI Shell To Load Cisco NX-OS Image into Bootflash 98
CHAPTER 5	Migrating Switches in a vPC Topology 99
	vPC Forklift Upgrade 99

Contents

I



Preface

This preface includes the following sections:

- Audience, on page vii
- Document Conventions, on page vii
- Related Documentation for Cisco Nexus 9000 Series Switches, on page viii
- Documentation Feedback, on page viii
- · Communications, Services, and Additional Information, on page viii

Audience

This publication is for network administrators who install, configure, and maintain Cisco Nexus switches.

Document Conventions

Command descriptions use the following conventions:

Convention	Description Bold text indicates the commands and keywords that you enter litera as shown.	
bold		
Italic	Italic text indicates arguments for which you supply the values.	
[x]	Square brackets enclose an optional element (keyword or argument).	
[x y]	Square brackets enclosing keywords or arguments that are separated by a vertical bar indicate an optional choice.	
{x y}	Braces enclosing keywords or arguments that are separated by a vertical bar indicate a required choice.	
[x {y z}]	Nested set of square brackets or braces indicate optional or required choices within optional or required elements. Braces and a vertical bar within square brackets indicate a required choice within an optional element.	

Convention	Description	
variable	Indicates a variable for which you supply values, in context where italics cannot be used.	
string	A nonquoted set of characters. Do not use quotation marks around the string or the string includes the quotation marks.	

Examples use the following conventions:

Convention	Description
screen font	Terminal sessions and information the switch displays are in screen font.
boldface screen font	Information that you must enter is in boldface screen font.
italic screen font	Arguments for which you supply values are in italic screen font.
<>	Nonprinting characters, such as passwords, are in angle brackets.
[]	Default responses to system prompts are in square brackets.
!,#	An exclamation point (!) or a pound sign (#) at the beginning of a line of code indicates a comment line.

Related Documentation for Cisco Nexus 9000 Series Switches

The entire Cisco Nexus 9000 Series switch documentation set is available at the following URL: https://www.cisco.com/en/US/products/ps13386/tsd_products_support_series_home.html

Documentation Feedback

To provide technical feedback on this document, or to report an error or omission, please send your comments to nexus9k-docfeedback@cisco.com. We appreciate your feedback.

Communications, Services, and Additional Information

- To receive timely, relevant information from Cisco, sign up at Cisco Profile Manager.
- To get the business impact you're looking for with the technologies that matter, visit Cisco Services.
- To submit a service request, visit Cisco Support.
- To discover and browse secure, validated enterprise-class apps, products, solutions, and services, visit Cisco DevNet.
- To obtain general networking, training, and certification titles, visit Cisco Press.
- To find warranty information for a specific product or product family, access Cisco Warranty Finder.

Cisco Bug Search Tool

Cisco Bug Search Tool (BST) is a gateway to the Cisco bug-tracking system, which maintains a comprehensive list of defects and vulnerabilities in Cisco products and software. The BST provides you with detailed defect information about your products and software.

Documentation Feedback

To provide feedback about Cisco technical documentation, use the feedback form available in the right pane of every online document.

I



UNATIEN

New and Changed Information

• New and Changed Information, on page 1

New and Changed Information

This table summarizes the new and changed features for the *Cisco Nexus 9000 Series NX-OS Software Upgrade* and *Downgrade Guide*, *Release 10.5(x)* and tells you where they are documented.

Feature	Description	Changed in Release	Where Documented
NX-OS image management - S1 image uplift	Supports a new 64-bit Cisco NX-OS image file name with nxos64- s1 as the prefix on Cisco Nexus 9800 series switches		About the Software Image, on page 3 Cisco NX-OS Software Upgrade Guidelines, on page 7 Cisco NX-OS Software Downgrade Guidelines, on page 28

Table 1: New and Chan	and Features for Cisco	n NX-OS Release 10 5/x	r)
	<i>yeu realuies ivi visu</i>	U INA-US neiease 10.3()	•/

I



Upgrading or Downgrading the Cisco Nexus 9000 Series NX-OS Software

This chapter describes how to upgrade or downgrade the Cisco NX-OS software. It contains the following sections:

- About the Software Image, on page 3
- About ISSU, on page 5
- Recommendations for Upgrading the Cisco NX-OS Software, on page 6
- Prerequisites for Upgrading the Cisco NX-OS Software, on page 6
- Prerequisites for Downgrading the Cisco NX-OS Software, on page 7
- Cisco NX-OS Software Upgrade Guidelines, on page 7
- ISSU Platform Support, on page 18
- Cisco NX-OS Software Downgrade Guidelines, on page 28
- Upgrade Paths, on page 30
- Upgrade Patch Instructions, on page 30
- Enhanced ISSU, on page 40
- Upgrading the Cisco NX-OS Software, on page 43
- Upgrade Process for vPCs, on page 48
- Downgrading to an Earlier Software Release, on page 49
- Cisco NX-OS Upgrade History, on page 51

About the Software Image

Each device is shipped with the Cisco NX-OS software preinstalled. The Cisco NX-OS software consists of one NX-OS software image. Only this image is required to load the Cisco NX-OS operating system.

In Cisco NX-OS Release 10.5(1)F, the following three 64-bit images are supported:

- The 64-bit Cisco NX-OS image file name with nxos64-cs as the prefix (for example, nxos64-cs.10.5.1.F.bin) is supported on all Cisco Nexus 9000 series switches except Cisco Nexus 9500 -R and -R2 switches and line cards and Nexus 9800 switches.
- Starting from Cisco NX-OS Release 10.5(1)F, the 64-bit Cisco NX-OS image file name with nxos64-s1 as the prefix (for example, nxos64-s1.10.5.1.bin) is supported and mandatory on Nexus 9800 switches.

The 64-bit Cisco NX-OS image file name with nxos64-msll as the prefix (for example, nxos64-msll.10.5.1.F.bin) is supported on Cisco Nexus 9000 Series -R and -R2 modular switches.



Note Starting from Cisco NX-OS Release 10.2(2)F, 32-bit image is no longer supported. For 32-bit or 64-bit image support on respective platforms in earlier releases, refer to the relevant version of Cisco Nexus 9000 Series NX-OS Release Notes on Cisco.com.

For information about the supported upgrade paths, see the Cisco Nexus 9000 and 3000 Upgrade and ISSU Matrix.

In Cisco NX-OS Release 10.1(1), 10.1(2), and 10.2(1)F there are 32 and 64 bit images.

- The 32-bit Cisco NX-OS image file has the image filename that begins with "nxos" (for example, nxos.10.1.1.bin).
- The 64-bit Cisco NX-OS image file has the image filename that begins with "nxos64" (for example, nxos64.10.1.1.bin).

Beginning with Cisco NX-OS Release 10.1(x), only 9300-GX platforms support 64-bit image. Beginning with Cisco NX-OS Release 10.2(1)F, all platforms support 64-bit image.

Beginning with Cisco NX-OS Release 10.2(2)F all Cisco Nexus platforms are operating only on 64-bit images and there are two 64-bit images.

- The 64-bit Cisco NX-OS image file has the image filename that begins with "nxos64-cs" (for example, nxos64-cs.10.2.2.F.bin) : This image is supported on Cisco Nexus 9000 -EX, -FX, -FX2, -FXP, -FX3, -GX, -GX2, and 9364C series fixed switches and Nexus 9000 series modular switches
- The 64-bit Cisco NX-OS image file has the image filename that begins with "nxos64-msll" (for example, nxos64-msll.10.2.2.F.bin) This image is supported on Cisco Nexus 9000 -R and -R2 series modular switches, Cisco Nexus 3600 series fixed switches and Cisco Nexus 3500-XL switches.

For 32-bit or 64-bit image support on respective platforms, see the relevant version of the Cisco Nexus 9000 Series Release Notes on Cisco.com.

The Cisco Nexus 9000 Series switches support disruptive software upgrades and downgrades by default.



Note Another type of binary file is the software maintenance upgrade (SMU) package file. SMUs contain fixes for specific defects. They are created to respond to immediate issues and do not include new features. SMU package files are available for download from Cisco.com and generally include the ID number of the resolved defect in the filename (for example, n9000-dk10.1.1.CSCab00001.gbin). For more information on SMUs, see the *Cisco Nexus 9000 Series NX-OS System Management Configuration Guide*.

Note



Note Cisco also provides electronic programmable logic device (EPLD) image upgrades to enhance hardware functionality or to resolve known hardware issues. The EPLD image upgrades are independent from the Cisco NX-OS software upgrades. For more information on EPLD images and the upgrade process, see the Cisco Nexus 9000 Series FPGA/EPLD Upgrade Release Notes.

About ISSU

An in-service software upgrade (ISSU) allows you to upgrade the device software while the switch continues to forward traffic. ISSU reduces or eliminates the downtime typically caused by software upgrades. You can perform an ISSU, also known as a non-disruptive upgrade, for some switches. (See the ISSU Platform Support, on page 18 for a complete list of supported platforms.)

The default upgrade process is disruptive. Therefore, ISSU needs to be enabled using the command-line interface (CLI), as described in the configuration section of this document. Using the non-disruptive option helps ensure a non-disruptive upgrade. The guest shell is disabled during the ISSU process and it is later reactivated after the upgrade.

Enhanced ISSUs are supported for some Cisco Nexus 9000 Series switches.

The following ISSU scenarios are supported:

- · Performing standard ISSU on Top-of-Rack (ToR) switches with a single supervisor
- · Performing enhanced ISSU on Top-of-Rack (ToR) switches with a single supervisor

Performing Standard ISSU on Top-of-Rack (ToR) Switches with a Single Supervisor

The ToR Cisco Nexus 9300 platform switches are the NX-OS switches with single supervisors. Performing ISSU on the Cisco Nexus 9000 Series switches causes the supervisor CPU to reset and to load the new software version. After the CPU loads the updated version of the Cisco NX-OS software, the system restores the control plane to the previous known configuration and the runtime state and it gets in-sync with the data plane, thereby completing the ISSU process.

The data plane traffic is not disrupted during the ISSU process. In other words, the data plane forwards the packets while the control plane is being upgraded, any servers that are connected to the Cisco Nexus 9000 Series switches do not see any traffic disruption. The control plane downtime during the ISSU process is approximately less than 120 seconds.

Performing Enhanced ISSU on Top-of-Rack (ToR) Switches with a Single Supervisor



Note Enhanced ISSU may not be supported if there are any underlying kernel differences. The system will prompt the following message:

Host kernel is not compatible with target image. Full ISSU will be performed and control plane will be impacted.

In effect, system will perform non-disruptive ISSU instead of enhanced ISSU.

The Cisco NX-OS software normally runs directly on the hardware. However, configuring enhanced or container-based ISSU on single supervisor ToRs is accomplished by creating virtual instances of the supervisor modules and the line cards. With enhanced ISSU, the software runs inside a separate Linux container (LXC) for the supervisors and the line cards. A third container is created as part of the ISSU procedure, and it is brought up as a standby supervisor.

The virtual instances (or the Linux containers) communicate with each other using an emulated Ethernet connection. In the normal state, only two Linux containers are instantiated: vSup1 (a virtual SUP container in an active role) and vLC (a virtual linecard container). Enhanced ISSU requires 16G memory on the switch.

To enable booting in the enhanced ISSU (LXC) mode, use the **[no] boot mode lxc** command. This command is executed in the config mode. See the following sample configuration for more information:

Note

When you are enabling enhanced ISSU for the first time, you have to reload the switch first.

During the software upgrade with enhanced ISSU, the supervisor control plane stays up with minimal switchover downtime disruption and the forwarding state of the network is maintained accurately during the upgrade. The supervisor is upgraded first and the line card is upgraded next.

The data plane traffic is not disrupted during the ISSU process. The control plane downtime is less than 6 seconds.



Note In-service software downgrades (ISSDs), also known as non-disruptive downgrades, are not supported.

For information on ISSU and high availability, see the Cisco Nexus 9000 Series NX-OS High Availability and Redundancy Guide.

Recommendations for Upgrading the Cisco NX-OS Software

Cisco recommends performing a Nexus Health and Configuration Check before performing an upgrade. The benefits include identification of potential issues, susceptible Field Notices and Security Vulnerabilities, missing recommended configurations and so on. For more information about the procedure, see Perform Nexus Health and Configuration Check.

Prerequisites for Upgrading the Cisco NX-OS Software

Upgrading the Cisco NX-OS software has the following prerequisites:

For ISSU compatibility for all releases, see the Cisco Nexus 9000 and 3000 Upgrade and ISSU Matrix.

- Ensure that everyone who has access to the device or the network is not configuring the device or the network during this time. You cannot configure a device during an upgrade. Use the **show configuration session summary** command to verify that you have no active configuration sessions.
- Save, commit, or discard any active configuration sessions before upgrading or downgrading the Cisco NX-OS software image on your device. On a device with dual supervisors, the active supervisor module cannot switch over to the standby supervisor module during the Cisco NX-OS software upgrade if you have an active configuration session.
- To transfer NX-OS software images to the Nexus switch through a file transfer protocol (such as TFTP, FTP, SFTP, SCP, etc.), verify that the Nexus switch can connect to the remote file server where the NX-OS software images are stored. If you do not have a router to route traffic between subnets, ensure that the Nexus switch and the remote file server are on the same subnetwork. To verify connectivity to the remote server, transfer a test file using a file transfer protocol of your choice or use the ping command if the remote file server is configured to respond to ICMP Echo Request packets. An example of using the **ping** command to verify connectivity to a remote file server 192.0.2.100 is shown below:

switch# ping 192.0.2.100 vrf management
PING 192.0.2.100 (192.0.2.100): 56 data bytes
64 bytes from 192.0.2.100: icmp_seq=0 ttl=239 time=106.647 ms
64 bytes from 192.0.2.100: icmp_seq=1 ttl=239 time=76.807 ms
64 bytes from 192.0.2.100: icmp_seq=2 ttl=239 time=76.593 ms
64 bytes from 192.0.2.100: icmp_seq=3 ttl=239 time=81.679 ms
64 bytes from 192.0.2.100: icmp_seq=4 ttl=239 time=76.5 ms
--- 192.0.2.100 ping statistics --5 packets transmitted, 5 packets received, 0.00% packet loss
round-trip min/avg/max = 76.5/83.645/106.647 ms

For more information on configuration sessions, see the *Cisco Nexus 9000 Series NX-OS System Management Configuration Guide* specific to your release.

Prerequisites for Downgrading the Cisco NX-OS Software

Downgrading the Cisco NX-OS software has the following prerequisites:

• Before you downgrade from a Cisco NX-OS release that supports the Control Plane Policing (CoPP) feature to an earlier Cisco NX-OS release that does not support the CoPP feature, you should verify compatibility using the **show incompatibility nxos bootflash**:*filename* command. If an incompatibility exists, disable any features that are incompatible with the downgrade image before downgrading the software.

Cisco NX-OS Software Upgrade Guidelines

Before attempting to upgrade to any software image, follow these guidelines:

- For a device that is running on Cisco Nexus Release 10.1(2), 10.2(1)F, and 10.2(2)F, ND-ISSU is not supported if L2 sub-interfaces are configured.
- Beginning with Cisco NX-OS Release 10.2(2)F, Cisco Nexus 9504 and 9508 platform switches, and Cisco Nexus 9508-R, R2, and RX line cards support Cisco NX-OS 64-bit images. Disruptive upgrade

from earlier releases to 10.2(2)F 64-bit NX-OS image is supported. Cisco NX-OS 32-bit image is not supported on these platform switches anymore.

Beginning with Cisco NX-OS Release 10.2(2)F, FCoE/FC NPV is supported on N9K-C9336C-FX2-E platform switches.

ISSU with with FCoE (Fiber Channel over Ethernet)/FC (Fiber Channel) NPV (N-port Virtualization) is supported on some Cisco Nexus 9000 switches. An ISSU allows you to upgrade the device software while the switch continues to forward traffic. You can perform an in-service software upgrade (ISSU), also known as a nondisruptive upgrade, for some Cisco Nexus 9000 switches. The default upgrade process is disruptive. Using the nondisruptive option helps ensure a nondisruptive upgrade.

Fibre Channel N-port Virtualization (NPV) can co-exist with VXLAN on different fabric uplinks but on same or different front panel ports on the Cisco Nexus 93180YC-FX, N9K-C9336C-FX2-E, and N9k-C93360YC-FX2 switches.

 Beginning with Cisco NX-OS Release 10.2(2)F, ND ISSU is supported for FEX and you need to re-adjust the BGP graceful-restart restart time command for the upgrade to work non-disruptively. This must be done for each FEX upgrade one-by-one.

The following example shows the time taken to re-adjust bgp-graceful restart-time for each non-disruptive FEX upgrade.

In the Non-disruptive upgrade with FEX, each FEX will upgrade taking about 90 secondss

(1.5 minutess) sequentially (one-by-one and not a parallel upgrade).
Total non-disruptive upgrade time for all FEX = No. of fex * time taken per fex
For 10 FEX = 10 * 90
= 900 seconds or 15 minutes

 MPLS strip, GRE strip, and any underlying ACL configuration is not ISSU compatible when you perform ND ISSU to Cisco NX-OS Release 10.2(2)F from a previous release.

After ND ISSU to Cisco NX-OS Release 10.2(2)F or 10.2(3)F from a previous release, post GRE strip dot1q tunnel VLAN_tag might be missing. Workaround for this issue is to remove and add port ACL from L2 interfaces for GRE strip enabled interface.

- For ISSU compatibility for all releases, see the Cisco Nexus 9000 and 3000 Upgrade and ISSU Matrix.
- Beginning from Cisco NX-OS Release 10.2(1), Cisco Nexus 9300 and 9500 platform switches support 64-bit image.
- Non-disruptive upgrade to 64-bit image is supported from Cisco NX-OS Release 9.3(9) onwards. See supported platforms in Cisco Nexus 9000 and 3000 Upgrade and ISSU Matrix.
- Beginning from Cisco NX-OS Release 10.2(1) onwards, Cisco Nexus 9300-FX3 supports non-disruptive upgrade.
- Beginning with Cisco NX-OS Release 10.1(1), during the disruptive upgrade to the 64-bit image or a downgrade from 64-bit to 32-bit image, if feature ITD is enabled, refer to *Guidelines and Limitations for ITD* in the *Cisco Nexus 9000 Series NX-OS Intelligent Traffic Director Configuration Guide, Release* 10.1(x), if the upgrade or downgrade proceeds with an ASIC reload.
- When you use **install all** with **no-reload** option, the saved configuration cannot be used before you reload the device. Saving configuration in this state can result in incorrect startup configuration once you reload the device with new version of NX-OS.
- For switches that are in LXC boot mode, the enhanced LXC upgrade will fall back to standard ND ISSU as the target image kernels are likely be different than the current image.

- Beginning with Cisco NX-OS Release 10.2(3)F, for switches that are in LXC mode and for non-destruptive upgrade, a new option skip-kernel-upgrade is added to install command.
- The following are the two methods by which the ND ISSU can be performed in LXC mode:
 - ND ISSU in LXC mode Switchover-based ISSU that is similar to EOR. Second SUP is brought up in new container and switchover is done. The second SUP now becomes the new active. There is no change to the kernel.
 - Fallback ND LXC ISSU This is only done when the above switchover-based ISSU cannot be done (SRG Kernel incompatible or less memory). The kernel is upgraded.
 - skip-kernel-upgrade option will force ND ISSU in LXC mode Switchover-based ISSU (even in case when running) and target kernels are incompatible.
- When upgrading from Cisco NX-OS Release 9.3(3) to Cisco NX-OS Release 9.3(6) or later, if you do
 not retain configurations of the TRM enabled VRFs from Cisco NX-OS Release 9.3(3), or if you create
 new VRFs after the upgrade, the auto-generation of ip multicast multipath s-g-hash next-hop-based
 CLI, when feature ngmvpn is enabled, will not happen. You must enable the CLI manually for each
 TRM enabled VRF. For the configuration instructions, see the Cisco Nexus 9000 Series NX-OS VXLAN
 Configuration Guide, Release 10.1(x).
- When you upgrade a Cisco Nexus 9000 device to Cisco NX-OS Release 10.1(x), if a QSFP port is configured with the manual breakout command and is using a QSA, the configuration of the interface Ethernet 1/50/1 is no longer supported and must be removed. To restore the configuration, you must manually configure the interface Ethernet 1/50 on the device.
- When redistributing static routes, Cisco NX-OS requires the **default-information originate** command to successfully redistribute the default static route starting in 7.0(3)I7(6).
- To perform an EPLD upgrade after an ISSU upgrade from Cisco NX-OS Release 7.x to Cisco NX-OS Release 9.3(x), before starting the EPLD upgrade, add the copy run start command.
- When upgrading from Cisco NX-OS Release 9.2(4) or earlier releases to Cisco NX-OS Release 9.3(4) or later, running configuration contains extra TCAM configuration lines. You can ignore these extra lines as they do not have an effect on the upgrade and configuration.
- When performing an ISSU from Cisco NX-OS Release 9.3(1) or 9.3(2) to Cisco NX-OS Release 9.3(3) or later, ensure that the features with user-defined ports, such as <ssh port>, are within the prescribed port range. If the port range is incorrect, follow the syslog message recommendation. For more information about the port range, see Cisco Nexus 9000 Series NX-OS IP SLAs Configuration Guide, Release 10.1(x).
- When upgrading from Cisco NX-OS Release 9.2(2) or earlier releases to Cisco NX-OS Release 10.1(x), you need to make sure that ingress RACL TCAM region is not more than 50% full. Otherwise, the atomic update feature will be enabled after the upgrade and interfaces with RACLs that exceed 50% of TCAM allocation will remain down.
- Beginning with Cisco NX-OS Release 10.1(1), ISSU is supported on FC/FCoE switch mode on Cisco Nexus 93360YC-FX2. For more information about the FC/FCoE switch mode and supported hardware, see *Cisco Nexus 9000 Series NX-OS SAN Switching Configuration Guide, Release 10.1(x)*.
- Beginning with Cisco NX-OS Release 10.1(1), Enhanced ISSU is supported on FC/FCoE switch mode for Cisco Nexus 93180YC-FX and 93360YC-FX2 switches. For more information about the FC/FCoE switch mode and supported hardware, see *Cisco Nexus 9000 Series NX-OS SAN Switching Configuration Guide, Release 10.1(x)*.

- Beginning with Cisco NX-OS Release 10.1(1), Enhanced ISSU is supported on FC/FCoE NPV mode for Cisco Nexus 93180YC-FX and 93360YC-FX2 switches. For more information about the FC/FCoE NPV mode and supported hardware, see *Cisco Nexus 9000 Series NX-OS FC-NPV and FCoE NPV Configuration Guide, Release 10.1(x).*
- The compressed image of Cisco Nexus 3000-series is hardware dependent and can only be used on the same device that it got compressed or downloaded from CCO. Do not use the Nexus 3000-series compressed image on Nexus 9000-series
- The following limitation applies to software upgrades from 7.0(3) I5 to 10.1(x) or 9.2(3) to 10.1(x):

If you have the same NetFlow configuration in both VLAN and SVI, you must remove the NetFlow flow monitor from the VLAN configuration prior to the upgrade. Once upgraded, reconfigure NetFlow by creating a new flow monitor and adding it to the VLAN configuration. Failure to perform these steps results in error messages and the inability to modify the VLAN NetFlow configuration in the upgraded software.

- When upgrading from Cisco NX-OS Releases 7.0(3)I4(8), 7.0(3)I5(3), and 7.0(3)I6(1) to Cisco NX-OS Release 10.1(x) results in a disruptive upgrade. If syncing images to standby SUP failed during the disruptive upgrade from Cisco NX-OS Releases 7.0(3)I4(8), 7.0(3)I5(3), or 7.0(3)I6(1) to 10.1(x), you should manually copy the image to the standby SUP and perform the disruptive upgrade.
- When upgrading directly to Cisco NX-OS Release 10.1(x) from any release prior to 7.0(x), the upgrade will be disruptive. For a non-disruptive upgrade, an intermediate upgrade to Cisco NX-OS Release 9.x is required. We recommend upgrading to the latest release of Cisco NX-OS Release 9.3(x) as an intermediate hop for the upgrade. For information about the supported upgrade paths, see the Cisco Nexus 9000 and 3000 Upgrade and ISSU Matrix.
- When upgrading from Cisco NX-OS Release 7.0(3)I6(1) or 7.0(3)I7(1) to Cisco NX-OS Release 10.1(x), if the Cisco Nexus 9000 Series switches are running vPC and they are connected to an IOS-based switch via Layer 2 vPC, there is a likelihood that the Layer 2 port channel on the IOS side will become error disabled. The workaround is to disable the spanning-tree etherchannel guard misconfig command on the IOS switch before starting the upgrade process.

Once both the Cisco Nexus 9000 Series switches are upgraded, you can re-enable the command.

- If you are upgrading from Cisco NX-OS Release 7.0(3)I5(2) to Cisco NX-OS Release 10.1(x) by using the **install all** command, BIOS will not be upgraded due to CSCve24965. When the upgrade to Cisco NX-OS Release 10.1(x) is complete, use the **install all** command again to complete the BIOS upgrade, if applicable.
- An upgrade that is performed via the **install all** command for Cisco NX-OS Release 7.0(3)I2(2b) to Release 10.1(x) might result in the VLANs being unable to be added to the existing FEX HIF trunk ports. To recover from this, the following steps should be performed after all FEXs have come online and the HIFs are operationally up:
 - 1. Enter the copy run bootflash:fex_config_restore.cfg command at the prompt.
 - Enter the copy bootflash:fex_config_restore.cfg running-config echo-commands command at the prompt.
- In Cisco NX-OS Release 7.0(3)I6(1) and earlier, performing an ASCII replay or running the copy file run command on a FEX HIF configuration requires manually reapplying the FEX configuration after the FEX comes back up.

- When upgrading to Cisco NX-OS Release 10.1(x) from 7.0(3)I2(x) or before and running EVPN VXLAN configuration, an intermediate upgrade to 7.0(3)I4(x) or 7.0(3)I5(x) or 7.0(3)I6(x) is required.
- Before enabling the FHS on the interface, we recommend that you carve the ifacl TCAM region on Cisco Nexus 9300 and 9500 platform switches. If you carved the ifacl TCAM region in a previous release, you must reload the system after upgrading to Cisco NX-OS Release 10.1(x). Uploading the system creates the required match qualifiers for the FHS TCAM region, ifacl.
- Before enabling the FHS, we recommend that you carve the ing-redirect TCAM region on Cisco Nexus 9200 and 9300-EX platform switches. If you carved the ing-redirect TCAM region in a previous release, you must reload the system after upgrading to Cisco NX-OS Release 10.1(x). Uploading the system creates the required match qualifiers for the FHS TCAM region, ing-redirect.
- Upgrading from Cisco NX-OS Release 9.3(1), 9.3(2) or 9.3(3) to a higher release, with Embedded Event Manager (EEM) configurations that are saved to the running configuration, may cause a DME error to be presented. The error is in the output of the **show consistency-checker dme running-config enhanced** command, specifically, the event manager commands. If this error occurs, delete all EEM applet configurations after completing the ISSU, then reapply the EEM configurations.
- For any prior release version upgrading to Cisco NX-OS Release 9.3(5) using ISSU, if the following logging level commands are configured, they are missing in the upgraded version and must be reconfigured:
 - logging level evmc value
 - logging level mvsh value
 - · logging level fs-daemon value
- For any prior release version upgrading to Cisco NX-OS Release 9.3(6) using ISSU, if the following logging level commands are configured, they are missing in the upgraded version and must be reconfigured:
 - logging level evmc value
 - logging level mvsh value
- An error occurs when you try to perform an ISSU if you changed the reserved VLAN without entering the copy running-config save-config and reload commands.
- The install all command is the recommended method for software upgrades because it performs configuration compatibility checks and BIOS upgrades automatically. In contrast, changing the boot variables and reloading the device bypasses these checks and the BIOS upgrade and therefore it is not recommended.
- Upgrading from Cisco NX-OS Release 7.0(3)I1(2), Release 7.0(3)I1(3), or Release 7.0(3)I1(3a) requires installing a patch for Cisco Nexus 9500 platform switches only. For more information on the upgrade patch, see Patch Upgrade Instructions.
- An ISSU can be performed only from a Cisco NX-OS Release 7.0(3)I4(1) to a later image.
- While performing an ISSU, VRRP and VRRPv3 displays the following messages:
 - If VRRPv3 is enabled:

```
2015 Dec 29 20:41:44 MDP-N9K-6 %$ VDC-1 %$ %USER-0-SYSTEM_MSG: ISSU ERROR: Service
"vrrpv3" has sent the following message: Feature vrrpv3 is configured. User can
change
```

vrrpv3 timers to 120 seconds or fine tune these timers based on upgrade time on all Vrrp Peers to avoid Vrrp State transitions. - sysmgr

• If VRRP is enabled:

```
2015 Dec 29 20:45:10 MDP-N9K-6 %$ VDC-1 %$ %USER-0-SYSTEM_MSG: ISSU ERROR: Service
"vrrp-
eng" has sent the following message: Feature vrrp is configured. User can change
vrrp
timers to 120 seconds or fine tune these timers based on upgrade time on all Vrrp
Peers to
avoid Vrrp State transitions. - sysmgr
```

- Guest Shell is disabled during an ISSU and reactivated after the upgrade. Any application running in the Guest Shell is affected.
- If you have ITD probes configured, you must disable the ITD service (using the **shutdown** command) before upgrading to Cisco NX-OS Release 10.1(x). After the upgrade, enter the **feature sla sender** command to enable IP SLA for ITD probes and then the **no shutdown** command to re-enable the ITD service. (If you upgrade without shutting down the service, you can enter the **feature sla sender** command after the upgrade.)
- Schedule the upgrade when your network is stable and steady.
- Avoid any power interruption, which could corrupt the software image, during the installation procedure.
- On devices with dual supervisor modules, both supervisor modules must have connections on the console ports to maintain connectivity when switchovers occur during a software upgrade. See the Hardware Installation Guide for your specific chassis.
- Perform the installation on the active supervisor module, not the standby supervisor module.
- The **install all** command is the recommended method for software upgrades because it performs configuration compatibility checks and BIOS upgrades automatically. In contrast, changing the boot variables and reloading the device bypasses these checks and the BIOS upgrade and therefore is not recommended.



- **Note** For Cisco Nexus 9500 platform switches with -R line cards, you must save the configuration and reload the device to upgrade from Cisco NX-OS Release 7.0(3)F3(5) to 9.3(1). To upgrade from Cisco NX-OS Release 9.2(2) or 9.2(3), we recommend that you use the **install all** command.
 - You can detect an incomplete or corrupt NX-OS software image prior to performing an upgrade by verifying the MD5, SHA256 or SHA512 checksum of the software image. To verify the MD5 checksum of the software image, run the show file bootflash:<IMAGE-NAME>md5sum command and compare the resulting value to the published MD5 checksum for the software image on Cisco's Software Download website. To verify the SHA512 checksum of the software image, run the show file bootflash:<IMAGE-NAME>md5sum command and compare the resulting value to the published mD5 checksum for the software image, run the show file bootflash:<IMAGE-NAME>sha512 checksum of the software image, run the show file bootflash:<IMAGE-NAME>sha512 checksum command and compare the resulting value to the published SHA512 checksum for the software image on Cisco's Software Download website.
 - When upgrading from Cisco Nexus 94xx, 95xx, and 96xx line cards to Cisco Nexus 9732C-EX line cards and their fabric modules, upgrade the Cisco NX-OS software before inserting the line cards and fabric modules. Failure to do so can cause a diagnostic failure on the line card and no TCAM space to be allocated. You must use the write_erase command followed by the reload command.


- If you upgrade from a Cisco NX-OS release that supports the CoPP feature to a Cisco NX-OS release that supports the CoPP feature with additional classes for new protocols, you must either run the setup utility using the **setup** command or use the **copp profile** command for the new CoPP classes to be available. For more information on these commands, see the "Configuring Control Plane Policing" chapter in the *Cisco Nexus 9000 Series NX-OS Security Configuration Guide, Release 10.1(x)*.
- For secure POAP, ensure that DHCP snooping is enabled and set firewall rules to block unintended or malicious DHCP servers. For more information on POAP, see the *Cisco Nexus 9000 Series Fundamentals Configuration Guide, Release 10.1(x).*
- When you upgrade from an earlier release to a Cisco NX-OS release that supports switch profiles, you have the option to move some of the running-configuration commands to a switch profile. For more information, see the *Cisco Nexus 9000 Series NX-OS System Management Configuration Guide, Release 10.1(x).*
- By default, the software upgrade process is disruptive.
- OpenFlow and LACP fast timer rate configurations are not supported for ISSU.
- Guest Shell is disabled during an ISSU and reactivated after the upgrade.
- When performing ND ISSU using BGP non-default hold timers, ensure that the BGP graceful-restart timer is reasonably long enough, for example, 180 seconds.
- During an ISSU on a Cisco Nexus 9300 Series switch, all First-Hop Redundancy Protocols (FHRPs) will cause the other peer to become active if the node undergoing the ISSU is active.
- Make sure that both vPC peers are in the same mode (regular mode or enhanced mode) before performing a nondisruptive upgrade.



Note

vPC peering between an enhanced ISSU mode (boot mode lxc) configured switch and a non-enhanced ISSU mode switch is not supported.

- During an ISSU, the software reload process on the first vPC device locks its vPC peer device by using CFS messaging over the vPC communications channel. Only one device at a time is upgraded. When the first device completes its upgrade, it unlocks its peer device. The second device then performs the upgrade process, locking the first device as it does so. During the upgrade, the two vPC devices temporarily run different releases of Cisco NX-OS; however, the system functions correctly because of its backward compatibility support.
- ISSU is not supported when onePK is enabled. You can run the **show feature** | **include onep** command to verify that this feature is disabled before performing an ISSU or enhanced ISSU.
- In general, ISSUs are supported for the following:
 - From a major release to any associated maintenance release.
 - From the last two maintenance releases to the next two major releases.
 - From an earlier maintenance release to the next two major releases.

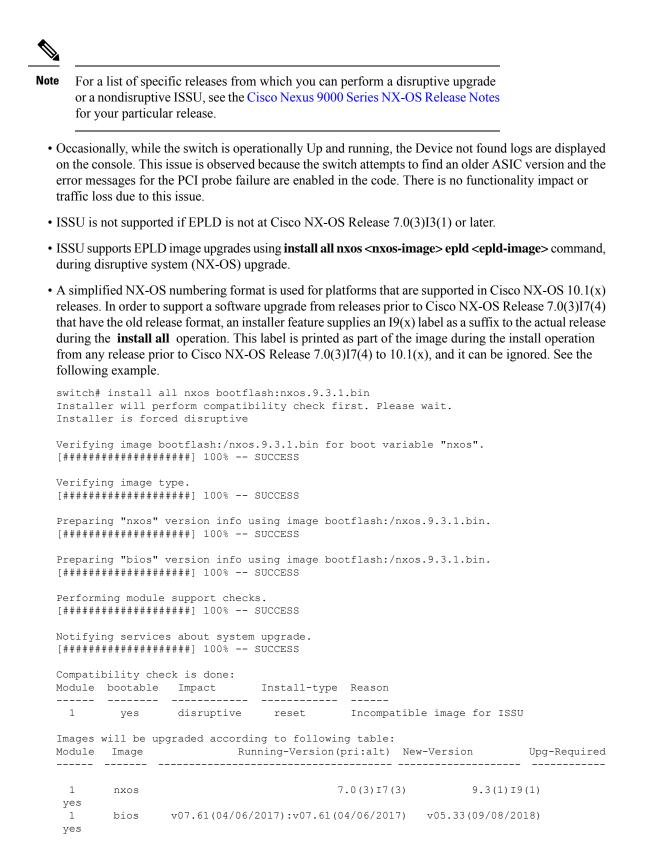

Switch will be reloaded for disruptive upgrade. Do you want to continue with the installation (y/n)? [n] y

- Beginning with Cisco NX-OS Release 9.3(5), standard, nondisruptive ISSU, on switches that are configured with uRPF, is supported on the following:
 - · Cisco Nexus 9300-EX platform switches
 - Cisco Nexus 9300-FX/FX2 platform switches
 - Cisco Nexus 9300-GX platform switches



Note

Prior to Cisco NX-OS Release 9.3(5), if any of the above switches were configured with uRPF, standard, nondisruptive ISSU was not supported.

- ISSU is blocked if boot poap enable is configured.
- When you upgrade from Cisco NX-OS Release 7.0(3)I7(1), 7.0(3)I7(2) or 7.0(3)I7(3) to Cisco NX-OS Release 10.2(x), the upgrade fails with below error message:

- Make sure that you follow below procedure to upgrade to 10.2(x) release:
 - Upgrade from 7.0(3)I7(1), 7.0(3)I7(2) or 7.0(3)I7(3) to 7.0(3)I7(5) and above code or 9.x code
 - Upgrade from 7.0(3)I7(5) or 9.x code to 10.2(x) code
- On performing a non-disruptive ISSU from Cisco NX-OS Release 7.0(3)I6(1) to any higher version, a
 traffic loss might occur based on the number of VLANs configured. To avoid traffic loss, it is
 recommended to increase the routing protocol's graceful restart timer to higher value. The recommended
 value of the graceful restart timer is 600 seconds. You can further increase or decrease this value based
 on the scale of the configuration.
- Beginning with Cisco NX-OS Release 10.1(1), Fs_daemon does not support snmpwalk on devices with more than 5000 files. When performing snmpwalk on a device with more than 5000 files, the error resourceUnavailable (This is likely a out-of-memory failure within the agent) is an expected behaviour.
- Beginning with Cisco NX-OS Release 10.1(2), CoPP is supported on N9K-X9624D-R2 and N9K-C9508-FM-R2 platform switches.
- Beginning with Cisco NX-OS Release 10.1(2), RACL is supported on N9K-X9624D-R2 and N9K-C9508-FM-R2 platform switches.

- While performing an ISSU from Cisco NX-OS Release 9.3(5), 9.3(6), 9.3(7), 10.1(1), or 10.1(2) to Cisco NX-OS Release 10.2(1) or higher release, ISSU will be blocked.
- ISSU is blocked when the delay config is present in track list Boolean/weight.
- If the IPv6 ND timeouts during ISSU, then the IPv6 BFD session may flap after the ISSU.
- Beginning with Cisco NX-OS Release 10.2(3)F, non-disruptive ISSU is supported for VPC fabric peering on all Cisco Nexus 9300-X TORs. Both standard and enhanced non-disruptive upgrades are supported. Note that ISSU should be started or triggered when there is no failure. An example for failure would be one of the VPC legs is down.
- The recommended routing protocol graceful restart timer is 600 seconds and nve source-interface hold-down-time is 400 seconds.
- It is recommended to set disable-fka on VFC interfaces in E or F mode, when invoking ND native ISSU
 on switch mode testbed. If not, it can be disruptive.
- If there is a VRF scale, for a non-disruptive ISSU under each VRF, you must configure graceful restart timer to 300 seconds.
- For platforms that need to be upgraded from any release to nxos64-cs.10.3(1)F or higher release, use nxos.9.3.10.bin or nxos64-cs.10.2(3)F or higher release as an interim hop. This restriction is applicable to both disruptive and non-disruptive upgrades. The nxos64-msll.10.3(1)F does not have this restriction.
- Loading an unsupported image on Cisco Nexus 9800 platform switches cause the switch to be stuck. Only a power cycle can reset it.
- Disruptive upgrade from any version before 9.3(10) or 10.2(3)F may fail due to CSCwb63451. You must upgrade to 9.3(10) or 10.2(3)F first, before upgrading to 10.3(1)F or later.
- Beginning with Cisco NX-OS Release 10.3(2)F, 2xSFP Eth10/1-2 are not supported on N9K-C9400-SW-GX2A. However, from Cisco NX-OS Release 10.4(2)F onwards, N9K-C9400-SW-GX2A Sup card ports 2xSFP Eth10/1-2 are supported.
- While performing an ISSU on the L2 switch in a vPC complex or a LAN scenario, the IGMP group timeout must be configured with higher value as the L2 switch will not be able to forward the reports/queries during the control plane down time. The L2 snooping querier interval must also be matched to the L3 querier interval.
- When upgrading from earlier release to Cisco NX-OS Release 10.3(3)F and later, if the **hardware rate-limiter span-egress** command is configured then it must be removed and reapplied after the upgrade/ISSU is complete.
- ASIC SFP+ ports Eth10/1-2 are not supported in Cisco NX-OS Releases 10.3(2)F, 10.3(3)F, and 10.4(1)F. Beginning with Cisco NX-OS Release 10.4(2)F, these ports are supported. However, note that after reloading the system, these ASIC SFP+ Eth10/1-2 ports can take up to 3 minutes to link up.
- Beginning with Cisco NX-OS Release 10.3(3)F, only the LXC mode is supported on Cisco Nexus 9300-FX3 and 9300-GX switches, which allows you to perform enhanced non-disruptive ISSU with minimal downtime.
- While performing multi-hop ND ISSU upgrade to higher releases, use 10.3(5)M or higher release as an intermediate hop.
 - If the switch has been previously upgraded using multi-hop ND ISSU and experiences unexpected CoPP drops, open a TAC case to determine if remediation is required.

- Beginning with Cisco NX-OS Release 10.4(1)F, only the LXC mode is supported on Cisco Nexus 9300-FX and 9300-FX2 switches, in addition to Cisco Nexus 9300-FX3 and 9300-GX switches. This allows you to perform enhanced non-disruptive ISSU with minimal downtime. However, on the rest of the Cisco Nexus 9000 switches, you have an option to perform a non-disruptive ISSU in the enhanced LXC mode with minimal downtime.
- Beginning with Cisco NX-OS Release 10.4(1)F, only the enhanced LXC mode is supported on Cisco Nexus N9K-C9332D-H2R, N9K-C9348GC-FX3, and N9K-C9348GC-FX3PH switches by default.
- Beginning with Cisco NX-OS Release 10.4(2)F, SR ISSU is not supported with underlay ISIS.
- Beginning with Cisco NX-OS Release 10.4(2)F, nondisruptive ISSU is supported for segment routing traffic engineering (SR-TE) features with BGP as underlay on Cisco Nexus 9300 and 92348GC-X platform switches; and on 9300-HX platform switches from Cisco NX-OS Release 10.4(3)F. However, the following features are not supported on nondisruptive ISSU:
 - SR L2EVPN
 - ISIS and OSPF underlay
 - vPC configuration with segment-routing
 - Egress Peer engineering
 - · Segment routing and GRE co existence
- Beginning with Cisco NX-OS Release 10.4(2)F, for Nexus 9300-R platforms, to upgrade bios to the latest version you should first upgrade to nxos image. This release onwards, the install all nxos command only upgrades the nxos sw to the latest version but the bios image will be upgraded to the last bios released prior to 10.4(2)F version.

To upgrade to bios released with 10.4(2)F or higher version, first upgrade the nxos image and then use bios-force option to upgrade the bios. For example,

1. Install all nxos bootflash:nxos64-msll.10.4.2.F.bin.

The system reloads and boots up with 10.4(2)F image.

2. Install all nxos bios-force.

Note The switch reloads twice, once for nxos upgrade and then again for bios upgrade.

- Beginning with Cisco NX-OS Release 10.4(3)F, non-disruptive ISSU is not supported on Cisco Nexus 92348GC-X.
- While performing ND ISSU, if a router is configured with BGP prefix peers, prefix-peer-timeout (default value 30s) should be greater than GR timer (default value 120s), to allow the prefix peers to resume the connection after ISSU.
- Beginning with Cisco NX-OS Release 10.5(1)F, s1 image is introduced specifically for Cisco Nexus 9800 switches.

Upgrade of Nexus 9800 switches from earlier releases that have cs image format to the s1 image format in Cisco NX-OS Release 10.5(1)F and later is supported.

ISSU Platform Support

The following tables identify the platforms supporting standard and enhanced ISSU, and the release when the support was introduced.

Note Enhanced ISSU cannot be supported if there is kernel update in the target release without reloading the container. The system will prompt the following message:

Host kernel is not compatible with target image. Full ISSU will be performed and control plane will be impacted.

In effect, system will perform non-disruptive ISSU instead of enhanced ISSU.

ISSU Type	Release/Supported Platforms	Features Not Supported with Non-disruptive ISSU
Standard	Beginning with Cisco NX-OS Release 7.0(3)I6(1):Cisco Nexus 92300YCBeginning with Cisco NX-OS Release 9.3(3):Cisco Nexus 92348GC-X	Both ISSU types are disruptive for Cisco Nexus 9200 platform switches configured with the following features: • Segment routing
Enhanced	Cisco Nexus 92300YC	• Tetration Note Beginning with Cisco NX-OS Release 10.4(2)F, non-disruptive ISSU is supported for segment routing traffic engineering (SR-TE) features with BGP as underlay only on Cisco Nexus 92348GC-X platform switches. For more information about the features that are not supported, see Cisco NX-OS Software Upgrade Guidelines, on page 7.
		Note Beginning with Cisco NX-OS Release 10.4(3)F, non-disruptive ISSU is not supported on Cisco Nexus 92348GC-X. For more information about the features that are not supported, see Cisco NX-OS Software Upgrade Guidelines, on page 7.

ISSU for Cisco Nexus 9200 Platform Switches

ISSU Type	Relea	se/Supported Platforms	Features Not Supported with Non-disruptive ISSU
Standard	Cisco	 nning with Cisco NX-OS Release 9.3(3): Nexus 9332C Nexus 9364C ISSU on Cisco Nexus 9300 platform switches is supported when the switch is the spanning tree root. You can use the show spanning-tree issu-impact command to verify if the switch meets this criteria. 	 Both ISSU types are disruptive for Cisco Nexus 9300 platform switches configured with the following features: Dual-homed FEX Segment routing Note Beginning with Cisco NX-OS Release 10.4(2)F, non-disruptive ISSU is supported for segment routing traffic engineering (SR-TE) features with BGP as underlay only on Cisco Nexus 9300 platform switches. For more information about the features that are not supported, see Cisco NX-OS Software Upgrade Guidelines, on page 7.
Enhanced	Cisco	 nning with Cisco NX-OS Release 9.3(5): Nexus 9332C Nexus 9364C ISSU on Cisco Nexus 9300 platform switches is supported when the switch is the spanning tree root. You can use the show spanning-tree issu-impact command to verify if the switch meets this criteria. 	

ISSU for Cisco Nexus 9300 Platform Switches

Release/Supported Platforms	Features Not Supported with Non-disruptive ISSU
Beginning with Cisco NX-OS Release 10.2(3)F, VPC Fabric peering is supported on Cisco Nexus 9300-X TORs.	Beginning with Cisco NX-OS Release 10.2(3)F, the following VXLAN/ VPC features are not
Beginning with Cisco NX-OS Release 10.2(3)F, VPC Fabric peering is supported on Cisco Nexus 9300-X TORs.	 supported during non- disruptive ISSU for VPC Fabric Peering: TRM VXLAN IPv6 underlay Proportional Multipath for VNF VXLAN Flood-and-learn HSRP and VRRP VXLAN Cloudsec VXLAN to SR Handoff and all Handoff features Multi-Site Note Beginning with Cisco NX-OS Release 10.4(2)F, non-disruptive ISSU is supported for VXLAN to SR Handoff with BGP as underlay on Cisco Nexus
	Beginning with Cisco NX-OS Release 10.2(3)F, VPCFabric peering is supported on Cisco Nexus 9300-XTORs.Beginning with Cisco NX-OS Release 10.2(3)F, VPCFabric peering is supported on Cisco Nexus 9300-X

ISSU for Cisco Nexus 9300-X Platform Switches

Release/Supported Platforms	Features Not Supported with Non-disruptive ISSU
Beginning with Cisco NX-OS Release 7.0(3)I6(1): Cisco Nexus 93108TC-EX Cisco Nexus 93180YC-EX	Both ISSU types are disruptive for Cisco Nexus 9300-EX platform switches configured with the following features:
Beginning with Cisco NX-OS Release 7.0(3)I7(3): Cisco Nexus 93108TC-EX Cisco Nexus 93180YC-EX	 Segment routing Tetration Note Beginning with Cisco NX-OS Release 10.2(1), both ISSU types are non-disruptive for Cisco Nexus 9300-EX platform switches configured with Straight-Through FEX
	Beginning with Cisco NX-OS Release 7.0(3)I6(1): Cisco Nexus 93108TC-EX Cisco Nexus 93180YC-EX Beginning with Cisco NX-OS Release 7.0(3)I7(3): Cisco Nexus 93108TC-EX

ISSU for Cisco Nexus 9300-EX Platform Switches

ISSU Type	Release/Supported Platforms	Features Not Supported with Non-disruptive ISSU
Standard	Cisco NX-OS Release 9.3(1) and 9.3(2): None	Standard ISSU is disruptive for
	Beginning with Cisco NX-OS Release 9.3(3):	Cisco Nexus 9300-FX platform switches configured with the following features:
	Cisco Nexus 9336C-FX2	
	Cisco Nexus 93240YC-FX2	Segment Routing
	Cisco Nexus 93240YC-FX2Z	• TRM Feature
	Cisco Nexus 9348GC-FXP	Note Beginning with Cisco NX-OS
	Cisco Nexus 93108TC-FX	Release 10.2(1), Standard
	Cisco Nexus 93180YC-FX	ISSU is non-disruptive for Cisco Nexus 9300-FX
	Beginning with Cisco NX-OS Release 10.2(1)F:	platform switches configured with Straight-Through FEX and Dual-Homed FEX.
	Cisco Nexus 93180YC-FX3	
	Cisco Nexus 93180YC-FX3S	
	Beginning with Cisco NX-OS Release 10.4(1)F:	Beginning with Cisco NX-OS Release 10.3(3)F, standard ISSU is not supported on Cisco Nexus 93180YC-FX3 and FX3S platform switches. Beginning with Cisco NX-OS Release 10.4(1)F, standard ISSU is not supported on Cisco Nexus 9300-FX and 9300-FX2 platform switches.
	9348GC-FX3	
	9348GC-FX3PH	
	Beginning with Cisco NX-OS Release 10.4(2)F:	
	93108TC-FX3	
		Note Beginning with Cisco NX-OS Release 10.4(2)F, non-disruptive ISSU is supported for segment routing traffic engineering (SR-TE) features with BGP as underlay only on Cisco Nexus 9300 platform switches. For more information about the features that are not supported, see Cisco NX-OS Software Upgrade Guidelines, on page 7.

ISSU for Cisco Nexus 9300-FX Platform Switches

ISSU Type	Release/Supported Platforms	Features Not Supported with Non-disruptive ISSU
Enhanced	Cisco NX-OS Release 9.3(1), 9.3(2), and 9.3(3): None	
	Beginning with Cisco NX-OS Release 9.3(5):	
	Cisco Nexus 9336C-FX2	
	Cisco Nexus 93240YC-FX2	
	Cisco Nexus 93216TC-FX2	
	Cisco Nexus 93360YC-FX2	
	Cisco Nexus 93240YC-FX2Z	
	Cisco Nexus 9348GC-FXP	
	Cisco Nexus 93108TC-FX	
	Cisco Nexus 93180YC-FX	
	Beginning with Cisco NX-OS Release 10.1(1), Enhanced ISSU is supported on the following platforms with FC/FCoE features:	
	Cisco Nexus 93360YC-FX2	
	Cisco Nexus 93180YC-FX	
	Beginning with Cisco NX-OS Release 10.2(1)F, Enhanced ISSU is supported on the following platforms:	
	Cisco Nexus 93180YC-FX3	
	Cisco Nexus 93180YC-FX3S	
	Beginning with Cisco NX-OS Release 10.4(1)F:	
	9348GC-FX3	
	9348GC-FX3PH	
	Beginning with Cisco NX-OS Release 10.4(2)F:	
	93108TC-FX3	
	Beginning with Cisco NX-OS Release 10.2(2)F, Enhanced ISSU is supported on the following platform with FC/FCoE features:	
	N9K-C9336C-FX2-E	

ISSU Type	Release/Supported Platforms	Features Not Supported with Non-disruptive ISSU
		Enhanced ISSU is disruptive for Cisco Nexus 9300-FX platform switches configured with the following features:
		Segment Routing
		• TRM Feature
		Note In Cisco NX-OS Releases 9.3(x), Enhnaced ISSU on Cisco Nexus 93360YC-FX2 and Cisco Nexus 93180YC-FX with FC/FCoE features will be disruptive.
		Note Beginning with Cisco NX-OS Release 10.2(1), Enhanced ISSU is non-disruptive for Cisco Nexus 9300-FX platform switches configured with Straight-Through FEX and Dual-Homed FEX.
		Beginning with Cisco NX-OS Release 10.3(3)F, only the LXC mode is supported on Cisco Nexus 9300-FX3 and 9300-FX3S switches, which allows you to perform enhanced non-disruptive ISSU with minimal downtime.
		Beginning with Cisco NX-OS Release 10.4(1)F, only the LXC mode is supported on Cisco Nexus 9300-FX and 9300-FX2 switches, which allows you to perform enhanced non-disruptive ISSU with minimal downtime.
		Note Beginning with Cisco NX-OS Release 10.4(2)F, non-disruptive ISSU is supported for segment routing traffic engineering (SR-TE) features with BGP as underlay only on Cisco Nexus 9300 platform switches. For more

ISSU Type	Release/Supported Platforms	Features Not Supported with Non-disruptive ISSU
		information about the features that are not supported, see Cisco NX-OS Software Upgrade Guidelines, on page 7.

ISSU for Cisco Nexus 9300-GX Platform Switches

ISSU Type	Release/Supported Platforms	Features Not Supported with Non-disruptive ISSU
Standard	Beginning with Cisco NX-OS Release 10.1(1): Cisco Nexus 9364C-GX Cisco Nexus 9316D-GX Cisco Nexus 93600CD-GX Note Beginning with Cisco NX-OS Release 10.3(3)F, standard ISSU is not supported on Cisco Nexus 9300-GX platform switches.	 TRM Feature Segment Routing Note Beginning with Cisco NX-OS Release 10.3(3)F, standard ISSU is not supported on Cisco Nexus 9300-GX platform switches. Note Beginning with Cisco NX-OS Release 10.4(2)F, non-disruptive ISSU is supported for segment routing traffic engineering (SR-TE) features with BGP as underlay only on Cisco Nexus 9300 platform switches. For more information about the features that are not supported, see Cisco NX-OS Software Upgrade Guidelines, on page 7.

ISSU Type	Release/Supported Platforms	Features Not Supported with Non-disruptive ISSU
Enhanced	Beginning with Cisco NX-OS Release 10.1(1):	TRM Feature
	Cisco Nexus 9364C-GX	Segment Routing
	Cisco Nexus 9316D-GX Cisco Nexus 93600CD-GX	Note Beginning with Cisco NX-OS Release 10.4(2)F,
	Beginning with Cisco NX-OS Release 10.2(2)F, Enhanced ISSU is supported on Cisco Nexus 9300-GX2B platform switches.	non-disruptive ISSU is supported for segment routing traffic engineering (SR-TE) features with BGP as underlay
	Beginning with Cisco NX-OS Release 10.2(3)F, Enhanced ISSU is supported on Cisco Nexus 9300-GX2A platform switches.	only on Cisco Nexus 9300 platform switches. For more information about the features
	Beginning with Cisco NX-OS Release 10.3(3)F, only the LXC mode is supported on Cisco Nexus 9300-GX switches, which allows you to perform enhanced non-disruptive ISSU with minimal downtime.	Ciana NV OC Cathering

ISSU for Cisco Nexus 9300-HX Platform Switches

ISSU Type	Release/Supported Platforms	Features Not Supported with Non-disruptive ISSU
Enhanced	Boot mode LXC ISSU is supported by default on the following Cisco Nexus C9300-HX platform switches: • N9K-C9332D-H2R - Beginning with Cisco NX-OS Release 10.4(1)F • N9K-C93400LD-H1 - Beginning with Cisco NX-OS Release 10.4(2)F • N9K-C9364C-H1 - Beginning with Cisco NX-OS	The following features are not supported on ND ISSU: • SR L2EVPN • ISIS and OSPF underlay • vPC configuration with segment-routing
	Release 10.4(3)F	 Egress Peer engineering Segment routing and GRE co-existence

ISSU for Cisco Nexus 9400 Platform Switches

ISSU Type	Release/Supported Platforms	Features Not Supported with Non-disruptive ISSU
Enhanced	Beginning with Cisco NX-OS Release 10.4(1)F, Enhanced ISSU is supported on Cisco Nexus C9408 platform switch.	TRM FeatureSegment Routing

Cisco NX-OS Software Downgrade Guidelines

Before attempting to downgrade to an earlier software release, follow these guidelines:

• The only supported method of downgrading a Cisco Nexus 9000 Series switch is to utilize the install all command. Changing the boot variables, saving the configuration, and reloading the switch is not a supported method to downgrade the switch.

Disable the Guest Shell if you need to downgrade from Cisco NX-OS Release 9.3(x) to an earlier release.

• Performing an ISSU downgrade from Cisco NX-OS Release 9.3(x) to Release 7.0(3)I4(1) with an FCoE (Fiber Channel over Ethernet) NPV (N-port Virtualization) configuration causes the port channel to crash with a core file:

```
[################# ] 38%2016 Apr 18 20:52:35 n93-ns1 %$ VDC-1 %$ %SYSMGR-2-
SERVICE_CRASHED: Service "port-channel" (PID 14976) hasn't caught signal 11 (core
will
be saved)
```

- ISSU (non-disruptive) downgrade is not supported
- When downgrading from the Cisco NX-OS Release 9.3(x) to earlier releases, any ACL with the statistics per-entry command enabled and applied as RACL needs the statistics per-entry command removed from the running configuration before downgrading. Otherwise, the interfaces on which this ACL is applied as a RACL will be error disabled after the downgrade.
- Prior to downgrading a Cisco Nexus 9500-series switch, with -FX or -FX+EX line cards, from Cisco NX-OS Release 10.1(x) to earlier releases (9.2(x) or 7.x), the TCAM region that applies to NetFlow (ing-netflow) should be carved to zero (0) using the following command:

hardware access-list tcam region ing-netflow 0

The configuration change is required because the default ing-netflow TCAM region in 9.3(1) and onwards is 512 while the default in 9.2(x) and earlier is 0.

- When downgrading from the Cisco NX-OS Release 10.1(x) to a release prior to 9.3(x), make sure that the ACL TCAM usage for ingress features does exceed the allocated TCAM space in the absence of the label sharing feature. Label sharing is a new feature in Cisco NX-OS Release 9.3(x). Otherwise, interfaces with RACLs that could not fit in the TCAM will be disabled after the downgrade.
- Software downgrades should be performed using the **install all** command. Changing the boot variables, saving the configuration, and reloading the switch is not a supported method to downgrade the switch.
- The following limitation applies to Cisco Nexus platform switches that support Trust Anchor Module (TAM):

The TACACS global key cannot be restored when downgrading from Cisco NX-OS Release 9.3(3) and higher to any earlier version. TAM was updated to version-7 in 9.3(3), but earlier NX-OS versions used TAM version-3.

- iCAM must be disabled before downgrading from Release 9.2(x) or Release 9.3(x) \rightarrow 7.0(3)I7(1). Only Release 9.3(1) \rightarrow Release 9.2(4) can be performed if iCAM is enabled.
- Beginning with Cisco NX-OS Release 9.3(3), new configuration commands exist for SRAPP (with sub-mode options for MPLS and SRTE). The SRAPP configuration on the switch running release 9.3(3) (or later) will not be present if the switch is downgraded to an earlier release.

- On devices with dual supervisor modules, both supervisor modules must have connections on the console ports to maintain connectivity when switchovers occur during a software downgrade. See the Hardware Installation Guide for your specific chassis.
- Cisco NX-OS automatically installs and enables the guest shell by default. However, if the device is
 reloaded with a Cisco NX-OS image that does not provide guest shell support, the existing guest shell
 is automatically removed and a %VMAN-2-INVALID_PACKAGE message is issued. As a best practice,
 remove the guest shell with the guestshell destroy command before downgrading to an earlier Cisco
 NX-OS image.
- You must delete the switch profile (if configured) when downgrading from a Cisco NX-OS release that supports switch profiles to a release that does not. For more information, see the *Cisco Nexus 9000 Series NX-OS System Management Configuration Guide, Release 10.1(x).*
- Software downgrades are disruptive. In-service software downgrades (ISSDs), also known as nondisruptive downgrades, are not supported.
- While downgrading from the Cisco NX-OS Release 10.2(1)F or higher to an earlier release, the **install** all command is blocked when the delay config is present in track list Boolean/weight.
- While performing ISSD from Cisco NX-OS Release 10.2(3)F to Cisco NX-OS Release 10.2(2)F with **epbr L2** applied on interfaces, remove the policies from interfaces before performing ISSD to avoid the duplicate tracks issue.
- Beginning with Cisco NX-OS Release 10.2(3)F, if you have configured the **lldp chassis-id switch** command, then you must disable the command before performing ISSD.
- Beginning with 10.2(3)F, although application of ePBR policy to access ports is supported, downgrading with this configuration is not recommended.
- When feature ngmvpn is enabled and a disruptive downgrade is performed from Cisco NX-OS Release 10.3(2)F to Cisco NX-OS Release 10.3(1)F, although a few VRFs are missing from the show run output, this is only a display issue, and has no functional impact.
- When a switch is downgraded from Cisco NX-OS Release 10.3(3)F or 10.4(1)F to a version that supports both Native and LXC modes, the switch always goes to Native mode even if the upgrade was done from LXC mode. To keep the mode persistent after a downgrade, ensure that you perform the downgrade in the following sequence:

Note

- The following sections are applicable only to Cisco Nexus 9300-FX3 and 9300-GX platform switches.
- When system comes up in native mode on downgrade, boot mode lxc is removed from configuration.
- LXC mode upgrade/downgrade: For example,
- 1. The switch is running on Cisco NX-OS Release 10.3(2)F in LXC mode.
- 2. Upgrade the version to Cisco NX-OS Release 10.3(3)F (LXC mode).
- 3. Downgrade the version to Cisco NX-OS Release 10.3(2)F to the Native mode.

- 4. Execute the boot mode lxc configuration command, save the configuration, and reload the switch.
- 5. The switch comes up in Cisco NX-OS Release 10.3(2)F LXC mode.
- Native mode upgrade/downgrade:

Example 1

- 1. The switch (9300-FX3 or 9300-GX) is running on Cisco NX-OS Release 10.3(2)F in the Native mode.
- Upgrade the version to Cisco NX-OS Release 10.3(3)F (LXC mode), as these (9300-FX3 or 9300-GX) switches support only LXC mode.
- 3. Downgrade to any earlier Cisco NX-OS Release [for example, 10.3(2)].
- 4. The switch comes up in Cisco NX-OS Release 10.3(2)F in Native mode.

Example 2

- The switch (Cisco Nexus 9300-FX or 9300-FX2) is running on Cisco NX-OS Release 10.3(2)F in the Native mode.
- Upgrade the version to Cisco NX-OS Release 10.4(1)F (LXC mode), as these switches support only LXC mode.
- **3.** Downgrade to any earlier Cisco NX-OS Release [for example, 10.3(2)].
- 4. The switch comes up in Cisco NX-OS Release 10.3(2)F in Native mode.
- When you downgrade from Cisco NX-OS Release 10.4(2)F to any earlier releases until 10.3(2)F (included), N9K-C9400-SW-GX2A Sup card ports 2xSFP Eth10/1-2 are not supported.
- When Cisco Nexus 9400 has feature security-group enabled, then downgrade from 10.5(1)F release to a lower release is not possible as feature security-group is not supported on 9400 in 10.4(3)F release and earlier.
- Downgrade of Nexus 9800 switches that have s1 image format from Cisco NX-OS Release 10.5(1)F to earlier releases that have cs image format is supported. However, as the s1 image is not present in earlier releases, the downgrade should be done to the cs image from the corresponding release.

Upgrade Paths

For ISSU compatibility for all release and information about the upgrade paths, see the Cisco Nexus 9000 and 3000 Upgrade and ISSU Matrix.

Upgrade Patch Instructions

On Cisco Nexus 9500 series switches only, a software upgrade from Cisco NX-OS Release 7.0(3)I1(2), 7.0(3)I1(3), or 7.0(3)I1(3a) to any other Cisco NX-OS release requires installing two patches prior to upgrading

using the **install all** command. These patches are available for each respective release and can be downloaded using the links below.

Â

Caution

Failing to follow this procedure could require console access in order to recover the switch after the upgrade.

Ø

Note These patches are only for upgrading. After the upgrade, the patch is automatically removed. If you decide not to upgrade after installing the patches, do not deactivate it. Deactivating the patch may cause a bios_daemon crash.

Cisco NX-OS Release 7.0(3)I1(2) Upgrade Patch

Cisco NX-OS Release 7.0(3)I1(3) Upgrade Patch

Cisco NX-OS Release 7.0(3)I1(3a) Upgrade Patch

To install these patches prior to upgrading using the install all command, follow the instructions shown below. An example is demonstrated below with an NX-OS software patch and upgrade from 7.0(3)I1(2) to 7.0(3)I7(1):

1. Add both patches with the install add bootflash: {patch-file.bin} command.

```
switch(config)# install add bootflash:n9000-dk9.7.0.3.I1.2.CSCuy16604.bin
Install operation 16 completed successfully at Thu Mar 3 04:24:13 2016
switch(config)# install add bootflash:n9000-dk9.7.0.3.I1.2.CSCuy16606.bin
Install operation 17 completed successfully at Thu Mar 3 04:24:43 2016
```

2. Activate both patches with the install activate {*patch-file.bin*} command.

```
switch(config)# install activate n9000-dk9.7.0.3.I1.2.CSCuy16604.bin
Install operation 18 completed successfully at Thu Mar 3 04:28:38 2016
switch (config)# install activate n9000-dk9.7.0.3.I1.2.CSCuy16606.bin
Install operation 19 completed successfully at Thu Mar 3 04:29:08 2016
```

3. Commit both patches with the **install commit** {*patch-file.bin*} command.

```
switch(config)# install commit n9000-dk9.7.0.3.I1.2.CSCuy16604.bin
Install operation 20 completed successfully at Thu Mar 3 04:30:38 2016
switch (config)# install commit n9000-dk9.7.0.3.I1.2.CSCuy16606.bin
Install operation 21 completed successfully at Thu Mar 3 04:31:16 2016
```

4. Proceed with an NX-OS software upgrade to the desired target release with the install all command.

```
switch (config)# install all nxos bootflash:nxos.7.0.3.I7.1.bin
Installer will perform compatibility check first. Please wait.
uri is: /nxos.7.0.3.I7.1.bin
Installer is forced disruptive
```

Verifying image type. [############################] 100% -- SUCCESS

Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.I7.1.bin. [#######################] 100% -- SUCCESS Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.I7.1.bin. Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.17.1.bin. Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.17.1.bin. [###################### 100% -- SUCCESS Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.17.1.bin. Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.17.1.bin. Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.I7.1.bin. [###################### 100% -- SUCCESS Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.I7.1.bin. [###################### 100% -- SUCCESS Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.17.1.bin. [###################### 100% -- SUCCESS Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.I7.1.bin. Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.I7.1.bin. [#####################] 100% -- SUCCESS Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.I7.1.bin. [##################### 100% -- SUCCESS Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.I7.1.bin. Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.I7.1.bin. Preparing "nxos" version info using image bootflash:/nxos.7.0.3.17.1.bin. Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.I7.1.bin. Preparing "lcn9k" version info using image bootflash:/nxos.7.0.3.17.1.bin. [#######################] 100% -- SUCCESS Performing module support checks. [##################### 100% -- SUCCESS Notifying services about system upgrade. Compatibility check is done: Module bootable Impact Install-type Reason _____ _____ _____ ____ 1 disruptive reset Incompatible image yes 6 disruptive Incompatible image yes reset reset Incompatible image

disruptive

disruptive

reset Incompatible image

8

9

ves

yes

10	yes	disruptive	reset	Incompatible	image
11	yes	disruptive	reset	Incompatible	image
14	yes	disruptive	reset	Incompatible	image
15	yes	disruptive	reset	Incompatible	image
16	yes	disruptive	reset	Incompatible	image
21	yes	disruptive	reset	Incompatible	image
22	yes	disruptive	reset	Incompatible	image
23	yes	disruptive	reset	Incompatible	image
24	yes	disruptive	reset	Incompatible	image
25	yes	disruptive	reset	Incompatible	image
26	yes	disruptive	reset	Incompatible	image
27	yes	disruptive	reset	Incompatible	image
28	yes	disruptive	reset	Incompatible	image
29	yes	disruptive	reset	Incompatible	image
30	yes	disruptive	reset	Incompatible	image

Images will be upgraded according to following table:

Module	Image	Running-Version (pri:alt)	New-Version	Upg-Required
1	lcn9k	7.0(3)I1(2)	7.0(3)17(1)	yes
1	bios	v01.42(00:v01.42(00	v01.48(00	yes
6	lcn9k	7.0(3)I1(2)	7.0(3)I7(1)	yes
6	bios	v01.48(00:v01.48(00	v01.48(00	no
8	lcn9k	7.0(3)I1(2)	7.0(3)17(1)	yes
8	bios	v01.48(00:v01.29(00	v01.48(00	no
9	lcn9k	7.0(3)I1(2)	7.0(3)17(1)	yes
9	bios	v01.48(00:v01.35(00	v01.48(00	no
10	lcn9k	7.0(3)I1(2)	7.0(3)17(1)	yes
10	bios	v01.48(00:v01.42(00	v01.48(00	no
11	lcn9k	7.0(3)I1(2)	7.0(3)17(1)	yes
11	bios	v01.48(00:v01.52(00	v01.48(00	no
14	lcn9k	7.0(3)I1(2)	7.0(3)I7(1)	yes
14	bios	v01.48(00:v01.48(00	v01.48(00	no
15	lcn9k	7.0(3)I1(2)	7.0(3)17(1)	yes
15	bios	v01.48(00:v01.40(00	v01.48(00	no
16	lcn9k	7.0(3)I1(2)	7.0(3)17(1)	yes
16	bios	v01.48(00:v01.42(00	v01.48(00	no
21	lcn9k	7.0(3)I1(2)	7.0(3)17(1)	yes
21	bios	v01.48(00:v01.42(00	v01.48(00	no
22	lcn9k	7.0(3)I1(2)	7.0(3)I7(1)	yes
22	bios	v01.48(00:v01.40(00	v01.48(00	no
23	lcn9k	7.0(3)I1(2)	7.0(3)I7(1)	yes
23	bios	v01.48(00:v01.40(00	v01.48(00	no
24	lcn9k	7.0(3)I1(2)	7.0(3)17(1)	yes
24	bios	v01.48(00:v01.40(00	v01.48(00	no
25	lcn9k	7.0(3)I1(2)	7.0(3)I7(1)	yes
25	bios	v01.48(00:v01.40(00	v01.48(00	no
26	lcn9k	7.0(3)I1(2)	7.0(3)17(1)	yes
26	bios	v01.48(00:v01.40(00	v01.48(00	no
27	nxos	7.0(3)I1(2)	7.0(3)17(1)	yes
27	bios	v08.06(09/10/2014):v08.18(08/11/2015)	v08.26(01/12/2016)	yes
28	nxos	7.0(3)I1(2)	7.0(3)I7(1)	yes
28	bios	v08.06(09/10/2014):v08.26(01/12/2016)	v08.26(01/12/2016)	yes
29	lcn9k	7.0(3)I1(2)	7.0(3)17(1)	yes
29	bios	v01.48(00:v01.35(00	v01.48(00	no
30	lcn9k	7.0(3)I1(2)	7.0(3)I7(1)	yes
30	bios	v01.48(00:v01.35(00	v01.48(00	no

Switch will be reloaded for disruptive upgrade. Do you want to continue with the installation (y/n)? [n] y

Install is in progress, please wait.

Performing runtime checks.

[##################### 100% -- SUCCESS Syncing image bootflash:/nxos.7.0.3.17.1.bin to standby. [###################### 100% -- SUCCESS Setting boot variables. Performing configuration copy. Module 1: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. Module 6: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. Module 8: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. Module 9: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. Module 10: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. Module 11: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. Module 14: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. [##################### 100% -- SUCCESS Module 15: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. [##################### 100% -- SUCCESS Module 16: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. [#####################] 100% -- SUCCESS Module 21: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. [#####################] 100% -- SUCCESS Module 22: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. Module 23: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time.

Module 25: Refreshing compact flash and upgrading bios/loader/bootrom.

Warning: please do not remove or power off the module at this time. [####################### 100% -- SUCCESS Module 26: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. [#####################] 100% -- SUCCESS Module 27: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. [###################### 100% -- SUCCESS Module 28: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. Module 29: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. [###################### 100% -- SUCCESS Module 30: Refreshing compact flash and upgrading bios/loader/bootrom. Warning: please do not remove or power off the module at this time. [##################### 100% -- SUCCESS Finishing the upgrade, switch will reboot in 10 seconds. switch(config)# User Access Verification switch login: [2644.917727] [1456980048] writing reset reason 88, CISCO SWITCH Ver 8.26 CISCO SWITCH Ver 8.26 Memory Size (Bytes): 0x000000080000000 + 0x000000380000000 Relocated to memory Time: 6/3/2016 4:41:8 Detected CISCO IOFPGA Booting from Primary Bios Code Signing Results: 0x0 Using Upgrade FPGA : 0x27 FPGA Revision FPGA ID : 0x1168153 FPGA Date : 0x20160111 Reset Cause Register: 0x22 Boot Ctrl Register : 0x60ff EventLog Register1 : 0x2000000 EventLog Register2 : 0xfbe77fff Version 2.16.1240. Copyright (C) 2013 American Megatrends, Inc. Board type 1 IOFPGA @ 0xe8000000 SLOT ID @ 0x1b Standalone chassis check bootmode: grub: Continue grub Trying to read config file /boot/grub/menu.lst.local from (hd0,4) Filesystem type is ext2fs, partition type 0x83 Booting bootflash:/nxos.7.0.3.I7.1.bin ... Booting bootflash:/nxos.7.0.3.I7.1.bin Trying diskboot Filesystem type is ext2fs, partition type 0x83 IOFPGA ID: 1168153 Image valid

Image Signature verification was Successful.

Boot Time: 3/3/2016 4:41:44 INIT: version 2.88 booting Unsquashing rootfs ... Loading IGB driver ... Installing SSE module ... done Creating the sse device node ... done Loading I2C driver ... Installing CCTRL driver for card_type 3 ... CCTRL driver for card index 21000 ... old data: 4000004 new data: 1 Not Micron SSD ... Checking all filesystems..... Installing default sprom values ... done.Configuring network ... Installing LC netdev ... Installing psdev ... Installing veobc ... Installing OBFL driver ... mounting plog for N9k! tune2fs 1.42.1 (17-Feb-2012) Setting reserved blocks percentage to 0% (0 blocks) Starting portmap daemon... creating NFS state directory: done starting 8 nfsd kernel threads: done starting mountd: done starting statd: done Saving image for img-sync ... Loading system software Installing local RPMS Patch Repository Setup completed successfully dealing with default shell .. file /proc/cmdline found, look for shell unset shelltype, nothing to do .. user add file found..edit it Uncompressing system image: Thu Jun 3 04:42:11 UTC 2016 blogger: nothing to do. ..done Thu Mar 3 04:42:11 UTC 2016 Creating /dev/mcelog Starting mcelog daemon Overwriting dme stub lib Replaced dme stub lib INIT: Entering runlevel: 3 Running S93thirdparty-script... 2016 Mar 3 04:42:37 switch%\$ VDC-1 %\$ %USER-2-SYSTEM MSG: <<%USBHSD-2-MOUNT>> logflash: online - usbhsd 2016 Mar 3 04:42:37 switch%\$ VDC-1 %\$ Mar 3 04:42:37 %KERN-2-SYSTEM_MSG: [12.509615] hwport mode=6 - kernel 2016 Mar 3 04:42:40 switch%\$ VDC-1 %\$ %VMAN-2-INSTALL STATE: Installing virtual service 'questshell+' 2016 Mar 3 04:42:40 switch%\$ VDC-1 %\$ %DAEMON-2-SYSTEM MSG: <<%ASCII-CFG-2-CONF CONTROL>> Binary restore - ascii-cfg[13904] 2016 Mar 3 04:42:40 switch%\$ VDC-1 %\$ %DAEMON-2-SYSTEM_MSG: <<%ASCII-CFG-2-CONF CONTROL>> Restore DME database - ascii-cfg[13904] 2016 Mar 3 04:42:42 switch%\$ VDC-1 %\$ netstack: Registration with cli server complete 2016 Mar 3 04:43:00 switch%\$ VDC-1 %\$ %USER-2-SYSTEM_MSG: ssnmgr_app_init called on ssnmgr up - aclmgr 2016 Mar 3 04:43:09 switch%\$ VDC-1 %\$ %USER-0-SYSTEM MSG: end of default policer - copp 2016 Mar 3 04:43:10 switch%\$ VDC-1 %\$ %VMAN-2-INSTALL STATE: Install success virtual service 'guestshell+'; Activating

2016 Mar 3 04:43:10 switch% VDC-1 %\$ %VMAN-2-ACTIVATION_STATE: Activating virtual service 'guestshell+' 2016 Mar 3 04:43:13 switch% VDC-1 %\$ %CARDCLIENT-2-FPGA_BOOT_PRIMARY: IOFPGA booted from Primary 2016 Mar 3 04:43:18 switch% VDC-1 %\$ %USER-2-SYSTEM_MSG: IPV6 Netlink thread init successful - icmpv6 2016 Mar 3 04:43:19 switch% VDC-1 %\$ %VDC_MGR-2-VDC_ONLINE: vdc 1 has come online

User Access Verification switchlogin: 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 1 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 6 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 8 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 9 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 10 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 11 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD_PRESENT: Detected the presence of Module 14 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 15 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 16 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 21 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 22 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 23 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 24 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 25 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 26 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 28 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 29 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PRESENT: Detected the presence of Module 30 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-PS OK: Power supply 1 ok (Serial number XYZ284014RR) 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-PS FANOK: Fan in Power supply 1 ok 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-PS OK: Power supply 2 ok (Serial number XYZ285111TC) 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-PS FANOK: Fan in Power supply 2 ok 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-PS OK: Power supply 3 ok (Serial number XYZ285111QQ) 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-PS FANOK: Fan in Power supply 3 ok 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-PS OK: Power supply 4 ok (Serial number XYZ284014TT) 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-PS FANOK: Fan in Power supply 4 ok 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-PS OK: Power supply 5 ok (Serial number XYZ284014TS) 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-PS FANOK: Fan in Power supply 5 ok 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-FANMOD FAN OK: Fan module 1 (Fan1(sys fan1) fan) ok

2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-FANMOD FAN OK: Fan module 2 (Fan2(sys fan2) fan) ok 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-FANMOD FAN OK: Fan module 3 (Fan3(sys fan3) fan) ok 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 30 detected (Serial number ABC1234DE56) Module-Type System Controller Model N9K-SC-A 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 30 powered up (Serial number ABC1234DE56) 2016 Mar 3 04:43:52 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 28 detected (Serial number :unavailable) Module-Type Supervisor Module Model :unavailable 2016 Mar 3 04:43:58 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 29 detected (Serial number ABC1234DEFG) Module-Type System Controller Model N9K-SC-A 2016 Mar 3 04:43:58 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 29 powered up (Serial number ABC1234DEFG) 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 21 detected (Serial number ABC1213DEFG) Module-Type Fabric Module Model N9K-C9516-FM 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 22 detected (Serial number ABC1211DEFG) Module-Type Fabric Module Model N9K-C9516-FM 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD_PWRUP: Module 21 powered up (Serial number ABC1213DEFG) 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 22 powered up (Serial number ABC1211DEFG) 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 23 detected (Serial number ABC1234D5EF) Module-Type Fabric Module Model N9K-C9516-FM 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 23 powered up (Serial number ABC1234D5EF) 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 24 detected (Serial number ABC1211DE3F) Module-Type Fabric Module Model N9K-C9516-FM 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 24 powered up (Serial number ABC1211DE3F) 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 25 detected (Serial number ABC1213DEFG) Module-Type Fabric Module Model N9K-C9516-FM 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 25 powered up (Serial number ABC1213DEFG) 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 26 detected (Serial number ABC1211DE34) Module-Type Fabric Module Model N9K-C9516-FM 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 26 powered up (Serial number ABC1211DE34) 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MODULE EJECTOR POLICY ENABLED: All Ejectors closed for module 1. Ejector based shutdown enabled 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 1 detected (Serial number ABC1217DEFG) Module-Type 32p 40G Ethernet Module Model N9K-X9432PQ 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 1 powered up (Serial number ABC1217DEFG) 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MODULE EJECTOR POLICY ENABLED: All Ejectors closed for module 9. Ejector based shutdown enabled 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 9 detected (Serial number ABC1236D4E5) Module-Type 48x1/10G-T 4x40G Ethernet Module Model N9K-X9564TX 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 9 powered up (Serial number ABC1236D4E5) 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MODULE EJECTOR POLICY ENABLED: All Ejectors closed for module 10. Ejector based shutdown enabled 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 10 detected (Serial number ABC1217EFGH) Module-Type 32p 40G Ethernet Module Model N9K-X9432PQ 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 10 powered up (Serial number ABC1217EFGH) 2016 Mar 3 04:44:01 switch%\$ VDC-1 %\$ %PLATFORM-2-MODULE EJECTOR POLICY ENABLED: All Ejectors closed for module 11. Ejector based shutdown enabled 2016 Mar 3 04:44:02 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 11 detected (Serial number ABC123DEF4) Module-Type 36p 40G Ethernet Module Model N9K-X9536PQ 2016 Mar 3 04:44:02 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 11 powered up (Serial number ABC123DEF4) 2016 Mar 3 04:44:02 switch%\$ VDC-1 %\$ %PLATFORM-2-MODULE EJECTOR POLICY ENABLED: All Ejectors closed for module 15. Ejector based shutdown enabled

2016 Mar 3 04:44:02 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 15 detected (Serial number ABC1212DEFG) Module-Type 36p 40G Ethernet Module Model N9K-X9536PQ 2016 Mar 3 04:44:02 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 15 powered up (Serial number ABC1212DEFG) 2016 Mar 3 04:44:02 switch%\$ VDC-1 %\$ %PLATFORM-2-MODULE EJECTOR POLICY ENABLED: All Ejectors closed for module 16. Ejector based shutdown enabled 2016 Mar 3 04:44:02 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 16 detected (Serial number ABCD1235DEFG) Module-Type 48x1/10G SFP+ 4x40G Ethernet Module Model N9K-X9464PX 2016 Mar 3 04:44:02 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 16 powered up (Serial number ABCD1235DEFG) 2016 Mar 3 04:44:08 switch%\$ VDC-1 %\$ %PLATFORM-2-MODULE EJECTOR POLICY ENABLED: All Ejectors closed for module 14. Ejector based shutdown enabled 2016 Mar 3 04:44:08 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 14 detected (Serial number ABC9876DE5F) Module-Type 8p 100G Ethernet Module Model N9K-X9408PC-CFP2 2016 Mar 3 04:44:08 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 14 powered up (Serial number ABC9876DE5F) 2016 Mar 3 04:44:09 switch%\$ VDC-1 %\$ %PLATFORM-2-MODULE EJECTOR POLICY ENABLED: All Ejectors closed for module 6. Ejector based shutdown enabled 2016 Mar 3 04:44:09 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 6 detected (Serial number ABC9876DE3F) Module-Type 8p 100G Ethernet Module Model N9K-X9408PC-CFP2 2016 Mar 3 04:44:09 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 6 powered up (Serial number ABC9876DE3F) 2016 Mar 3 04:44:10 switch%\$ VDC-1 %\$ %PLATFORM-2-MODULE EJECTOR POLICY ENABLED: All Ejectors closed for module 8. Ejector based shutdown enabled 2016 Mar 3 04:44:10 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD DETECT: Module 8 detected (Serial number ABC3456D7E8) Module-Type 48x1/10G-T 4x40G Ethernet Module Model N9K-X9564TX 2016 Mar 3 04:44:10 switch%\$ VDC-1 %\$ %PLATFORM-2-MOD PWRUP: Module 8 powered up (Serial number ABC3456D7E8) 2016 Mar 3 04:44:56 switch%\$ VDC-1 %\$ %USBHSD-STANDBY-2-MOUNT: logflash: online 2016 Mar 3 04:47:31 switch%\$ VDC-1 %\$ %ASCII-CFG-2-CONF CONTROL: System ready 2016 Mar 3 04:47:51 switch%\$ VDC-1 %\$ %VMAN-2-ACTIVATION STATE: Successfully activated virtual service 'guestshell+' 2016 Mar 3 04:47:51 switch%\$ VDC-1 %\$ %VMAN-2-GUESTSHELL ENABLED: The quest shell has been enabled. The command 'guestshell' may be used to access it, 'guestshell destroy' to remove it. User Access Verification switch# show version Cisco Nexus Operating System (NX-OS) Software TAC support: http://www.cisco.com/tac Copyright (C) 2002-2016, Cisco and/or its affiliates.

All rights reserved. The copyrights to certain works contained in this software are owned by other third parties and used and distributed under their own licenses, such as open source. This software is provided "as is," and unless otherwise stated, there is no warranty, express or implied, including but not limited to warranties of merchantability and fitness for a particular purpose. Certain components of this software are licensed under the GNU General Public License (GPL) version 2.0 or GNU General Public License (GPL) version 3.0 or the GNU Lesser General Public License (LGPL) Version 2.1 or Lesser General Public License (LGPL) Version 2.0. A copy of each such license is available at http://www.opensource.org/licenses/gpl-2.0.php and http://opensource.org/licenses/gpl-3.0.html and http://www.opensource.org/licenses/lgpl-2.1.php and http://www.gnu.org/licenses/old-licenses/library.txt.

Software

BIOS: version 08.26 NXOS: version 7.0(3)I7(1) BIOS compile time: 06/12/2016 NXOS image file is: bootflash:///nxos.7.0.3.I7.1.bin

NXOS compile time: 2/8/2016 20:00:00 [02/09/2016 05:18:17] Hardware cisco Nexus9000 C9516 (16 Slot) Chassis ("Supervisor Module") Intel(R) Xeon(R) CPU E5-2403 0 @ 1.80GHz with 16401664 kB of memory. Processor Board ID SAL1745FTPW Device name: switch bootflash: 20971520 kB Kernel uptime is 0 day(s), 0 hour(s), 8 minute(s), 13 second(s) Last reset at 235176 usecs after Thu Mar 3 04:40:48 2016 Reason: Reset due to upgrade System version: 7.0(3)I1(2) Service: plugin Core Plugin, Ethernet Plugin Active Package(s): switch#

Enhanced ISSU

You can enable or disable enhanced (LXC) ISSU. Beginning with Cisco NX-OS Release 10.4(1)F, this section is applicable for N9364C and N9332C platforms only.



• Enhanced ISSU cannot be supported without reloading the container if there are kernel updates in the target release. The system will prompt the following message:

Host kernel is not compatible with target image. Full ISSU will be performed and control plane will be impacted.

In effect, system will perform nondisruptive ISSU instead of enhanced ISSU.

- For Cisco N9K-C9332D-GX2B [from Cisco NX-OS Release 10.2(2)F)], and N9K-C9348D-GX2A and N9K-C9364D-GX2A [from Cisco NX-OS Release 10.2(3)F] platform switches, enhanced (LXC) ISSU is the default mode, so you cannot enable or disable this mode. Also, for these switches, virtual supervisor module is shown in the output of the **show module** command. Beginning with Cisco NX-OS Release 10.3(3)F, this is applicable to Cisco Nexus 9300-FX3, 9300-GX, and 9300-GX2 platform switches.Beginning with Cisco NX-OS Release 10.4(1)F, this is also applicable to Cisco Nexus 9300-FX and 9300-FX2 platform switches.
- It is recommended to set disable-fka on the FCF, when invoking Fallback ND LXC ISSU on the NPV from Cisco NX-OS Release 10.2(3)F to 10.3(2)F and higher versions. If not, it will be disruptive. Verify the output of the show fcoe-npv issu-impact command to know whether the disable-fka must be set.

Before you begin

Before you enable the LXC mode, ensure that the installed licenses do not include the 27000 string in the license file.

Note Beginning with Cisco NX-OS Release 10.3(3)F, Cisco Nexus 9300-FX3 and 9300-GX switches always boot in LXC mode. This allows you to use Enhanced ISSU with minimal downtime.Beginning with Cisco NX-OS Release 10.4(1)F, Cisco Nexus 9300-FX2 and 9300-FX2 switches always boot in LXC mode.

SUMMARY STEPS

- 1. configure terminal
- **2**. [no] boot mode lxc
- **3.** (Optional) **show boot mode**
- 4. copy running-config startup-config
- 5. reload
- **6.** (Optional) **show version**
- 7. (Optional) show boot mode
- 8. show module

DETAILED STEPS

Procedure

	Command or Action	Purpose
Step 1	configure terminal	Enters global configuration mode.
	Example:	
	<pre>switch# configure terminal switch(config#)</pre>	
Step 2	[no] boot mode lxc	Enables or disables enhanced (LXC) ISSU.
	Example:	Note In order to perform a nondisruptive enhanced ISSU,
	switch(config) # boot mode lxc	you must first boot the switch in LXC mode.
	Using LXC boot mode Example:	Beginning with Cisco NX-OS Release 10.3(3)F, boot
		mode lxc is enabled by default on Cisco Nexus 9300-FX3 and 9300-GX switches, and beginning with
	switch(config)# no boot mode lxc Using normal native boot mode	Cisco NX-OS Release 10.4(1)F, it is enabled by default on Cisco Nexus 9300-FX and 9300-FX2 switches. However, no boot mode lxc is not supported on these platforms.
Step 3	(Optional) show boot mode	Shows whether enhanced (LXC) ISSU is enabled or
	Example:	disabled.
	switch(config)# show boot mode LXC boot mode is enabled	
	Example:	
	switch(config)# show boot mode LXC boot mode is disabled	

	Command or Action	Purpose
Step 4	copy running-config startup-config	Saves the running configuration to the startup configuration
	Example:	
	<pre>switch(config)# copy running-config startup-config</pre>	1
Step 5	reload	Reloads the device. When prompted, press Y to confirm the
	Example:	reboot.
	<pre>switch(config)# reload This command will reboot the system. (y/n)? [n] Y loader></pre>	
Step 6	(Optional) show version	Shows the version information of the Software and
-	Example:	Hardware and also shows the mode in which the switch is
	<pre>switch(config)# show version i "boot mode"NXOS boot mode:LXC switch#</pre>	Note Beginning with Cisco NX-OS Release 10.3(3)F, this command is applicable to all platforms that support LXC mode, when the switch is in LXC mode. However, LXC is the only option for Cisco Nexus 9300-FX3 and 9300-GX switches.Beginning with Cisco NX-OS Release 10.4(1)F, this command is applicable to Cisco Nexus 9300-FX and 9300-FX2 switches.
Step 7	(Optional) show boot mode	Shows whether the current mode is enhanced (LXC) ISSU
•	Example:	
	switch(config) # show boot mode	
<u> </u>	Current mode is LXC.	
Step 8	show module	Shows the details about the module after the switch comes up.
	Example:	Note Beginning with Cisco NX-OS Release 10.3(3)F, this
	switch# show module Mod Ports Module-Type Model Status	command is applicable to all platforms that support LXC mode, when the switch is in LXC mode. However, LXC is the only option for Cisco Nexus 9300-FX3 and 9300-GX switches. Beginning with
	1 64 64x100G/40G QSFP28 Ethernet Module	Cisco NX-OS Release 10.4(1)F, this command is
	N9K-C9364C-GX ok 27 0 Virtual Supervisor Module N9K-C9364C-GX active *	applicable to Cisco Nexus 9300-FX and 9300-FX2 switches.
	Mod Sw Hw Slot	
	1 10.3(3) 1.0 NA 27 10.3(3) 1.0 VSUP	
	Mod MAC-Address(es) Serial-Num 	
	 1 c4-b2-39-95-18-d8 to c4-b2-39-95-19-63 FD023480XTZ	

 Command or Action	Purpose
 27 c4-b2-39-95-18-d8 to c4-b2-39-95-19-63 FD023480XTZ	
Mod Online Diag Status	
1 Pass 27 Pass	
* this terminal session	

What to do next

Follow the instructions in Upgrading the Cisco NX-OS Software section. Make sure to choose the **non-disruptive** option if you want to perform an enhanced or regular ISSU.

Upgrading the Cisco NX-OS Software

Use this procedure to upgrade to a Cisco NX-OS 10.2(x) release.



Beginning with Cisco NX-OS Release 10.1(1), the Cisco Nexus -GX series platforms use the 64-bit Cisco NX-OS image file, which has the image filename that begins with "nxos64" (for example, nxos64.10.1.1.bin). The 64-bit software image, which supports software scalability, is available for the Cisco Nexus C9316D-GX, C93600CD-GX, C9364C-GX switches. The non-GX series platforms use the 32-bit Cisco NX-OS image file, which has the image filename that begins with "nxos" (for example, nxos.10.1.1.bin).

Note

For Cisco Nexus 9500 platform switches with -R line cards, you must save the configuration and reload the device to upgrade from Cisco NX-OS Release 7.0(3)F3(5) to 10.1(1). To upgrade from Cisco NX-OS Release 9.2(2) or later, we recommend that you use the **install all** command.



Note If an error message appears during the upgrade, the upgrade will fail because of the reason indicated. See the *Cisco Nexus 9000 Series NX-OS Troubleshooting Guide, Release 10.1(x)* for a list of possible causes and solutions.

Before you begin

Before performing a nondisruptive ISSU to Cisco NX-OS Release 10.1(1), you must configure the BGP graceful restart timer to 180 seconds for Cisco Nexus 3132Q-V platform switches.

SUMMARY STEPS

- 1. Read the release notes for the software image file for any exceptions to this upgrade procedure. See the Cisco Nexus 9000 Series NX-OS Release Notes.
- **2.** Log in to the device on the console port connection.

- **3.** Ensure that the required space is available for the image file to be copied.
- 4. If you need more space on the active supervisor module, delete unnecessary files to make space available.
- 5. Verify that there is space available on the standby supervisor module.
- **6.** If you need more space on the standby supervisor module, delete any unnecessary files to make space available.
- 7. Log in to Cisco.com, choose the software image file for your device from the following URL, and download it to a file server: http://software.cisco.com/download/navigator.html.
- **8.** Copy the software image to the active supervisor module using a transfer protocol. You can use FTP, TFTP, SCP, or SFTP.
- 9. You can detect an incomplete or corrupt NX-OS software image prior to performing an upgrade by verifying the MD5, SHA256 or SHA512 checksum of the software image. To verify the MD5 checksum of the software image, run the show file bootflash: <IMAGE-NAME>md5sum command and compare the resulting value to the published MD5 checksum for the software image on Cisco's Software Download website. To verify the SHA512 checksum of the software image, run the show file bootflash: <IMAGE-NAME>sha512 checksum of the software image, run the show file bootflash: <IMAGE-NAME>sha512 checksum of the software image, run the show file SHA512 checksum for the software image on Cisco's Software Download website.
- 10. You can detect an incomplete or corrupt NX-OS software image prior to performing an upgrade by verifying the MD5, SHA256 or SHA512 checksum of the software image. To verify the MD5 checksum of the software image, run the show file bootflash: <IMAGE-NAME>md5sum command and compare the resulting value to the published MD5 checksum for the software image on Cisco's Software Download website. To verify the SHA512 checksum of the software image, run the show file bootflash: <IMAGE-NAME>show file bootflash: <Image command and compare the resulting value to the published SHA512 checksum for the software image on Cisco's Software Download website.</p>
- **11.** Check the impact of upgrading the software before actually performing the upgrade.
- **12.** Save the running configuration to the startup configuration.
- **13.** If required, upgrade the EPLD image using the **install all nxos <nxos-image> epld <epld-image>** command.
- **14.** Upgrade the Cisco NX-OS software using the **install all nxos bootflash**:*filename* [**no-reload** | **non-disruptive** | **non-interruptive** | **serial**] command.
- **15.** (Optional) Display the entire upgrade process.
- **16.** (Optional) Log in and verify that the device is running the required software version.
- **17.** (Optional) If necessary, install any licenses to ensure that the required features are available on the device. See the Cisco NX-OS Licensing Guide.

DETAILED STEPS

Procedure

- Step 1
 Read the release notes for the software image file for any exceptions to this upgrade procedure. See the Cisco Nexus 9000 Series NX-OS Release Notes.
- **Step 2** Log in to the device on the console port connection.
- **Step 3** Ensure that the required space is available for the image file to be copied.

```
switch# dir bootflash:
16384   Oct 30 17:05:32 2020   lost+found/
1964291584   Dec 08 19:44:33 2020   nxos.10.1.1.bin
...
Usage for bootflash://sup-local
```

4825743360 bytes used 16312102912 bytes free 21137846272 bytes total

Note We recommend that you have the image file for at least one previous release of the Cisco NX-OS software on the device to use if the new image file does not load successfully.

Step 4 If you need more space on the active supervisor module, delete unnecessary files to make space available.

switch# delete bootflash:nxos.9.2.1.bin

Step 5 Verify that there is space available on the standby supervisor module.

Step 6 If you need more space on the standby supervisor module, delete any unnecessary files to make space available.

switch# delete bootflash://sup-standby/nxos.9.2.1.bin

- **Step 7** Log in to Cisco.com, choose the software image file for your device from the following URL, and download it to a file server: http://software.cisco.com/download/navigator.html.
- **Step 8** Copy the software image to the active supervisor module using a transfer protocol. You can use FTP, TFTP, SCP, or SFTP.

switch# copy scp://user@scpserver.cisco.com//download/nxos64.10.2.1.F.bin bootflash:nxos64.10.2.1.F.bin

For software images requiring compaction, you must use SCP, HTTP, or HTTPS as the source and bootflash or USB as the destination. The following example uses SCP and bootflash:

switch# copy scp://user@scpserver.cisco.com//download/nxos64.10.2.1.F.bin bootflash:nxos64.10.2.1.F.bin compact vrf management use-kstack

user1@10.65.42.196's password: nxos64.10.2.1.F.bin 100% 1887MB 6.6MB/s 04:47 Copy complete, now saving to disk (please wait)... Copy complete.

The **compact** keyword compacts the NX-OS image before copying the file to the supervisor module.

Note Software image compaction is only supported on SCP, HTTP, or HTTPS. If you attempt compaction with any other protocol, the system returns the following error:

```
Compact option is allowed only with source as scp/http/https and destination as bootflash or usb
```

- **Note** Compacted images are not supported with LXC boot mode.
- **Note** Software image compaction is only supported on Cisco Nexus 9300-series platform switches.

Step 9You can detect an incomplete or corrupt NX-OS software image prior to performing an upgrade by verifying the MD5,
SHA256 or SHA512 checksum of the software image. To verify the MD5 checksum of the software image, run the
show file bootflash:<IMAGE-NAME>md5sum command and compare the resulting value to the published MD5
checksum for the software image on Cisco's Software Download website. To verify the SHA512 checksum of the
software image, run the show file bootflash:<IMAGE-NAME>sha512sum
command and compare the resulting value to the resulting value
to the published SHA512 checksum for the software image on Cisco's Software Download website.

switch# show file bootflash:nxos.10.1.1.bin md5sum
2242a7f876f1304118fd175c66f69b34

switch# show file bootflash:nxos.10.1.1.bin sha512sum 7f25ccc57ca137a79211fb3835338aae64acf9b021b75ccc5d4156e873b4274ca4f98e9a74fe4c8961f5ace99ed65f3826650599369f84ab07265d7c5d61b57f

Step 10 You can detect an incomplete or corrupt NX-OS software image prior to performing an upgrade by verifying the MD5, SHA256 or SHA512 checksum of the software image. To verify the MD5 checksum of the software image, run the show file bootflash:<IMAGE-NAME>md5sum command and compare the resulting value to the published MD5 checksum for the software image on Cisco's Software Download website. To verify the SHA512 checksum of the software image, run the software image, run the software image, run the software image on Cisco's Software Download website. To verify the SHA512 checksum of the software image to the published SHA512 checksum for the software image on Cisco's Software Download website.

switch# show file bootflash:nxos64.10.2.1.F.bin md5sum
c49660952215822afd30bb7958a0765a

switch# show file bootflash:nxos64.10.2.1.F.bin sha256sum
2a64efbb381fabbb52054af74cf3efda1691772a49a70ddd35550431cadecf8e

switch# show file bootflash:nxos64.10.2.1.F.bin sha512sum 3bf6a771aa4a192a8e1383e348b26bb483356a9774d74ba39edbf7718248483b3391942d8103de8104deea8fda212266e70bd736220cff34943bd8e359432975

Step 11 Check the impact of upgrading the software before actually performing the upgrade.

switch# # show install all impact nxos bootflash:nxos64.10.2.1.F.bin

During the compatibility check, the following ISSU-related messages may appear in the Reason field:

Reason Field Message	Description
Incompatible image for ISSU	The Cisco NX-OS image to which you are attempting to upgrade does not support ISSU.
Default upgrade is not hitless	By default, the software upgrade process is disruptive. You must configure the non-disruptive option to perform an ISSU.

Step 12 Save the running configuration to the startup configuration.

switch# copy running-config startup-config

Step 13 If required, upgrade the EPLD image using the **install all nxos <nxos-image> epld <epld-image> command.**

The following is an example output of the **install all nxos <nxos-image> epld <epld-image>** command:

switch# install all nxos nxos.10.1.1.bin epld n9000-epld.10.1.1.img

Installer will perform compatibility check first. Please wait. Installer is forced disruptive

Verifying EPLD image bootflash:/ n9000-epld.10.1.1.img. [#####################] 100% -- SUCCESS Verifying image type. [##################### 100% -- SUCCESS Preparing "nxos" version info using image bootflash:/nxos.10.1.1.bin. [###################### 100% -- SUCCESS Preparing "bios" version info using image bootflash:/nxos.10.1.1.bin. Performing module support checks. [###################### 100% -- SUCCESS Notifying services about system upgrade. switch# install all nxos nxos.10.1.1.IJD9.0.59.bin epld n9000-epld.10.2.1.F.img Installer will perform compatibility check first. Please wait. Installer is forced disruptive Verifying image bootflash:/nxos.10.1.1.IJD9.0.59.bin for boot variable "nxos". [##################### 100% -- SUCCESS Verifying EPLD image bootflash:/ n9000-epld.10.2.1.F.img. Verifying image type. [##################### 100% -- SUCCESS Preparing "nxos" version info using image bootflash:/nxos.10.1.1.IJD9.0.59.bin. Preparing "bios" version info using image bootflash:/nxos.10.1.1.IJD9.0.59.bin. [###################### 100% -- SUCCESS Performing module support checks. [###################### 100% -- SUCCESS Notifying services about system upgrade.

Step 14 Upgrade the Cisco NX-OS software using the **install all nxos bootflash**:*filename* [**no-reload** | **non-disruptive** | **non-interruptive** | **serial**] command.

switch# install all nxos bootflash:nxos64.10.2.1.F.bin

The following options are available:

- no-reload—Exits the software upgrade process before the device reloads.
 - **Note** When you use **install all** with **no-reload** option, the saved configuration cannot be used before you relaod the device. Saving configuration in this state can result in incorrect startup configuration once you reload the device with new version of NX-OS.
- **non-disruptive**—Performs an in-service software upgrade (ISSU) to prevent the disruption of data traffic. (By default, the software upgrade process is disruptive.)
- non-interruptive—Upgrades the software without any prompts. This option skips all error and sanity checks.

	are u paral	I—Upgrades the I/O modules in Cisco Nexus 9500 Series switches one at a time. (By default, the I/O modules pgraded in parallel, which reduces the overall upgrade time. Specifically, the I/O modules are upgraded in lel in this order: the first half of the line cards and fabric modules, the second half of the line cards and fabric iles, the first system controller, the second system controller.)	
	Note	If you enter the install all command without specifying a filename, the command performs a compatibility check, notifies you of the modules that will be upgraded, and confirms that you want to continue with the installation. If you choose to proceed, it installs the NX-OS software image that is currently running on the switch and upgrades the BIOS of various modules from the running image, if necessary.	
Step 15	`	tional) Display the entire upgrade process. tch# show install all status	
Step 16	(Optional) Log in and verify that the device is running the required software version. switch# show version		
Step 17	· • /	If necessary, install any licenses to ensure that the required features are available on the device. See the -OS Licensing Guide.	

Upgrade Process for vPCs

Upgrade Process for a vPC Topology on the Primary Switch

The following list summarizes the upgrade process on a switch in a vPC topology that holds either the Primary or Operational Primary vPC roles. Steps that differ from a switch upgrade in a non-vPC topology are in bold.



In vPC topologies, the two peer switches must be upgraded individually. An upgrade on one peer switch does not automatically update the vPC peer switch.

In a dual-homed non-vPC access network (either a triangle or Y shaped access network), with or without STP configured, with BFD enabled and with HSRP configured on the SVIs and with HSRP configured as BFD client, transient traffic may drop for both IPv4 native unicast and/or labeled traffic after performing an ND-ISSU n fallback mode.

To counter this, configure in all the HSRP IPv4 groups for all the HSRP enabled SVIs the **timer 2 120** on both HSRP peers prior to performing the ND-ISSU. The configuration of the **timer 3 120** may lead to traffic loss.

- 1. The install all command issued on the vPC primary switch triggers the installation upgrade.
- 2. The compatibility checks display the impact of the upgrade.
- 3. The installation proceeds or not based on the upgrade impact.
- 4. The configuration is locked on both vPC peer switches.

- 5. The current state is saved.
- **6.** The system unloads and runs the new image.
- 7. The stateful restart of the system software and application occurs.
- 8. The installer resumes with the new image.
- **9.** The installation is complete.

When the installation is complete, the vPC primary switch is upgraded.



Note

The vPC primary switch is running the upgraded version, and the vPC secondary switch is running the original software version.

Upgrade Process for a vPC Topology on the Secondary Switch

The following list summarizes the upgrade process on a switch in a vPC topology that holds either the Secondary or Operational Secondary vPC roles. Steps that differ from a switch upgrade in a non-vPC topology are in bold.

- 1. The install all command issued on the vPC secondary switch triggers the installation upgrade.
- 2. The compatibility checks display the impact of the upgrade.
- 3. The installation proceeds or not based on the upgrade impact.
- 4. The current state is saved.
- 5. The system unloads and runs the new image.
- 6. The stateful restart of the system software and application occurs.
- 7. The installer resumes with the new image.
- 8. The configuration is unlocked on the primary and secondary switches.
- 9. The installation is complete.

Downgrading to an Earlier Software Release



If an error message appears during the downgrade, the downgrade will fail because of the reason indicated. See the *Cisco Nexus 9000 Series NX-OS Troubleshooting Guide, Release 10.2(x)* for a list of possible causes and solutions.

SUMMARY STEPS

1. Read the release notes for the software image file for any exceptions to this downgrade procedure. See the Cisco Nexus 9000 Series NX-OS Release Notes.

- 2. Log in to the device on the console port connection.
- 3. Verify that the image file for the downgrade is present on the active supervisor module bootflash:.
- **4.** If the software image file is not present, log in to Cisco.com, choose the software image file for your device from the following URL, and download it to a file server: http://software.cisco.com/download/ navigator.html.
- **5.** Copy the software image to the active supervisor module using a transfer protocol. You can use FTP, TFTP, SCP, or SFTP.
- 6. Check for any software incompatibilities.
- 7. Disable any features that are incompatible with the downgrade image.
- 8. Check for any hardware incompatibilities.
- **9.** Power off any unsupported modules.
- **10.** Save the running configuration to the startup configuration.
- **11.** Downgrade the Cisco NX-OS software using the **install all nxos bootflash** *<nxos_image_to_downgrade>* command.
- **12.** (Optional) Display the entire downgrade process.
- **13.** (Optional) Log in and verify that the device is running the required software version.

DETAILED STEPS

Procedure

Step 1	Read the release notes for the software image file for any exceptions to this downgrade procedure. See the Cis Nexus 9000 Series NX-OS Release Notes.		
Step 2	Log in to the device on the console port connection.		
Step 3	Verify that the image file for the downgrade is present on the active supervisor module bootflash:.		
	switch# dir bootflash:		
Step 4	If the software image file is not present, log in to Cisco.com, choose the software image file for your device from the following URL, and download it to a file server: http://software.cisco.com/download/navigator.html.		
	Note If you need more space on the active or standby supervisor module bootflash:, use the delete comman to remove unnecessary files.		
Step 5	Copy the software image to the active supervisor module using a transfer protocol. You can use FTP, TFTP, SCP, or SFTP.		
	<pre>switch# switch# copy scp://user@scpserver.cisco.com//download/nxos.9.2.1.bin bootflash:nxos.9.2.1.bin</pre>		
Step 6	Check for any software incompatibilities.		
	switch# show incompatibility-all nxos bootflash:nxos.9.2.1.bin Checking incompatible configuration(s) No incompatible configurations		
	The resulting output displays any incompatibilities and remedies.		

Step 7 Disable any features that are incompatible with the downgrade image.

.

Step 8	Check f	or any hardware incompatibilities.
	switch	show install all impact nxos bootflash:nxos.9.2.1.bin
Step 9	Power c	off any unsupported modules.
	switch	poweroff module module-number
Step 10	Save the	e running configuration to the startup configuration.
	switch	copy running-config startup-config
Step 11	Downgi	rade the Cisco NX-OS software using the install all nxos bootflash <i><nxos_image_to_downgrade></nxos_image_to_downgrade></i> command.
	Note	If you enter the install all command without specifying a filename, the command performs a compatibility check, notifies you of the modules that will be upgraded, and confirms that you want to continue with the installation. If you choose to proceed, it installs the NXOS software image that is currently running on the switch and upgrades the BIOS of various modules from the running image if required.
Step 12	(Option	al) Display the entire downgrade process.
	Example	e:
	switch	show install all status
Step 13	(Option	al) Log in and verify that the device is running the required software version.
	switch	show version

Cisco NX-OS Upgrade History

During the life of a Cisco Nexus 9000 switch, many upgrade procedures can be performed. Upgrades can occur for maintenance purposes or to update the operating system to obtain new features. Over time, switches may be updated on numerous occasions. Viewing the types of upgrades and when they occurred can help in troubleshooting issues or simply understanding the history of the switch.

Beginning with Cisco NX-OS Release 9.3(5), Cisco Nexus 9000 switches log all upgrade activity performed over time providing a comprehensive history of these events. The stored upgrade history types are:

- Cisco NX-OS System Upgrades
- Electronic Programmable Logic Device (EPLD) Upgrades
- Software Maintenance Upgrade (SMU) Installations

View the Cisco NX-OS upgrade history by entering the **show upgrade history** command. The output displays any upgrade activity that previously occurred on the switch and defines the start and end times for each event. The following is an example output of the **show upgrade history** command:

switch# show upgrad	e history			
TYPE	VERSION	DATE		STATUS
NXOS EPLD	n9000-	26 Apr 2	2020 11:37:16	EPLD Upgrade completed
	epld.9.3.	4.img		
NXOS EPLD	n9000-	26 Apr 2	2020 11:32:41	EPLD Upgrade started

			epld.9.3.4	4.ir	ng			
NXOS	system	image	9.3(5)	24	Mar	2020	20:09:10	Installation End
NXOS	system	image	9.3(5)	24	Mar	2020	20:05:29	Installation started
NXOS	SMU		9.3(5)	03	Mar	2020	23:34:15	Patch activation ended for
								nxos.libnbproxycli_patch-n9k_
								ALL-1.0.0-9.3.5.lib32_n9000.rpm
NXOS	SMU		9.3(5)	03	Mar	2020	23:34:03	Patch activation started for
								nxos.libnbproxycli_patch-n9k_
								ALL-1.0.0-9.3.5.lib32_n9000.rpm

Beginning with Cisco NX-OS Release 10.2(3)F, Cisco Nexus 9000 switches supports new cli "**show upgrade history details**" which displays login details (user name/session ID).

View the Cisco NX-OS upgrade history details by entering the **show upgrade history details** command. The output displays user login details (user name/session ID) under LOGIN column on the switch along with upgrade history. The following is an example output of the **show upgrade history details** command:

switch# sh upgrad	e history details			
TYPE	VERSION		DATE	LOGIN
	STATUS			
NXOS system image	10.2(3)	21 Jan 20	22 10:01:06	admin/10.30.216.212
Installati	on End			
NXOS system image	10.2(3)	21 Jan 20	22 10:00:53	admin/10.30.216.212
Installati	on started			
NXOS system image	10.2(3)	21 Jan 20	22 01:03:52	admin/10.30.216.212
Installati	on End			



Optionality in Cisco NX-OS Software

This chapter describes optionality in Cisco NX-OS software.

- Optionality in Cisco NX-OS Software, on page 53
- Using Modular Packages, on page 54
- Booting the NX-OS Image in Base or Full Mode, on page 55
- Information About RPMs, on page 56
- Information About DNF Commands, on page 70
- Configuring an FTP server and Setting up a Local FTP YUM Repository, on page 84
- Creating User Roles for Install Operation, on page 89
- Compacting Cisco NX-OS Software Images, on page 89

Optionality in Cisco NX-OS Software

Beginning with Cisco NXOS Release 9.2(1), Cisco NX-OS software image supports modular package management. Cisco NX-OS software now provides flexibility to add, remove, and upgrade the features selectively without changing the base NX-OS software.

The advantages for using modular Cisco NX-OS software are:

- Lean NX-OS software
- Asynchronous delivery of the features and the fixes: Quick fixes are provided that are independent of the releases, including new features.
- · Reduced footprint of binaries and libraries at run time

Cisco NX-OS software is provisioned to boot the NX-OS software in two modes as described in the following illustration:

- Base NX-OS mode
- Full NX-OS mode

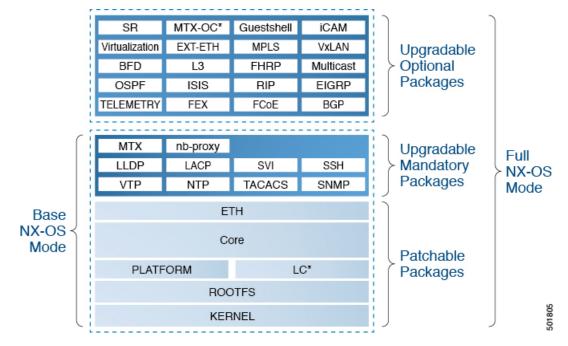


Figure 1: Optionality in Cisco NX-OS Software

- Base NX-OS mode contains:
 - Upgradable mandatory packages
 - Patchable packages
- Full NX-OS mode contains:
 - · Upgradable optional packages
 - Upgradable mandatory packages
 - · Patchable packages



Note The default mode is full NX-OS mode.

In base NX-OS mode, basic Layer 2 and Layer 3 features are available. All dynamic routing features (for example, BGP, OSPF, EIGRP, RIP, and ISIS) and other optional feature RPMs are not available by default. You have to install the optional feature RPMs on top of the base image.

In full NX-OS mode, all feature RPMs are installed during boot time when Ethernet plugin is activated by the plugin manager. There is no change in the user behavior as compared to the previous releases.

Using Modular Packages

The Cisco NX-OS software image is traditionally constructed with the packaging that forms a Cisco Linux distribution. It makes upgrading certain packages difficult as each package is large in size.

This section describes a new package management for the Cisco NX-OS software image. Beginning with Cisco NX-OS Release 9.2(1), some NXOS features are considered as optional, for example, BGP, OSPF, VXLAN, MPLS, Segment Routing.

Each modular package has the following important characteristics:

- Upgrade functionality: The modular packages can be independently upgraded. The modular packages should be used from the same release as performing upgrades on these packages across multiple releases is not supported.
- Optionality: The modular packages are optional, for example, these packages can be removed or uninstalled at run time. The removal of the modular packages does not affect bringing-up the system and it does not affect any other functionality of the switches.



Note All APIs exported by the modular package should be used only after the installation of the feature.

RPM and **DNF**

RPM (Red Hat Package Manager) is the package management system used for packaging in the Linux Standard Base (LSB). The RPM command options are grouped into three subgroups for:

- · Querying and verifying packages
- Installing, upgrading, and removing packages
- Performing miscellaneous functions

rpm is the command name for the main command that is used with RPM, whereas .rpm is the extension that is used for the RPM files.

Dandified YUM (Yellowdog Updater, Modified) or DNF is an open source command-line tool for RPM based Linux systems. It allows users and system administrators to easily install, update, remove, or search software packages on the systems. DNF adds the automatic updates and the package management, including dependency management, to the RPM systems. In addition to understanding the installed packages on a system, DNF works with the repositories that are collections of the packages and they are typically accessible over a network connection.

Booting the NX-OS Image in Base or Full Mode

You can now boot the NX-OS image in base or full mode. The full boot mode installs the complete NX-OS software which is similar to the software of the previous releases. This is the default boot mode. The base boot mode has no optional RPMs installed.

To use the command line option, see the following steps:

- Use the install reset nxos base option to install the NX-OS image in the base boot mode using the VSH prompt. After reload, the switch is in the base mode with no optional packages installed.
- Use the **install reset nxos full** option to install the NX-OS image in the full boot mode using the VSH prompt. After reload, the switch is in the full mode with the optional packages automatically installed.

For more information, see Using Install CLIs for Feature RPM Operation section.

Information About RPMs

RPMs can be upgraded or downgraded to a new software version using NXOS install commands or by using DNF commands. An upgradable RPM can be optional or mandatory.

Ŵ

Ν	ote

During the boot-up process of NX-OS, signed RPMs remain in memory while the image extraction stage takes place. However, this method is not the most efficient in terms of memory consumption. As of Cisco NX-OS Release 10.4(3)F, after the system reaches a stable state and adequate SSD space is accessible, the RPMs are transferred from memory to persistent storage. This feature is supported on N9K-C92348GC-X and all Nexus 9300 TOR switches.

See the following sections for more information about optional and mandatory RPMs.

Format of the RPM

The general format of a RPM is <name>-<version>-<release>.<arch>.rpm. The same format is followed for NXOS feature RPMS.

- Name: package name, for example, BGP
- Version in <x.y.x.b> format: <major.minor.patch.build_number>, for example, 2.0.1.0
- Release: The branch from which the RPM is created, for example, 9.2.1
- Arch: The architecture type of the RPM, for example, lib32_n9000

See the following table for more information on the naming convention, for example, fex-2.0.0.9.2.1.lib32_n9000.rpm:

RPM Naming Convention Example: fex-2.0.0.0-9.2.1.lib32_n9000.rpm	Description
fex	Indicates the name of the component.
2	Indicates that the RPM is not backward compatible. Configuration loss takes place during an upgrade.
0	Indicates the incremental API changes/CLI changes/Schema changes with backward compatibility. It is applicable to the new features on top of the existing capabilities. No configuration is lost during an upgrade.
0	Indicates a bug fix without any functionality change. No configuration is lost during an upgrade.

Table 2: RPM Naming Convention

RPM Naming Convention	Description
Example: fex-2.0.0.0-9.2.1.lib32_n9000.rpm	
0	This number tracks how many times the component has changed during the development cycle of a release. This value will be 0 for all the release images.
9.2.1	Indicates the release number or the distribution version for the RPM. It aligns to the NVR format. Since the feature RPM is only applicable to a NXOS release, this field has NXOS release version number present.
lib32_n9000	Indicates the architecture type of the RPM.

Optional RPMs and Their Associated Features

The optional RPMs are the RPMs that can be installed to enable the features without affecting the native NXOS behavior or they can be removed using the **install deactivate** command from the switch.

Optional RPMs, for example, EIGRP are not a part of the base software. They can be added, upgraded, and removed as required using either **dnf** or **install** CLI commands from the switch.

See the following list of the optional RPMs and their associated features:

Associated Features
feature app-hosting
feature bgp
feature bfd
feature container-tracker
feature eigrp
• feature openflow
• feature evb
• feature imp
• feature netflow
• feature sla_sender
• feature sla_responder
• feature sla twamp-server
• feature sflow

 Table 3: List of Optional RPMs and Their Associated Features

Associated Features
• feature evb
• feature netflow
• feature-set fcoe
• feature-set fcoe-npv
feature-set fex
• feature hsrp
• feature vrrpv3
feature hw telemetry
feature icam
feature isis
• feature mpls segment-routing
• feature mpls evpn
• feature pim
• feature pim6
• feature msdp
• feature ngmvpn
NA
NA
• feature ospf
• feature ospfv3
feature rip
NA
feature catena
feature mpls segment-routing traffic-engineering
feature telemetry
NA
feature vmtracker

Package Name	Associated Features
VXLAN	feature nv overlay
	• feature fabric forwarding

Guidelines for NX-OS Feature RPM Installation

See the following NX-OS system RPM repositories that are present in the Cisco NX-OS Series switches for the RPM management.



Note

Avoid manually copying the RPMs to system repositories. Instead use the install or DNF commands.

Repository Name	Repository Path	Description
groups-repo	/rpms	Part of the bundled NX-OS image. It is used to keep all the RPMs that are bundled as part of the NX-OS image. All RPMs based in this repository are known as base RPMs.
localdb	/bootflash/.rpmstore/patching/localrepo	Used for RPM persistency. When a user adds a NX-OS feature RPM as part of install add command, the RPM is copied to this location and it is persisted during the reloads. User has the responsibility to clean the repository.
		To add a RPM to this repository, use install add command.
		To remove a RPM from this repository, use install remove command.
		DNF commands can be used to populate the repository too.
		The maximum space for the repository is 200Mb along with the patching repository for Cisco Nexus 9000 Series switches except Cisco Nexus 3000 Series switches. For Cisco Nexus 3000 Series switches, the maximum space for the repository is 20 Mb only.

Repository Name	Repository Path	Description
patching	/bootflash/.rpmstore/patching/patchrepo	Used for RPM persistency. When a user adds a NX-OS patch RPM to the switch, the patch RPM is copied to this repository.
thirdparty	/bootflash/.rpmstore/thirdparty	Used for RPM persistency when a user adds a third party RPM.

The **groups-repo** and **localdb** repositories hold the NX-OS feature RPMs that should be installed during the system boot or during activation. DNF commands or **install** command can be used for the installation or the removal of these RPMs.

The following rules are applied to the feature RPM installation procedure during boot or install time:

- Only RPMs with the same NX-OS release number should be selected for the installation.
- Base RPMs cannot be added to the localdb repository.

Guidelines for Third-Party RPM Installation

Currently, any third-party package that is not provided by Cisco is allowed to be installed on the device, even when it is not signed by Cisco.

Starting with release 10.1(x) any third-party package that is not signed by Cisco is not allowed to be installed on the device. However, if you wish to bypass this and install the software, you can configure the device to enable the third-party software installation. The configuration will persist as a normal configuration and can be verified by using the **running-config** command. Following this configuration, you can install any third-party software with the known risks.

Using Install CLIs for Feature or Third-Party RPM Operation

See the following reference table for using install CLIs for the feature RPM operations:

CLI	Description
install reset	This operation removes all the patches, persisted configurations, upgraded packages, third-party installed packages, unsaved configurations, and reloads the switch's previous mode (Full/Base) with the default packages.
	The install reset command also performs write erase operation. The following message is displayed at the prompt:
	<pre>switch(config)# install reset</pre>
	WARNING!!This operation will remove all pactches, upgraded packages, persisted etc configs, third party packages installed, startup configuration(write erase) and reload the switch with default packages.
	Do you want to proceed with reset operation? (y/n)? [n]
install reset nxos base	This operation installs NXOS in base mode by removing all patches, upgraded packages, persisted etc configurations, third-party packages installed, startup configuration (write erase), and reloads the switch with the default packages.
install reset nxos full	This operation installs NXOS with full mode by removing all patches, upgraded packages, persisted etc configs, third-party packages installed, startup configuration (write erase), and reloads the switch with the default packages (with mandatory and optional RPMs).
install add <>	Adds an RPM file to the respective repository and updates the repository (patch/feature/third-party).
install activate <rpm name=""></rpm>	Installs an RPM that is present in the repository.
install commit <rpm name=""></rpm>	Used for the patch RPMs. Makes the patch persist during the reload.
install deactivate <rpm name=""></rpm>	Un-installs an RPM.
	Beginning with Cisco NX-OS Release 10.1(1), when you use this command to deactivate RPMs, the options to either downgrade to the base version of RPM or to uninstall RPM appear. You can select the option that you desire and the operation will proceed.

Table 5: Reference for Install CLIs for the Feature RPM Operations

CLI	Description
install remove <rpm name=""></rpm>	Removes an RPM file from the repository and updates the repository.
sh install active	Displays the list of the installed RPMs in the system apart from base rootfs RPMs. (features/patch/third-party).
sh install inactive	Displays the list of the RPMs that are present in the repository but they are not installed.
sh install packages	Lists all the RPMs that are installed including rootfs RPMs.
[no] system software allow third-party	Beginning with Cisco NX-OS Release 10.1(1) the third-party RPM installations are not allowed to be installed on the device by default. This command bypasses this restriction and configures the device to enable the third-party software installation.
	The following command shows the error message when you activate third-party RPM without applying the third-party configuration:
	<pre>switch(config)# install activate pbwMonitor-1.0-1.5.0.x86_64.rpm</pre>
	Install operation 193 failed because package is not signed by Cisco.Enable TPS installation using 'system software allow third-party' CLI at Tue Nov 17 04:23:10 2020
	The following command shows activating third-party RPM installations after applying the configuration:
	<pre>switch(config)# system software allow third-party switch(config)# 2020 Nov 17 04:25:41 switch %\$ VDC-1 %\$ %USER-2-SYSTEM_MSG: <<%PATCH-INSTALLER-2-TPS_FEATURE_ENABLED>> User has enabled TPS installation - patch_installer</pre>
	<pre>switch(config)# install activate pbwMonitor-1.0-1.5.0.x86_64.rpm [##################] 100% Install operation 194 completed successfully at Tue Nov 17 04:25:58 2020</pre>
	The following command shows disabling the third-party configuration:
	<pre>switch(config)# no system software allow third-party switch(config)# 2020 Nov 17 04:27:17 switch %\$ VDC-1 %\$ %USER-2-SYSTEM_MSG: <<%PATCH-INSTALLER-2-TPS_FEATURE_DISABLED>> User has disabled TPS installation - patch_installer</pre>

L



Note If you are using ISSU or upgrading to Cisco NX-OS Release 10.1.1 release from an earlier version, you must manually apply the third-party configuration within the first 30 minutes after the upgrade to ensure the third-party RPMs get installed.

Using Install CLIs for Digital Signature Support

Use the following CLI commands to install CLIs for digital signature support:

SUMMARY STEPS

- 1. switch#install add bootflash:<keyfile> gpg-key
- 2. switch#install verify package package-name>
- **3.** OR switch#install verify bootflash:<*RPM file*>

DETAILED STEPS

Procedure

	Command or Action	Purpose	
Step 1	switch#install add bootflash: <keyfile> gpg-key</keyfile>	Cisco release RPMs are signed with Cisco GPG (GNU	
	Example:	Privacy Guard) key. The public GPG key is present at /etc/pki/rpm-gpg/arm-Nexus9k-rel.gpg. To add other	
	<pre>install add bootflash:RPM-GPG-KEY-puppetlabs gpg-key [###################] 100% Install operation 304 completed successfully at Thu Jun 19 16:40:28 2018</pre>	public keys from different sources, use the steps in this section.	
Step 2	switch#install verify package <package-name></package-name>	Verifies the package.	
Step 3	OR switch#install verify bootflash: <rpm file=""></rpm>	Use step 2 or 3 to verify whether the RPM file is a signed	
	Example:	or non-signed file.	
	switch# install verify bootflash:vxlan-2.0.0.0-9.2.1.lib32_n9000.rpm	a	
	RSA signed switch#		

Querying All Installed RPMs

Complete the following step to query all the installed RPMs:

SUMMARY STEPS

1. show install packages

I

DETAILED STEPS

Procedure

	Command or Action	Purpose
tep 1	show install packages	Queries all the installed RPMs.
	Example:	
	switch# show install packages	
	Boot Image:	
	NXOS Image: bootflash:/nxos.9.2.1.bin	
	Installed Packages	
	attr.x86 64 2.4.47-r0.0 installed Unsigned	
	aufs-util.x86_64 3.14+git0+b59a2167a1-r0.0	
	installed Unsigned	
	base-files.n9000 3.0.14-r89.0 installed Unsigned	
	base-passwd.lib32_x86 3.5.29-r0.1.0 installed Unsigned	
	bash.lib32 x86 4.3.30-r0.0 installed Unsigned	
	bfd.lib32 n9000 2.0.0.0-9.2.1 installed Signed	
	bgp.lib32 n9000 2.0.0.0-9.2.1 installed Signed	
	binutils.x86 64 2.25.1-r0.0 installed Unsigned	
	bridge-utils.x86 64 1.5-r0.0 installed Unsigned	
	busybox.x86 64 1.23.2-r0.0 installed Unsigned	
	busybox-udhcpc.x86 64 1.23.2-r0.0 installed	
	Unsigned	
	bzip2.x86_64 1.0.6-r5.0 installed Unsigned	
	ca-certificates.all 20150426-r0.0 installed	
	Unsigned	
	cgroup-lite.x86 64 1.1-r0.0 installed Unsigned	
	chkconfig.x86 64 1.3.58-r7.0 installed Unsigned	
	container-tracker.lib32 n9000 2.0.0.0-9.2.1	
	installed Signed	
	containerd-docker.x86_64	
	0.2.3+gitaa8187dbd3b7ad67d8e5e3a15115d3eef43a7ed1-r0.0	
	installed Unsigned	
	core.lib32_n9000 2.0.0.0-9.2.1 installed Signed	
	coreutils.lib32_x86 8.24-r0.0 installed Unsigned	
	cpio.x86_64 2.12-r0.0 installed Unsigned	
	cracklib.lib32_x86 2.9.5-r0.0 installed Unsigned	
	cracklib.x86_64 2.9.5-r0.0 installed Unsigned	
	createrepo.x86_64 0.4.11-r9.0 installed Unsigned	
	cronie.x86_64 1.5.0-r0.0 installed Unsigned	
	curl.lib32_x86 7.60.0-r0.0 installed Unsigned	
	db.x86_64 6.0.30-r0.0 installed Unsigned	
	dbus-1.lib32_x86 1.8.20-r0.0 installed Unsigned	
	dhcp-client.x86_64 4.3.2-r0.0 installed Unsigned	
	dhcp-server.x86_64 4.3.2-r0.0 installed Unsigned	
	switch#	

Installing the RPMs Using One Step Procedure

The CLIs for both install and upgrade RPMs are the same. See the following step to install the RPMs using one step procedure:

Procedure

L

	Command or Action	Purpose
Step 1	install add <rpm> activate</rpm>	Installs and activates the RPM.
	Example:	
	<pre>switch# install add bootflash:chef.rpm</pre>	
	activate	
	Adding the patch (/chef.rpm)	
	[#####################] 100% Install operation 868 completed successfully at	
	Tue May 8 11:20:10 2018	
	Activating the patch (/chef.rpm)	
	[######################] 100%	
	Install operation 869 completed successfully at	
	Tue May 8 11:20:20 2018	

Example

```
switch# show install active
Boot Image:
        NXOS Image: bootflash:/nxos.9.2.1.bin
Active Packages:
bgp-2.0.1.0-9.2.1.lib32_n9000
chef-12.0.0alpha.2+20150319234423.git.1608.b6eb10f-1.el5.x86_64
Active Base Packages:
        lacp-2.0.0.0-9.2.1.lib32 n9000
        lldp-2.0.0.0-9.2.1.lib32 n9000
        mtx-device-2.0.0.0-9.2.1.lib32 n9000
        mtx-grpc-agent-2.0.0.0-9.2.1.1ib32 n9000
        mtx-infra-2.0.0.0-9.2.1.lib32_n9000
        mtx-netconf-agent-2.0.0.0-9.2.1.lib32_n9000
        mtx-restconf-agent-2.0.0.0-9.2.1.lib32 n9000
        mtx-telemetry-2.0.0.0-9.2.1.lib32 n9000
        ntp-2.0.0.0-9.2.1.lib32 n9000
        nxos-ssh-2.0.0.0-9.2.1.lib32 n9000
        snmp-2.0.0.0-9.2.1.lib32 n9000
        svi-2.0.0.0-9.2.1.lib32 n9000
        tacacs-2.0.0.0-9.2.1.lib32 n9000
        vtp-2.0.0.0-9.2.1.lib32_n9000
switch(config)#
```

Installing the RPMs Using Two Steps Procedure

The CLIs for both install and upgrade RPMs are the same. See the following steps to install the RPMs using two steps procedure:

SUMMARY STEPS

- 1. install add <*rpm*>
- **2.** install activate *<rpm>*

DETAILED STEPS

Procedure

	Command or Action	Purpose
Step 1	install add <rpm></rpm>	Installs the RPM.
	Example:	
	switch# install add bootflash:vxlan-2.0.1.0-9.2.1.lib32_n9000.rpm	
	[#####################] 100% Install operation 892 completed successfully at Thu Jun 7 13:56:38 2018	
	<pre>switch(config)# sh install inactive grep vxlan</pre>	
	vxlan-2.0.1.0-9.2.1.lib32_n9000	
Step 2	install activate <rpm></rpm>	Activates the RPM.
	Example:	

Example

Upgrading the RPMs Using One Step

The CLIs for both install and upgrade RPMs are the same. See the following steps to upgrade the RPMs:

Procedure

	Command or Action	Purpose
Step 1	install add <rpm>activate upgrade</rpm>	Installs the RPM.
	Example:	
	switch(config)# install add bootflash:bgp-2.0.2.0-9.2.1.lib32_n9000.rpm	1
	activate upgrade	
	Adding the patch (/bgp-2.0.2.0-9.2.1.lib32_n9000.rpm) [################################## Install operation 870 completed successfully at Tue May 8 11:22:30 2018	
	Activating the patch (/bgp-2.0.2.0-9.2.1.lib32_n9000.rpm) [####################################	

Example

```
switch(config)# show install active
Boot Image:
NXOS Image: bootflash:/nxos.9.2.1.bin
Active Packages:
bgp-2.0.2.0-9.2.1.lib32 n9000
chef-12.0.0alpha.2+20150319234423.git.1608.b6eb10f-1.el5.x86_64
Active Base Packages:
lacp-2.0.0.0-9.2.1.lib32_n9000
lldp-2.0.0.0-9.2.1.lib32 n9000
mtx-device-2.0.0.0-9.2.1.lib32 n9000
mtx-grpc-agent-2.0.0.0-9.2.1.lib32_n9000
mtx-infra-2.0.0.0-9.2.1.1ib32 n9000
mtx-netconf-agent-2.0.0.0-9.2.1.lib32_n9000
mtx-restconf-agent-2.0.0.0-9.2.1.lib32 n9000
mtx-telemetry-2.0.0.0-9.2.1.1ib32 n9000
ntp-2.0.0.0-9.2.1.lib32_n9000
nxos-ssh-2.0.0.0-9.2.1.lib32 n9000
 snmp-2.0.0.0-9.2.1.lib32 n9000
svi-2.0.0.0-9.2.1.lib32_n9000
tacacs-2.0.0.0-9.2.1.1ib32 n9000
 vtp-2.0.0.0-9.2.1.lib32 n9000
```

Downgrading the RPMs

The downgrade procedure needs a special CLI attribute. See the following step to downgrade the RPMs using the one step procedure:

Procedure

	Command or Action	Purpose
Step 1	install add <rpm>activate downgrade</rpm>	Downgrades the RPM.
	Example:	
	<pre>switch(config)# install add bootflash:bgp-2.0.1.0-9.2.1.lib32_n9000.rpm activate downgrade</pre>	1
	Adding the patch (/bgp-2.0.1.0-9.2.1.lib32_n9000.rpm) [###################] 100% Install operation 872 completed successfully at Tue May 8 11:24:43 2018	
	Activating the patch (/bgp-2.0.1.0-9.2.1.lib32_n9000.rpm) [###################] 100% Install operation 873 completed successfully at Tue May 8 11:24:52 2018	

Example

```
switch(config)# show install active
Boot Image:
NXOS Image: bootflash:/nxos.9.2.1.bin
Active Packages:
bgp-2.0.1.0-9.2.1.lib32 n9000
chef-12.0.0alpha.2+20150319234423.git.1608.b6eb10f-1.el5.x86_64
Active Base Packages:
lacp-2.0.0.0-9.2.1.lib32_n9000
lldp-2.0.0.0-9.2.1.lib32 n9000
mtx-device-2.0.0.0-9.2.1.lib32 n9000
mtx-grpc-agent-2.0.0.0-9.2.1.lib32 n9000
mtx-infra-2.0.0.0-9.2.1.lib32 n9000
mtx-netconf-agent-2.0.0.0-9.2.1.lib32_n9000
mtx-restconf-agent-2.0.0.0-9.2.1.1ib32 n9000
mtx-telemetry-2.0.0.0-9.2.1.1ib32 n9000
ntp-2.0.0.0-9.2.1.1ib32 n9000
nxos-ssh-2.0.0.0-9.2.1.lib32 n9000
snmp-2.0.0.0-9.2.1.lib32 n9000
svi-2.0.0.0-9.2.1.lib32_n9000
 tacacs-2.0.0.0-9.2.1.lib32_n9000
vtp-2.0.0.0-9.2.1.lib32 n9000
switch(config)#
```

Uninstalling the RPMs

See the following steps to uninstall the RPMs:

SUMMARY STEPS

1. install deactivate <*rpm*>

DETAILED STEPS

Procedure

	Command or Action	Purpose
Step 1	install deactivate <i><rpm></rpm></i> Example:	Downgrades to the base version of RPM, if one exists in the groups-repo (/rpms), or uninstalls the RPM completely from the switch.
	<pre>switch(config)# install deactivate bgp Base RPM found. Do you want to downgrade to base version(y/n) [n] y Downgrading to the base version [#############################] 100% Install operation 190 completed successfully at Tue Nov 17 04:10:40 2020</pre>	To downgrade to the base version, enter y . To completely uninstall the RPM, enter n in the command prompt.
	Example:	
	switch(config)# install deactivate bgp Base RPM found. Do you want to downgrade to base version(y/n) [n] n	
	WARNING!! This operation will remove 'bgp-3.0.0.0-9.4.1.1ib32_n9000' related configuration from running-configuration on successful completion. Update startup-configuration accordingly.	
	[######################] 100% Install operation 9 completed successfully at Tue Nov 17 05:05:59 2020	

Removing the RPMs

See the following steps to remove the RPMs:

SUMMARY STEPS

1. install remove *<rpm>*

DETAILED STEPS

Procedure

	Command or Action	Purpose
Step 1	install remove <rpm></rpm>	Removes the RPM from the repository.
	Example:	
	<pre>switch(config)# show install inactive grep vxlan</pre>	,
	<pre>vxlan-2.0.0.0-9.2.1.lib32_n9000 switch(config)# install remove vxlan</pre>	
	Proceed with removing vxlan? (y/n)? [n] y [###################################	
	Install operation 890 Removal of base rpm package is not permitted at Thu Jun 7 13:52:15 2018	

Information About DNF Commands

See the following sections for more information about DNF commands.

Ø Note

DNF commands do not support ctrl+c. Install commands do support ctrl+c. If DNF commands are aborted using ctrl+c, manual cleanup must be performed using "/isan/bin/patching_utils.py --unlock".

Performing Package Operations Using the DNF Commands

See the following sections for performing package operations using the DNF commands:

|--|

Note DNF commands are accessed only from the BASH shell on the box and they are not allowed from the NXOS VSH terminal.

Ŵ

Note

Make sure that as a sudo user, you have access to the super user privileges.

Finding the Base Version RPM of the Image

Use the **ls /rpms** command to find the base version RPM of the image. The base RPM version is the pre-installed RPM that is archived in the system image.

#ls /rpms

```
bfd-2.0.0.0-9.2.1.lib32 n9000.rpm
ins tor sdk t2-1.0.0.0-9.2.0.77.lib32 n9000.rpm
mtx-netconf-agent-2.0.0.0-9.2.1.lib32 n9000.rpm
                                                  snmp-2.0.0.0-9.2.1.lib32 n9000.rpm
bgp-2.0.0.0-9.2.1.lib32_n9000.rpm
ins tor sdk t3-1.0.0.0-9.2.0.77.lib32 n9000.rpm
mtx-restconf-agent-2.0.0.0-9.2.1.lib32 n9000.rpm sr-2.0.0.0-9.2.1.lib32 n9000.rpm
container-tracker-2.0.0.0-9.2.1.lib32 n9000.rpm isis-2.0.0.0-9.2.1.lib32 n9000.rpm
        mtx-telemetry-2.0.0.0-9.2.1.lib32 n9000.rpm
                                                         svi-2.0.0.0-9.2.1.lib32 n9000.rpm
eigrp-2.0.0.0-9.2.1.lib32 n9000.rpm
                                                 lacp-2.0.0.0-9.2.1.lib32 n9000.rpm
         nbproxy-2.0.0.0-9.2.1.lib32 n9000.rpm
tacacs-2.0.0.0-9.2.1.lib32 n9000.rpm
ext-eth-2.0.0.0-9.2.1.lib32 n9000.rpm
                                                 lldp-2.0.0.0-9.2.1.lib32 n9000.rpm
         ntp-2.0.0.0-9.2.1.lib32 n9000.rpm
telemetry-2.3.4.0-9.2.1.lib32 n9000.rpm
fcoe-2.0.0.0-9.2.1.lib32 n9000.rpm
                                                 mcast-2.0.0.0-9.2.1.lib32 n9000.rpm
         nxos-ssh-2.0.0.0-9.2.1.lib32 n9000.rpm
virtualization-2.0.0.0-9.2.1.lib32 n9000.rpm
fex-2.0.0.0-9.2.1.lib32 n9000.rpm
                                                 mpls-2.0.0.0-9.2.1.lib32 n9000.rpm
        ospf-2.0.0.0-9.2.1.lib32 n9000.rpm
                                                         vtp-2.0.0.0-9.2.1.lib32 n9000.rpm
fhrp-2.0.0.0-9.2.1.lib32 n9000.rpm
                                                 mtx-device-2.0.0.0-9.2.1.lib32 n9000.rpm
         repodata
vxlan-2.0.0.0-9.2.1.lib32 n9000.rpm
guestshell-2.0.0.0-9.2.1.lib32 n9000.rpm
                                               mtx-grpc-agent-2.0.0.0-9.2.1.lib32 n9000.rpm
      rip-2.0.0.0-9.2.1.lib32 n9000.rpm
icam-2.0.0.0-9.2.1.lib32 n9000.rpm
                                                 mtx-infra-2.0.0.0-9.2.1.lib32 n9000.rpm
          services-2.0.0.0-9.2.1.lib32 n9000.rpm
```

Checking the List of the Installed RPMs

Use the **dnf list installed** command to query the feature and third party RPMs and grep a specific RPM. See the following example for feature RPMs:

2 0 0 0 0 1	0
	@groups-repo
	installed
	installed
2.0.0.0-9.2.1	@groups-repo
2.0.0.0-9.2.1	installed
2.0.0.0-9.2.1	installed
2.0.0.0-9.2.1	installed
2.0.0.0-9.2.1	@groups-repo
2.0.0.0-9.2.1	installed
2.0.0.0-9.2.1	@groups-repo
2.0.0.0-9.2.1	installed
2.0.0.0-9.2.0.77	installed
2.0.1.0-9.2.1	@localdb
	2.0.0.0-9.2.1 $2.0.0.0-9.2.1$

bash-4.2# dnf list installed | grep lib32_n9000

vtp.lib32 n9000	2.0.0.0-9.2.1	installed
vxlan.lib32_n9000	2.0.0.0-9.2.1	@groups-repo

Getting Details of the Installed RPMs

The **dnf info** *<rpmname>* command lists out the detailed info of the installed RPM.

dnf info vxlan

Loaded plugins: downloadonly, importpubkey, localrpmDB, patchaction, patching, protect-packages groups-repo

localdb		1.1 kB 00:00
		951 B 00:00
patching		
thirdparty		951 В 00:00
curraparcy		
Installed Pa	ac	951 B 00:00 kages
Name	:	vxlan
Arch	:	lib32 n9000
Version	:	2.0.0.0
Release	:	9.2.1
Size	:	6.4 M
Repo	:	installed
From repo	:	groups-repo
Summary	:	Cisco NXOS VxLAN
URL	:	http://cisco.com/
License	:	Proprietary
Description	:	Provides VxLAN support

Installing the RPMs

Installing the RPMs downloads the RPMs and copies the respective program to the switches. See the following example for installing the RPMs from a remote server (that is reachable in the network):

<pre>bash-4.3# dnf install http://10.0.0.2/modulari</pre>	ty/rpms/vxl	.an-2.0.1	0-9.	2.1.	lib32	2_n9000.rpm
Loaded plugins: downloadonly, protect-packages groups-repo	importpubkey,	localrpmDI	3, pato	chactio	on, pa	tching,
			1.1 kH	3 (00:00	
localdb		I.	951 1	3 (00.00	
localdb/primary		I	JJ1 1		50.00	
			886 I	3 (00:00	
localdb						1/1
patching						1/1
			951 H	3 (00:00	
thirdparty			0 5 1 -			
		I	951 E	3 (00:00	•••

Dependencies Resolved

Package Reposit	Arch ory	Version Size	
Installing: vxlan /vxlan-2.0.1. Transaction Summar	lib32_n9000 0-9.2.1.lib32_n9000 Y	2.0.1.0-9.2.1 6.4 M	
Install 1 Pa	ckage		
starting pre-insta pre-install for vx starting post-inst post-install for v	y es: n Check n Test ucceeded n an-2.0.1.0-9.2.1.1ib32_n9000 ll package version mgmt for vxlan lan complete all package version mgmt for vxlan	1/1	
Installed: vxlan.lib32 n900	0 0:2.0.1.0-9.2.1		

Complete!

See the following example for installing the RPMs from local bootflash:

sudo dnf install /bootflash/vxlan-2.0.1.0-9.2.1.lib32_n9000.rpm

Loaded plugins: downloadonly, importpubkey, localrpmDB, patchaction, patching, protect-packages groups-repo

localdb		1.1 kB	00:00	• • •
patching	I	951 B	00:00	
thirdparty	I	951 B	00:00	
		951 B	00:00	

```
Setting up Install Process
Examining /bootflash/vxlan-2.0.1.0-9.2.1.lib32_n9000.rpm: vxlan-2.0.1.0-9.2.1.lib32_n9000
Marking /bootflash/vxlan-2.0.1.0-9.2.1.lib32_n9000.rpm as an update to
vxlan-2.0.0.0-9.2.1.lib32_n9000
Resolving Dependencies
--> Running transaction check
---> Package vxlan.lib32_n9000 0:2.0.0.0-9.2.1 will be updated
---> Package vxlan.lib32_n9000 0:2.0.1.0-9.2.1 will be an update
--> Finished Dependency Resolution
```

Dependencies Resolved

Package Version	Arch	Repository
	Size	
Updating:		
vxlan 2.0.1.0-9.2.1	lib32_	
2.0.1.0-9.2.1	6.4 M	/vxlan-2.0.1.0-9.2.1.lib32_n9000
Transaction Summary		
Upgrade 1 Package		
Total size: 6.4 M		
Is this ok [y/N]: y		
Downloading Packages:		
Running Transaction Check		
Running Transaction Test		
Transaction Test Succeeded		
Running Transaction	0 0 0 1 1 1 2 0 0000	
Updating : vxlan-2.0.1.	0-9.2.1.11b32_n9000	
	1/2	
starting pre-install packag	-	lan
pre-install for vxlan compl		
starting post-install packa		vxlan
post-install for vxlan comp		
Cleanup : vxlan-2.0.0.	0-9.2.1.lib32_n9000	
	2/2	
Updated:		
vxlan.lib32_n9000 0:2.0.1	.0-9.2.1	
Complete!		

See the following example for installing the RPM if it is available in a repository:

dnf install eigrp

Upgrading the RPMs

See the following example for upgrading the RPMs from a remote server (that is reachable in the network):

bash-4.3# dnf upgrade

http://10.0.0.2/modularity/rpms/vxlan-2.0.1.0-9.2.1.lib32_n9000.rpm

Loaded plugins: downloadonly, importpubkey, localrpmDB, patchaction, patching, protect-packages groups-repo | 1.1 kB 00:00 ... localdb 951 B 00:00 ... patching 951 B 00:00 ... thirdparty | 951 B 00:00 ... Setting up Upgrade Process vxlan-2.0.1.0-9.2.1.lib32 n9000.rpm | 1.6 MB 00:00 Examining /var/tmp/yum-root-RaANgb/vxlan-2.0.1.0-9.2.1.lib32 n9000.rpm: vxlan-2.0.1.0-9.2.1.lib32 n9000 Marking /var/tmp/yum-root-RaANgb/vxlan-2.0.1.0-9.2.1.lib32 n9000.rpm as an update to vxlan-2.0.0.0-9.2.1.lib32 n9000 Resolving Dependencies --> Running transaction check ---> Package vxlan.lib32 n9000 0:2.0.0.0-9.2.1 will be updated ---> Package vxlan.lib32_n9000 0:2.0.1.0-9.2.1 will be an update --> Finished Dependency Resolution

Dependencies Resolved

Package Version Arch Repository Size Updating: lib32 n9000 2.0.1.0-9.2.1 vxlan /vxlan-2.0.1.0-9.2.1.lib32 n9000 6.4 M Transaction Summary Upgrade 1 Package Total size: 6.4 M Is this ok [y/N]: y Downloading Packages: Running Transaction Check Running Transaction Test Transaction Test Succeeded Running Transaction ** Found 1 pre-existing rpmdb problem(s), 'yum check' output follows: busybox-1.23.2-r0.0.x86 64 has missing requires of busybox-syslog Updating : vxlan-2.0.1.0-9.2.1.1ib32 n9000 1/2 starting pre-install package version mgmt for vxlan pre-install for vxlan complete starting post-install package version mgmt for vxlan post-install for vxlan complete Cleanup : vxlan-2.0.0.0-9.2.1.lib32 n9000 2/2 Updated: vxlan.lib32 n9000 0:2.0.1.0-9.2.1

Complete!

See the following example for upgrading the RPMs from local bootflash:

sudo dnf upgrade /bootflash/vxlan-2.0.1.0-9.2.1.lib32 n9000.rpm

Loaded plugins: downloadonly, importpubkey, localrpmDB, patchaction, patching, protect-packages groups-repo

00:00 ...

00:00 ...

```
| 1.1 kB
localdb
```

patching

| 951 B 00:00 ...

| 951 B

onitiaparoj

| 951 B 00:00 ...

```
Setting up Upgrade Process
Examining /bootflash/vxlan-2.0.1.0-9.2.1.lib32_n9000.rpm: vxlan-2.0.1.0-9.2.1.lib32_n9000
Marking /bootflash/vxlan-2.0.1.0-9.2.1.lib32_n9000.rpm as an update to
vxlan-2.0.0.0-9.2.1.lib32_n9000
Resolving Dependencies
--> Running transaction check
---> Package vxlan.lib32_n9000 0:2.0.0.0-9.2.1 will be updated
---> Package vxlan.lib32_n9000 0:2.0.1.0-9.2.1 will be an update
--> Finished Dependency Resolution
```

Dependencies Resolved

Package Version	Size	Arch	Repository
Updating: vxlan 2.0.1.0-9.2.1 6	.4 M	lib32_n9	0000 /vxlan-2.0.1.0-9.2.1.lib32_n9000
Transaction Summary			
Upgrade 1 Package			
Total size: 6.4 M Is this ok [y/N]: y Downloading Packages: Running Transaction Check Running Transaction Test Transaction Test Succeeded Running Transaction Updating : vxlan-2.0.1.0-9	.2.1.lib32	_n9000	
<pre>starting pre-install package ve pre-install for vxlan complete starting post-install package ve post-install for vxlan complete Cleanup : vxlan-2.0.0.0-9</pre>	version mg	mt for vx	
	2/2		

```
Updated:
vxlan.lib32_n9000 0:2.0.1.0-9.2.1
```

Complete!

sudo dnf

See the following example for upgrading the RPMs if it is available in any repository:

dnf upgrade eigrp

Downgrading the RPMs

See the following example for downgrading the RPMs from a remote server (that is reachable in the network):

```
downgrade vxlan-2.0.0.0-9.2.1.1ib32 n9000
Loaded plugins: downloadonly, importpubkey, localrpmDB, patchaction, patching,
protect-packages
Setting up Downgrade Process
groups-repo
                    | 1.1 kB
                              00:00 ...
localdb
                    | 951 B
                              00:00 ...
localdb/primary
                    | 1.3 kB
                                00:00 ...
localdb
                                       2/2
patching
                    | 951 B
                                00:00 ...
thirdparty
                    951 B
                                00:00 ...
Resolving Dependencies
--> Running transaction check
---> Package vxlan.lib32 n9000 0:2.0.0.0-9.2.1 will be a downgrade
---> Package vxlan.lib32 n9000 0:2.0.1.0-9.2.1 will be erased
--> Finished Dependency Resolution
Dependencies Resolved
```

Package			Arch	Denseiterun
Version	Size		Repository	
Downgradin vxlan	g:		lib32 n9000	
	2.0.0.0-9.2.1			groups-repo
		1.6 M		
Transactio	n Summary			

Downgrade 1 Package

```
Total download size: 1.6 M
Is this ok [y/N]: y
Downloading Packages:
Running Transaction Check
Running Transaction Test
Transaction Test Succeeded
Running Transaction
 Installing : vxlan-2.0.0.0-9.2.1.1ib32 n9000
                                   1/2
starting pre-install package version mgmt for vxlan
pre-install for vxlan complete
starting post-install package version mgmt for vxlan
post-install for vxlan complete
 Cleanup : vxlan-2.0.1.0-9.2.1.1ib32 n9000
                                   2.12
Removed:
 vxlan.lib32_n9000 0:2.0.1.0-9.2.1
Installed:
 vxlan.lib32 n9000 0:2.0.0.0-9.2.1
Complete!
```

See the following example for downgrading the RPMs from local bootflash:

dnf downgrade /bootflash/eigrp-2.0.0-9.2.1.lib32_n9000.rpm

See the following example for downgrading the RPMs if it is available in any repository:

dnf downgrade eigrp

Deleting the RPMs

Deleting the RPMs de-installs the RPMs and removes any configuration CLI of the feature. Use the **dnf erase** <*rpm*> command to delete the RPMs.

bash-4.2# sudo dnf erase vxlan

```
Loaded plugins: downloadonly, importpubkey, localrpmDB, patchaction, patching,
protect-packages
Setting up Remove Process
Resolving Dependencies
--> Running transaction check
---> Package vxlan.lib32_n9000 0:2.0.1.0-9.2.1 will be erased
--> Finished Dependency Resolution
Dependencies Resolved
```

Package	Arch Repository	Version Size
Removing: vxlan Transaction Summary	lib32_n9000 @/vxlan-2.0.1.0-9.2.1.lib32_n9000	2.0.1.0-9.2.1 6.4 M
Remove 1 Package		
Installed size: 6.4 M Is this ok [y/N]: y Downloading Packages: Running Transaction Chec Running Transaction Test Transaction Test Succeed Running Transaction Erasing : vxlan-2.0	ed	
starting pre-remove pack pre-remove for vxlan com	1/1 age version mgmt for vxlan plete	
Removed: vxlan.lib32_n9000 0:2.	0.1.0-9.2.1	

Complete!

Support for DNF Groups

The support for DNF groups is part of the package management. It simplifies the management of the packages for the administrators and it provides greater flexibility.

The administrators can group a list of packages (RPMs) into a logical group and they can perform various operations. DNF supports the following group commands:

- grouplist
- groupinfo
- groupinstall
- groupremove
- groupupdate

DNF groups can be broadly classified as L2, L3, routing, and management.

Using the grouplist Command

In Linux, number of packages are bundled to particular group. Instead of installing individual packages with dnf, you can install particular group that will install all the related packages that belongs to the group. For example to list all the available groups, use the **dnf grouplist** command:

_\$

L2 L3 bash-4.4#

Using the groupmembers Command

Use **dnf groupinfo** command to display the description and the contents of a package group. The command lists out the feature members of the group.

Using the groupinstall Command

This command is for both install and upgrade of the members RPM. If the member is not installed, it will install the highest version available. If the member is already installed and higher RPM is available, it will upgrade that member.

Group

Packages

Using the groupupdate Command

Use the **dnf groupupdate** command to update any existing installed group packages.

```
bash-4.4# dnf groupupdate 13
```

```
Last metadata expiration check: 0:00:00 ago on Wed 13 Mar 2024 12:30:11 PM UTC. 
] --- B/s | 0 B --:-- ETA Dependencies resolved.
```

Group	Packages	¢
Marking packages as installed by the group: @L3	bfd	ېې

Package	Arch Repository	Size	Version
Installing group packages bfd	: lib32_64_n9000 groups-repo	562 k	2.0.0.0-10.4.3
Fransaction Summary			
Install 1 Package			
Total size: 562 k Installed size: 2.3 M Is this ok [y/N]: y Downloading Packages: Running transaction check Iransaction check succeed Running transaction test Transaction test succeede Running transaction Preparing :	ed.		
	2.0.0.0-10.4.3.lib32_64_n9000	1/1	
starting pre-install pack pre-install for bfd compl	ete	1/1	
-	2.0.0.0-10.4.3.lib32_64_n9000 2.0.0.0-10.4.3.lib32 64 n9000	1/1	
starting post-install pac	 kage version mgmt for bfd	1/1	
post-install for bfd comp Verifying : bfd-	lete 2.0.0.0-10.4.3.lib32_64_n9000	1/1	
Installed: bfd.lib32_64_n9000 2.0.	0.0-10.4.3		
Complete! Install operation 14 comp	leted successfully at Wed Mar 13 12	:30:23 2024.	
[#####################] 10 pash-4.4#	0%		

Using the grouperase Command

I

Use the **dnf grouperase** command to delete the groups or all the RPM members of the group.

bash-4.4# dr Dependencie:	nf grouperase 13 s resolved.		
Group		Packages	i i i i i i i i i i i i i i i i i i i
Marking pac @L3	kages as removed by the group:	bfd	
Package	Arch Repository	Size	Version

```
Removing:
bfd
                            lib32_64_n9000
                                                                   2.0.0.0-10.4.3
               @System
                                              2.3 M
Transaction Summary
Remove 1 Package
Freed space: 2.3 M
Is this ok [y/N]: y
Running transaction check
Transaction check succeeded.
Running transaction test
Transaction test succeeded.
Running transaction
 Preparing
                   :
                                                1/1
 Running scriptlet: bfd-2.0.0.0-10.4.3.lib32 64 n9000
starting pre-remove package version mgmt for bfd
pre-remove for bfd complete
                  : bfd-2.0.0.0-10.4.3.lib32 64 n9000
  Erasing
                                                1/1
 Running scriptlet: bfd-2.0.0.0-10.4.3.lib32 64 n9000
                                                1/1
starting post-remove package version mgmt for bfd
post-remove for bfd complete
                     : bfd-2.0.0.0-10.4.3.lib32_64_n9000
    Verifying
                                                  1/1
Removed:
 bfd.lib32 64 n9000 2.0.0.0-10.4.3
                                                    Complete!
Install operation 11 completed successfully at Fri Mar 8 12:38:41 2024.
[###################### 100%
bash-4.4#
```

Finding Repositories

This command lists the repositories that the switch has along with the number of RPMs it has to those repositories.

```
bash-4.3# dnf repolist all
Loaded plugins: downloadonly, importpubkey, localrpmDB, patchaction, patching,
protect-packages
groups-repo
                    | 1.1 kB
                                00:00 ...
localdb
                    | 951 B
                              00:00 ...
patching
                    | 951 B
                                00:00 ...
thirdparty
                    | 951 B
                                 00:00 ...
repo id
```

	repo name	
		status
groups-re	ро	
	Groups-RPM Database	
		enabled: 37
localdb		
	Local RPM Database	
		enabled: 6
patching	Patch-RPM Database	
	Fatch-KFM Database	enabled: 0
thirdpart	37	enabrea. 0
chirapare	Thirdparty RPM Databas	e
	initapatoj nin bacabao	enabled: 0
open-nxos		
÷	open-nxos	
	-	disabled
repolist:	43	

Finding the Installed DNF Version

See the following example for listing the installed DNF version:

```
dnf --version
```

```
3.4.3
Installed: rpm-5.4.14-r0.0.x86_64 at 2018-06-02 13:04
Built : Wind River <info@windriver.com> at 2018-04-27 08:36
Committed: Wind River <info@windriver.com> at 2018-04-27
Installed: yum-3.4.3-r9.0.x86_64 at 2018-06-02 13:05
Built : Wind River <info@windriver.com> at 2018-04-27 08:36
Committed: Wind River <info@windriver.com> at 2018-04-27
```

Mapping the NX-OS CLI to the DNF Commands

See the following table for mapping the NX-OS CLI to the DNF commands:

Table 6: Patching Command Reference

NX-OS CLI Commands	DNF Commands
show install inactive	dnf listpatch-only available
show install active	dnf listpatch-only installed
show install committed	dnf listpatch-only committed
show install packages	dnf listpatch-only
show install pkg-info	dnf infopatch-only

NX-OS CLI Commands	DNF Commands
show install log	dnf historyshow-patch-log
	where log_cmd:
	• opid= - Log that is specific to an operation ID.
	• last - Shows the latest operation log.
	• reverse – Shows the log in reverse order.
	• detail – Show detailed log.
	• from= - Shows logging from a specific operation ID.
clear install log	dnf historyclear-patch-log=
	where clear_log_cmd:
	• all - Clears the complete log.
	• - Clears the logs above this operation ID.
install add	dnf installadd bootflash:/
install remove	dnf installremove
install remove inactive	dnf installremove all
install activate	dnf installno-persistnocommit
	Note By default, all packages are activated and committed.
install deactivate	dnf erasenocommit
	Note By default, all packages are de-activated and committed.
install commit	dnf installcommit
Install commit	dnf installcommit all

Configuring an FTP server and Setting up a Local FTP YUM Repository

For setting up a local FTP YUM repository, you have to first create an FTP server, create a local FTP YUM repository, and configure the Cisco NX-OS switch to reach the FTP server as outlined in the following illustration.

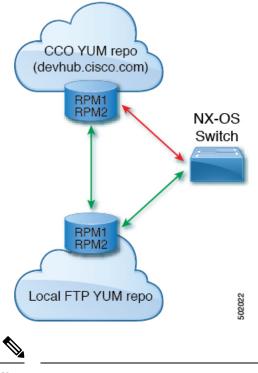


Figure 2: Configuring an FTP server and Setting up a Local FTP YUM Repository

Note For Cisco NX-OS Release 10.1(1), visit https://devhub.cisco.com/artifactory/open-nxos/10.1.1/ for Cisco open-nxos repository.

Creating an FTP Server on Red Hat Enterprise Linux 7 (RHEL7) Virtual Machine

Complete the following steps to create an FTP server on Red Hat Enterprise Linux 7 (RHEL7) Virtual Machine (VM):

SUMMARY STEPS

- 1. dnf install vsftpd
- **2**. systemctl start vsftpd
- 3. systemctl status vsftpd
- 4. firewall-cmd --zone=public --permanent --add-port=21/tcp
- 5. firewall-cmd --zone=public --permanent --add-service=ftp
- 6. firewall-cmd --reload
- 7. wget ftp:// <ip of FTP server> /test.txt

DETAILED STEPS

Procedure

	Command or Action	Purpose
Step 1	dnf install vsftpd	Installs vsftpd, an FTP server.
Step 2	systemctl start vsftpd	Starts the FTP Server.
Step 3	systemctl status vsftpd	Checks the status of the FTP Server.
Step 4	firewall-cmdzone=publicpermanent add-port=21/tcp	Allows access to the FTP services from the external systems and opens port 21.
Step 5	firewall-cmdzone=publicpermanent add-service=ftp	Adds the FTP service.
Step 6	firewall-cmdreload	Reloads the server.
Step 7	<pre>wget ftp:// <ip ftp="" of="" server=""> /test.txt</ip></pre>	Hosts a file in the FTP server (for example, test.txt) and attempts Wget of that file.
		Note Note that /var/ftp/ is the default home directory of the FTP server.

Creating a Local FTP YUM Repository

Complete the following steps to synchronize the external repository RPMs to the FTP server and create a local FTP YUM repository:

SUMMARY STEPS

- 1. touch /etc/yum.repos.d/local.repo
- 2. vim /etc/yum.repos.d/local.repo
- 3. cat /etc/yum.repos.d/local.repo
- 4. dnf repolist
- **5. nohup reposync -r** <*repo-name mentioned in the local.repo*> **-p** <*directory path to sync*>&
- 6. tail -f nouhup.out

DETAILED STEPS

Procedure

	Command or Action	Purpose
Step 1	touch /etc/yum.repos.d/local.repo	Creates a repository file under /etc/yum.repos.d /, for example, creates local.repo repository and adds the base
	Example: bash-4.3#touch /etc/yum.repos.d/local.repo	URL.

	Command or Action	Purpose
Step 2	vim /etc/yum.repos.d/local.repo	Edit the repository file and copy the localrepo details.
	Example: bash-4.3#vim /etc/yum.repos.d/local.repo	Note Modify the base URL to the required repository URL.
	<pre>[localrepo] name=localrepo baseurl= https://devhub.cisco.com/artifactory/open-nxos/7.0-3-I2-1/x86_64/ enabled=1 gpgcheck=0 sslverify=0</pre>	
Step 3	cat /etc/yum.repos.d/local.repo	Verify the local repository data to proceed further.
	Example: bash-4.3#cat /etc/yum.repos.d/local.repo	
	<pre>[localrepo] name=localrepo baseurl= https://devhub.cisco.com/artifactory/open-nxos/7.0-3-I2-1/x86_64/ enabled=1 gpgcheck=0 sslverify=0</pre>	
Step 4	dnf repolist	Checks the reachability of the repository.
	<pre>Example: bash-4.3# dnf repolist Loaded plugins: fastestmirror, langpacks Loading mirror speeds from cached hostfile * base: mirror.dhakacom.com * extras: mirror.dhakacom.com * updates: mirror.dhakacom.com repo id repo name status base/7/x86_64 CentOS-7 - Base 9,911 extras/7/x86_64 CentOS-7 - Extras 313 localrepo localrepo 687 updates/7/x86_64 CentOS-7 - Updates 711 repolist: 11,622</pre>	
Step 5	nohup reposync -r < <i>repo-name mentioned in the local.repo></i> -p < <i>directory path to sync></i> &	Synchronizes all the packages from the external repository to the FTP server home directory.
	Example:	
	nohup reposync -r localrepo -p /var/ftp/ &	
	This command creates a directory with the name local.repo inside / var/ftp / and downloads all the packages from	
	devhub.cisco.com to the directory.	

Configuring a Switch to Reach an FTP Server

Complete the following steps to configure a switch to reach an FTP server:

SUMMARY STEPS

- 1. run bash sudo su
- 2. ip netns exec management ping <ip_address>
- 3. touch /etc/yum/repos.d/ftp.repo
- 4. vim /etc/yum/repos.d/ftp.repo
- 5. cat /etc/yum/repos.d/ftp.repo
- 6. ip netns exec management bash
- 7. dnf repolist
- 8. dnf list available

DETAILED STEPS

Procedure

	Command or Action	Purpose
Step 1	run bash sudo su	Logs in as a sudo user.
Step 2	<pre>ip netns exec management ping <ip_address></ip_address></pre>	Checks the reachability of the FTP server address from the switch using the ping command.
Step 3	touch /etc/yum/repos.d/ftp.repo Example: bash-4.3#touch /etc/yum/repos.d/ftp.repo	Creates a repository file under /etc/yum/repos.d /, for example, creates ftp.repo repository.
Step 4	vim /etc/yum/repos.d/ftp.repo	Edit the repository file and copy the ftp repo details.
	Example: bash-4.3#vim /etc/yum/repos.d/ftp.repo	Note Modify the base URL to the required ftp server IP.
	<pre>[ftp] name=ftp baseurl= ftp://198.51.100.1/localrepo/ enabled=1 gpgcheck=0 sslverify=0</pre>	
Step 5	cat /etc/yum/repos.d/ftp.repo Example:	Creates a repository file on the switch with the FTP server address as the URL.
	<pre>bash-4.3# cat /etc/yum/repos.d/ftp.repo [ftp] name=ftp baseurl=ftp://198.51.100.1/localrepo/ enabled=1 gpgcheck=0 sslverify=0</pre>	

	Command or Action	Purpose
Step 6	ip netns exec management bash	Uses the Bash shell prompt.
Step 7	dnf repolist	Checks the reachability of newly created repository.
	Example:	
	<pre>bash-4.3# dnf repolist Loaded plugins: downloadonly, importpubkey, localrpmDB, patchaction, patching, : protect-packages groups-repo 1.1 kB 00:00 localdb 951 B 00:00 patching 951 B 00:00 thirdparty 951 B 00:00 thirdparty/primary 758 B 00:00 thirdparty 1/1 repo id repo name status groups-repo Groups-RPM Database 37 localdb Local RPM Database 0 patching Patch-RPM Database 0 thirdparty Thirdparty RPM Database 1 ftp ftp 686 repolist: 724</pre>	
Step 8	dnf list available	Lists the available packages in the new repository.

Creating User Roles for Install Operation

The **install** command is only available to the users of admin role. The **install** command can be available to a user by RBAC. See RBAC configuration guidelines for the same.

Compacting Cisco NX-OS Software Images

Cisco NX-OS software image compaction reduces the size of the image file before completing a copy request. Use SCP, HTTP, or HTTPS as the source and bootflash or USB as the destination. The following example uses SCP and bootflash:

```
switch# copy scp://user@scpserver.cisco.com//download/nxos64.10.1.1.bin
bootflash:nxos64.10.1.1.bin compact vrf management use-kstack
```

user1@10.65.42.196's password: nxos64.10.1.1.bin 100% 1501MB 8.4MB/s 02:58 Copy complete, now saving to disk (please wait)... Copy complete.

The **compact** keyword compacts the NX-OS image before copying the file to the supervisor module.



Note Software image compaction is only supported on SCP, HTTP, or HTTPS. If you attempt compaction with any other protocol, the system returns the following error:

Compact option is allowed only with source as $\operatorname{scp}/\operatorname{http}/\operatorname{https}$ and destination as bootflash or usb

Note Compacted images are not supported with LXC boot mode.



Note

Software image compaction is only supported on Cisco Nexus 9300-series platform switches.



CHAPTER -

Converting from Cisco NX-OS to ACI Boot Mode and from ACI Boot Mode Back to Cisco NX-OS

This chapter describes how to convert a Cisco Nexus 9000 Series switch from Cisco NX-OS to Cisco Application Centric Infrastructure (ACI) boot mode.



Note

If you need to convert the mode of operation from NX-OS to ACI and the NX-OS switch model has only 16G memory, then the switch requires an RAM memory upgrade to support the ACI mode. For more information about upgrading the RAM of such switches, refer to Adding an 8, 16, or 32 Gigabyte DIMM to a Cisco Nexus 9000 Series Switch.

This chapter contains the following sections:

- Converting to ACI Boot Mode, on page 91
- Converting a Replacement Standby Supervisor to ACI Boot Mode, on page 94
- Converting Back to Cisco NX-OS, on page 95

Converting to ACI Boot Mode

You can convert any Cisco Nexus 9000 Series switch from Cisco NX-OS to ACI boot mode.



Note When converting any switch from NX-OS (standalone) to ACI boot mode, you can delete the NX-OS image from the bootflash to save space.

Before you begin

Verify whether your switch hardware is supported in ACI boot mode by checking the "Supported Hardware" section of the Release Notes for Cisco Nexus 9000 Series ACI-Mode Switches. For example, line cards are not compatible between Cisco NX-OS and ACI boot mode.

Remove or turn off any unsupported modules (using the **poweroff module** *module* command). Otherwise, the software uses a recovery/retry mechanism before powering down the unsupported modules, which can cause delays in the conversion process.

For dual-supervisor systems, use the **show module** command to make sure that the standby supervisor module is in the ha-standby state.

Verify that the Application Policy Infrastructure Controller (APIC) is running Release 1.0(2j) or a later release.

Make sure that the ACI image is 11.0(2x) or a later release.

Use the **show install all impact epld** *epld-image-name* command to verify that the switch does not require any EPLD image upgrades. If any upgrades are required, follow the instructions in the Cisco Nexus 9000 Series FPGA/EPLD Upgrade Release Notes.

SUMMARY STEPS

- **1.** Verify that the switch is running the latest release.
- 2. Follow these steps to copy the ACI image from the APIC:
- **3.** Follow these steps to boot to the ACI image:
- 4. Verify whether you must install certificates for your device.

DETAILED STEPS

Procedure

Step 1 Verify that the switch is running the latest release.

Example:

switch(config) # show version

Cisco NX-OS filenames begin with "nxos".

- **Step 2** Follow these steps to copy the ACI image from the APIC:
 - a) Set the IP address on the mgmt0 interface of the switch to allow connectivity between this interface and the APIC.
 - b) Enable SCP services on the switch.

Example:

switch(config)# feature scp-server

c) From the APIC CLI, use SCP to copy the firmware image from the APIC to the active supervisor module on the switch.

Example:

admin@apic1:aci> scp -r /firmware/fwrepo/fwrepo/switch-image-name admin@switch-ip-address:switch-image-name

d) For dual-supervisor systems, copy the ACI image to the standby supervisor module.

Example:

switch(config) # copy bootflash:aci-image bootflash://sup-standby/

- **Step 3** Follow these steps to boot to the ACI image:
 - a) Configure the switch to not boot from Cisco NX-OS.

Example:

switch(config) # no boot nxos

b) Save the configuration.

Example:

switch(config) # copy running-config startup-config

- Note You must run the copy running-config startup-config command prior to booting the ACI image. Do not run it after you enter the **boot aci** command.
- c) Boot the active and standby supervisor modules with the ACI image.

Example:

switch(config) # boot aci bootflash:aci-image-name

- **Caution** Do not enter the **copy running-config startup-config** command after the **boot aci** command. If you do, the switch will go to the loader> prompt.
- d) Verify the integrity of the file by displaying the MD5 checksum.

Example:

switch(config) # show file bootflash:aci-image-name md5sum

e) Reload the switch.

Example:

switch(config)# reload

f) Log in to the switch as an administrator.

Example:

Login: admin

Step 4 Verify whether you must install certificates for your device.

Example:

admin@apic1:aci> openssl asnlparse -in /securedata/ssl/server.crt

Look for PRINTABLESTRING in the command output. If "Cisco Manufacturing CA" is listed, the correct certificates are installed. If something else is listed, contact TAC to generate and install the correct certificates for your device.

Note You might need to install certificates for Cisco Nexus 9000 Series switches that were shipped prior to May 2014.

To run this command, contact TAC.

What to do next

See the ACI and APIC documentation to configure and operate your switch in ACI mode: http://www.cisco.com/ c/en/us/support/cloud-systems-management/application-policy-infrastructure-controller-apic/ tsd-products-support-series-home.html.

Converting a Replacement Standby Supervisor to ACI Boot Mode

If you ever need to replace the standby supervisor module in a dual-supervisor system, you will need to copy and boot the ACI image for use with the replacement standby supervisor.

Before you begin

Copy the ACI image to a USB drive.

Procedure

Reload the switch. Step 1 Example: switch# reload Step 2 Enter a break sequence (Ctrl-C or Ctrl-]) during the initial boot sequence to access the loader> prompt. Example: Ctrl-C loader> Step 3 Plug the USB drive containing the ACI image into the standby supervisor USB slot. Step 4 Boot the ACI image. Example: loader> boot usb#:aci-image-name Note If you have two USB drives, enter the **dir** command to see which drive contains the ACI image. Then specify either **usb1** or **usb2** in the **boot** command. Step 5 Log in to the switch as an administrator. Login: admin Step 6 Copy the ACI image from the USB drive to the switch. Example: switch# copy usb#:aci-image-name bootflash:aci-image-name

Converting Back to Cisco NX-OS

You can convert a Cisco Nexus 9000 Series switch from ACI boot mode back to Cisco NX-OS.

Note When converting any switch from ACI to NX-OS (standalone) boot mode, you can delete the ACI image from the bootflash to save space.

SUMMARY STEPS

- **1.** Reload the switch.
- 2. Enter a break sequence (Ctrl-C or Ctrl-]) during the initial boot sequence to access the loader> prompt.
- **3.** Configure the boot process to stop at the switch(boot)# prompt.
- 4. Boot the active supervisor module with the Cisco NX-OS image.
- **5.** Restores the switch's file system partitioning to the default settings. The bootflash filesystem is reset to Cisco NX-OS partitioning, and the Cisco NX-OS image is deleted.
- 6. Completes the upload of the Cisco NX-OS image file.
- 7. Recopy the Cisco NX-OS image into the bootflash: and set the appropriate boot variables to ensure that the system boots the Cisco NX-OS image on the next reload.
- 8. Wait for the system controllers to come up, which could take approximately 15–20 minutes.
- 9. Verify that the active supervisor module and the system controllers are in the active state.
- **10.** For dual-supervisor systems, follow Steps 3–6 on the standby supervisor.
- **11.** Log in to the switch and verify that it is running Cisco NX-OS software.

DETAILED STEPS

Procedure

Step 1	Reload the switch. Example: switch# reload
Step 2	Enter a break sequence (Ctrl-C or Ctrl-]) during the initial boot sequence to access the loader> prompt. Example: Ctrl-C loader>
Step 3	Configure the boot process to stop at the switch(boot)# prompt. Example:

loader> cmdline recoverymode=1

Step 4 Boot the active supervisor module with the Cisco NX-OS image.

Example:

loader> boot nxos.9.2.3.bin

Note If the Cisco NX-OS image that is mentioned in the boot variable is not present in the bootflash, the system falls back to the loader prompt during the boot sequence. To recover the switch from the loader prompt, boot the system through a different image present in the bootflash, perform a **tftpboot**, or boot through a USB device.

Note For some Cisco NX-OS releases and Cisco Nexus 9000 Series switches, the following error message appears:

!!Fatal error!! Can't reserve space for RPM repo Please free up bootflash space and reboot

If you see this error message, start over from Step 1. After Step 3, enter the **cmdline init_system** command and then go to Step 4. The switch boots into the normal Cisco NX-OS prompt and skips the switch(boot)# prompt.

Step 5 Restores the switch's file system partitioning to the default settings. The bootflash filesystem is reset to Cisco NX-OS partitioning, and the Cisco NX-OS image is deleted.

Example:

switch(boot) # init system

Step 6 Completes the upload of the Cisco NX-OS image file.

Example:

switch(boot) # load-nxos

- **Note** For some Cisco Nexus 9000 Series switches, the device does not load with the normal Cisco NX-OS prompt (switch#) and instead comes up as "bash-4.2#". In this case, you must power cycle the device, jump to loader, and boot the NX-OS image using either TFTP or a USB method.
 - For the TFTP method First assign an IP address and gateway to the device using the **set ip** *ip address subnet mask* and the **set gw** *gateway address* commands. This is required as the **init system** command in the above step erases all available configurations on the device

Example

```
loader> set ip 1.1.1.2 255.255.255.255.0
loader>set gw 1.1.1.1
```

Then use the **tftp** command to load the image.

loader> boot tftp://<tftp server ip>/<nxos-image-name>

• For the USB method - Mount the USB on the switch and execute the **dir** command on the loader to see the contents of the bootflash folder and the USB device.

Example

```
loader > dir
usb1::
lost+found
/nxos.9.x.y.bin
```

Then boot the NX-OS image using the following command:

```
loader> boot usb1:/nxos-image
Example: boot usb1:/nxos.9.x.y.bin
```

Once you boot the Cisco NX-OS image, the device loads as a Cisco NX-OS switch and you can continue with the remaining steps.

Step 7 Recopy the Cisco NX-OS image into the bootflash: and set the appropriate boot variables to ensure that the system boots the Cisco NX-OS image on the next reload.

Example:

TFTP example:

```
switch# copy tftp://tftp-server-ip/nxos-image-name bootflash:
switch# configure terminal
switch(config)# boot nxos bootflash:nxos-image-name
switch(config)# copy running-config startup-config
switch(config)# end
```

USB example:

```
switch# copy usb1:nxos-image-name bootflash:
switch# configure terminal
switch(config)# boot nxos bootflash:nxos-image-name
switch(config)# copy running-config startup-config
switch(config)# end
```

Step 8 Wait for the system controllers to come up, which could take approximately 15–20 minutes.

File system differences between ACI and Cisco NX-OS require one-time reformatting change during the ACI to Cisco NX-OS conversion. Subsequent reloads with the Cisco NX-OS image are faster.

Step 9 Verify that the active supervisor module and the system controllers are in the active state.

Example:

switch# show module

- **Step 10** For dual-supervisor systems, follow Steps 3–6 on the standby supervisor.
- **Step 11** Log in to the switch and verify that it is running Cisco NX-OS software.

Using SCP on the ACI Shell To Load Cisco NX-OS Image into Bootflash

If you have a Cisco Nexus 9000 Series Switch in ACI mode and must convert it to NX-OS mode but are unable to perform a TFTP boot and physical access to USB is not available, Secure Copy Protocol (SCP) can be used on the ACI Shell to load a Cisco NX-OS Image into the bootflash. As this requires root access, contact Cisco TAC for further information about the process.



Migrating Switches in a vPC Topology

This chapter describes how to migrate from one pair of switches to another in a vPC topology. It contains the following sections:

- vPC Forklift Upgrade, on page 99
- vPC Upgrade and Downgrade Procedure for Nexus 9000 -R series switches, on page 99

vPC Forklift Upgrade

In a vPC topology, you can migrate from a pair of Cisco Nexus 9000 Series switches to a different pair of Cisco Nexus 9000 Series switches. For example, you might migrate from a pair of Cisco Nexus 9508 vPC peer nodes to a pair of Cisco Nexus 9516 switches. For more information, see the "vPC Forklift Upgrade Scenario" section in the Cisco Nexus 9000 Series NX-OS Interfaces Configuration Guide .

vPC Upgrade and Downgrade Procedure for Nexus 9000 -R series switches

In vPC topologies, the two peer switches usually must be upgraded individually. An upgrade on one peer switch does not automatically update the vPC peer switch.

However, Cisco NX-OS Releases 7.0(3)F3(3c) and 7.0(3)F3(4) are not compatible with Cisco NX-OS Release 9.2(x) for vPC peer switches. Both vPC peers must be upgraded simultaneously to Cisco NX-OS Release 9.2(x) to avoid one switch running a 7.0(3)F3(x) release and the other switch running 9.2(x). Optionally, if the switches are being upgraded from Cisco NX-OS Release 7.0(3)F3(4), you can use the following procedure to minimize the traffic impact during upgrade.

Note This procedure not to be used on Broadcom or Cloudscale-based switches.

1. Switch A and B are running a Cisco NX-OS release. Switch A is the primary switch, and switch B is the secondary switch. Use the **copy r s** command on both switches.

```
primary_switch# show vpc role
vPC Role status
```

```
vPC role : primary
vPC system-mac : 00:23:04:ee:be:64
vPC system-priority : 32667
vPC local system-mac : 70:df:2f:eb:86:1f
vPC local role-priority : 90
vPC peer system-mac : 70:df:2f:eb:1c:ab
vPC peer role-priority : 100
primary_switch#
secondary_switch# show vpc role
vPC Role status
_____
vPC role : secondary
vPC system-mac : 00:23:04:ee:be:64
vPC system-priority : 32667
vPC local system-mac : 70:df:2f:eb:1c:ab
vPC local role-priority : 100
vPC peer system-mac : 70:df:2f:eb:86:1f
vPC peer role-priority : 90
secondary switch#
primary switch# copy r s v
Copy complete.
secondary_switch# copy r s v
Copy complete.
```

2. Bring down the peer link (PL) on the primary switch. The secondary switch brings down its vPC legs.

```
primary switch# conf t
Enter configuration commands, one per line. End with CNTL/Z.
primary switch(config) # int port-channel 100
primary switch(config-if) # shutdown
Reload the secondary switch with Release 9.2.1 image (change bootvar /reload)
secondary switch(config) # boot nxos nxos.9.2.1.bin
Performing image verification and compatibility check, please wait....
secondary switch(config)#
secondary switch(config) # copy r s v
Copy complete.
secondary_switch# reload
This command will reboot the system. (y/n)? [n] y
After reload
secondary switch# show vpc
Legend:
(*) - local vPC is down, forwarding via vPC peer-link
vPC domain id : 100
Peer status : peer link is down
vPC keep-alive status : peer is alive
Configuration consistency status : failed
Per-vlan consistency status : success
Configuration inconsistency reason: Consistency Check Not Performed
Type-2 inconsistency reason : Consistency Check Not Performed
```

```
vPC role : none established
Number of vPCs configured : 20
Peer Gateway : Enabled
Dual-active excluded VLANs : -
Graceful Consistency Check : Disabled (due to peer configuration)
Auto-recovery status : Disabled
Delay-restore status : Timer is off. (timeout = 90s)
Delay-restore SVI status : Timer is off. (timeout = 10s)
Operational Layer3 Peer-router : Disabled
vPC Peer-link status
 _____
id Port Status Active vlans
___ ____ _____
1 Po100 down -
secondary switch#
primary_switch(config-if) # show vpc
Legend:
(*) - local vPC is down, forwarding via vPC peer-link
vPC domain id : 100
Peer status : peer link is down
vPC keep-alive status : peer is alive
Configuration consistency status : success
Per-vlan consistency status : success
Type-2 consistency status : success
vPC role : primary
Number of vPCs configured : 20
Peer Gateway : Enabled
Peer gateway excluded VLANs : -
Dual-active excluded VLANs and BDs : -
Graceful Consistency Check : Enabled
Auto-recovery status : Enabled, timer is off.(timeout = 240s)
Operational Layer3 Peer-router : Disabled
vPC Peer-link status
_____
id Port Status Active vlans
1 Po100 down -
```

3. Configure vPC auto-recovery under the vPC domain on the secondary switch. Enable **vpc upgrade** (exec command).

```
secondary switch (config) # vpc domain 100
secondary switch (config-vpc-domain) # auto-recovery
secondary_switch(config-vpc-domain) # end
secondary switch# show running-config vpc
!Command: show running-config vpc
!Running configuration last done at: Wed May 16 06:34:10 2018
!Time: Wed May 16 06:34:14 2018
version 9.2(1) Bios:version 01.11
feature vpc
vpc domain 100
peer-switch
role priority 100
peer-keepalive destination 10.1.31.30 source 10.1.31.29
delay restore 90
peer-gateway
auto-recovery
ipv6 nd synchronize
ip arp synchronize
```

```
interface port-channel100
vpc peer-link
interface port-channel2001
vpc 101
secondary_switch# show vpc upgrade
vPC upgrade : TRUE
SVI Timer : 0
Delay Restore Timer : 0
Delay Orphan Port Timer : 0
secondary switch#
secondary switch# show vpc upgrade >> Hidden command
vPC upgrade : FALSE
SVI Timer : 10
Delay Restore Timer : 90
Delay Orphan Port Timer : 0
secondary_switch# vpc upgrade
                               >> Hidden command
```

4. After Layer 3 routes are learned on the secondary switch, reload the primary switch with the new release image. The secondary switch takes over the primary role and brings up its vPC legs in approximately 5 seconds.

```
primary_switch(config) # show boot
Current Boot Variables:
sup-1
NXOS variable = bootflash:/nxos.9.2.1.bin
No module boot variable set
Boot Variables on next reload:
sup-1
NXOS variable = bootflash:/nxos.9.2.1.bin
No module boot variable set
primary switch(config) # end
primary switch# show boot
Current Boot Variables:
sup-1
NXOS variable = bootflash:/nxos.9.2.1.bin
No module boot variable set
Boot Variables on next reload:
sup-1
NXOS variable = bootflash:/nxos.9.2.1.bin
No module boot variable set
primary switch# reload
This command will reboot the system. (y/n)? [n] y
secondary_switch# show vpc
Legend:
(*) - local vPC is down, forwarding via vPC peer-link
vPC domain id : 100
Peer status : peer link is down
vPC keep-alive status : peer is not reachable through peer-keepalive
Configuration consistency status : failed
Per-vlan consistency status : success
Configuration inconsistency reason: Consistency Check Not Performed
Type-2 inconsistency reason : Consistency Check Not Performed
vPC role : primary
```

5. When the primary switch comes back up, the peer link on it is operationally up.

```
primary switch# show vpc
Legend:
(*) - local vPC is down, forwarding via vPC peer-link
vPC domain id : 100
Peer status : peer adjacency formed ok
vPC keep-alive status : peer is alive
Configuration consistency status : success
Per-vlan consistency status : success
Type-2 consistency status : success
vPC role : primary, operational secondary
Number of vPCs configured : 20
Peer Gateway : Enabled
Dual-active excluded VLANs : -
Graceful Consistency Check : Enabled
Auto-recovery status : Disabled
Delay-restore status : Timer is off.(timeout = 90s)
Delay-restore SVI status : Timer is off. (timeout = 10s)
Operational Layer3 Peer-router : Disabled
vPC Peer-link status
   _____
id Port Status Active vlans
__ ____ _____
1 Po100 up 1,101-400
```

For downgrade, reload both switches at the same time.



INDEX

В

boot 94 boot aci bootflash 93

C

copp profile **13** copy **45, 50, 95** copy bootflash: **92**

D

delete bootflash **45, 50** dir bootflash **44, 50**

F

features scp-server 92

G

guestshell destroy 29

I

init system **96** install all nxos bootflash **47, 51**

L

load-nxos 96

Ν

no boot nxos 93

Ρ

ping 7 poweroff module 51, 91

R

reload 93-94

S

setup 13 show configuration session summary 7 show file bootflash 46, 93 show incompatibility nxos bootflash: 7 show incompatibility-all nxos bootflash 50 show install all impact epId 92 show install all impact nxos bootflash 46, 51 show install all status 48, 51 show module 92, 98 show version 48, 51, 92 INDEX

I