

طخلا تناق اطب نيب ةفاضتسال ةداعإ صيخارت MC3GX60V هجوملا يف uBR10012

تايوت حمل

[ةمدقملا](#)

[ةمدختسملا تانوكملا](#)

[تابلطتملا](#)

[ءارجلا](#)

[زاهجلا دامتعا تانايب يلعل لوصحلا: 1 ةوطخلا](#)

[صيخرتلا ةباوب يلعل صيخرتلا لقن بلط: 2 ةوطخلا](#)

[صيخرتلا لقن ردصم ددح 2.1 ةوطخلا](#)

[صيخرتلا لقن فده ددح 2.2 ةوطخلا](#)

[صيخرتلا لقنل نذاللا ةركذت عاشناب مق 2.3 ةوطخلا](#)

[LC ردصم يلعل صيخرتلا ءاغللا: 3 ةوطخلا](#)

[صيخرتلا ةباوب يلعل فدهلا LC ل ديدج صيخرت يلعل لوصحلا: 4 ةوطخلا](#)

[ةفاضتسال ةداعإ تامولعم لخدأ: 4.1 ةوطخلا](#)

[فدهلا LC ل صيخرت فلم عاشناب: 4.2 ةوطخلا](#)

[فدهلا LC يلعل ديدج صيخرت تيبتت: 5 ةوطخلا](#)

[CMTS يلعل صيخرتلا فلم خسنا: 5.1 ةوطخلا](#)

[فدهلا LC يلعل ديدج صيخرتلا تيبتت لبق يلعل صيخرتلا ءلاخ نم ققحت: 5.2 ةوطخلا](#)

[فدهلا LC يلعل ديدج صيخرت تيبتت: 5.3 ةوطخلا](#)

[تيبتتلا دعب صيخرتلا ءلاخ نم ققحت: 5.4 ةوطخلا](#)

ةمدقملا

نم DS x 2 US نيصيخرت لقن متهي، لانشملا اذه يف. uBR1002 نم (LC) طخ يتق اطب نيب صيخارتلا لقن ةيلمع، يرخأ ءرابعب وأ، ءفاضتسال ةداعإ ءارجإ دنيسملا اذه فصري
Cisco uBR- طخلا ءق اطب يلعل (16 × 60) يلعل لصلال يف يوتحت يتلا) 8/0 طخلا ءق اطب ءحتف يلعل (60 × 72) يلعل لصلال يف يوتحت يتلا) 8/1 طخلا ءق اطب ءحتف
MC3GX60V.

وال يذن أو غن اثرت يواشاد نواش: ءمهاسم

راهديرس راموك: زيرحت

ةمدختسملا تانوكملا

قطنلا عمساو لا يملعل Cisco uBR10012 Router هجوملا

طخلا تناق اطب MC3GC60V

تابلطتملا

عم باسح لوخد لچس [Cisco.com](https://www.cisco.com)

Cisco <https://slexui.cloudapps.cisco.com/SWIFT/LicensingUI/Quickstart#> صيخرت ءباوب يلعل لوصولا

ءارجلا

slot 8/0 ي، فدهلا قاطبلا اىلا slot 8/1 ي، ف ردهلا قاطبلا نم صيخرتلا ففاضتسا اداعاب قول عملتا تاوطلخا يلى امي

LC ردهلا قاطبلا صيخرتلا دامتعا تانايب ىلع لوصحلا: 1 قوطخلا

صيخرتلا قباوب ىلع صيخرتلا لقن بلط: 2 قوطخلا

LC ردهلا قاطبلا لاطبلا: 3 قوطخلا

صيخرتلا قباوب ىلع فدهلا LC ل ديدج صيخرت ىلع لوصحلا: 4 قوطخلا

فدهلا LC ىلع ديدج صيخرت تيبيشت: 5 قوطخلا

زاهجلا دامتعا تانايب ىلع لوصحلا: 1 قوطخلا

عبتملا ديزملا رمال مادختساب فلجلا تايوتحم ضرع لىكفمي. "81_cred.txt" انا ىلع disk0 اىلا LC 8/1 ب قاطبلا زاهجلا دامتعا تانايب ظفح ،ماندا حضورملا رموال مادختساب فلجلا مساب:

```
ubr10012-1#show license udi
```

SlotID	PID	SN	UDI
7/0	UBR-MC20X20V	CAT1441E0L2	UBR-MC20X20V:CAT1441E0L2
7/1	UBR-MC20X20V	CAT1441E0KH	UBR-MC20X20V:CAT1441E0KH
8/0	UBR-MC3GX60V	CAT1616E015	UBR-MC3GX60V:CAT1616E015

```
8/1 UBR-MC3GX60V CAT1435E0TZ UBR-MC3GX60V:CAT1435E0TZ ubr10012-1#license save credential
disk0:81_cred.txt subslot 8/1 Device credential saved ..... to disk0:81_cred.txt ubr10012-1#more
disk0:81_cred.txt <?xml version="1.0" encoding="UTF-8"?><CISCO_WT_ARTIFACTS
version="1.0"><CISCO_WT_REHOST_ARTIFACT version="1.0"><HEADER><ARTIFACT_TYPE>Device
Credentials</ARTIFACT_TYPE><ARTIFACT_VERSION>1.0</ARTIFACT_VERSION><TRANSACTION_ID>T and I trans
id</TRANSACTION_ID><UDI><PID>UBR-
MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Device</SOURCE><CREATE_DATE>2013-07-
04T13:25:25.307Z</CREATE_DATE><ARTIFACT_INFO>T and art
info</ARTIFACT_INFO></HEADER><CONTENT><DECIPHER_INFO
encoding="BASE64">AAEAAGAOAA4AhQEBgABlBM8UMnw+NzxyfVWqIFuiUq7aqRoKmf06/hOkQuoe706yxkteiCMZrEE592
0+SxD6TTEHBqlf9YHxgv6yguQ9hM+JXLASZRPh5i jSyTfHc0eATvmwltxEv17kMmI jpxMlZ7/tKd4AAAAAAAAAAAAAAAA
AAAAAAAAAAAAAAAAAA=</DECIPHER_INFO><CORE_DATA><CIPHER_DATA
encoding="BASE64">AAEAAGAPAA8DhAAPABAN/1bTrMxBGDHYqWuzbUD5rFvGVudf1BuINdnRKipAksB00Vs96Zw5U5tYt
xK0nixv1lz1UtTvJhxzyK2r+lHG1UcZhn4ZPLIYWcJTMSPqPANPeI6rE324hkaT+NveeQxfVAp+uGu3/CKesJbfa3x0qyqM
cevT2mUfC2aZY2lLbga9mv8dhNlSUTKN0uDGPChaHNw+VKXfLh0Y/rGurVb63UsRkoIglef5Iw5bDhMZ6y2RiJy+VR7LvBZ
MZialAouROg7XiRwFjqGOMsahKrKTF+aMFBNBdHiOgZAYP7QnaiKNwsFHnU0Wky1EzqbCByce6CBrMMWDWLE30z68j/5roX1
m2cUHYEJAmGUBmCHreBeEa44SHYQkTKQ1pv22l3nhKv4PZ5cL5JIQs6xZMY6mcNj1f0uuUXIKswWrRj7TOgnQJCSB+cP9POu
JIZ8cQrXopc1P+McA/TdNv9K0usJOnUJZVCC2ZvS2B6XaLdAGssGbL0W3dlqyKpcushbLZ6s1F7h0vuQ4N56pScxO+Pie4VF
rz4G1U9JfWgt/G1hF359yNtaBBikxml37A5uwoDT5cmfLpJLJ48kWSi/9qunQ2mvmxxgRI+tmY3SxQtcx2GgmiPGNVTX8W1
hheo1DMRiLNYxmfrMP9vK27rcpsS4fEN2bk0hkaPDMQDzx+/MsNS/38vSrHWkWRoe9xM0cAybyYJgX7jr4hYed0F0g6QD+9U
vm8Ski0UMbMCAAZJHZJcgaC8BGvhZvbnDVPBoHq1+8P1t129YSFCg8GfJ1XHamTqRB+kxZihVcRmD5eG6o70s2h/kt9oZteq
jMVraDEURxFY4SSr7Wym1Oa0e7WAP0rrCBUnMV18bkNW22Ju5OeytNGHvKz9mjDFeFqMzegHrQJSQeMQD0h+UrRlS9qzpls8
5FL1sb6J7S1HvGMFdkTq3ITuqcmxMdgukZLP3prfWYc5ZaMtZ256B/ZdGiNowePzbvaFwUAYwQsLYDBrPmT80Bfm4SVekA6
ZSyexnkJevGipqW0Qom9ATZqplm60Lfwl0NpNTBVvv3Izin8M7h4SnAsRq59Kw5E4RgsraIgyhtbDbEn6109MegKb/hwErF
l0541z4DSfPdWUeiBrGziv9/D9fiK6NZ2/v1vOePYZTRhZlUkOJPlZwi817qRKZtBcHLXonc95q01w==</CIPHER_DATA>
</CORE_DATA><SIGNATURE_INFO
encoding="BASE64">AAEAAGALAAAsAVAECAQnWYA7F1UKowplFYRGINxVef2ThwAAAAAAAAAAAAAAAAABImmNxd3wiI3ESvX6T
CYfl8ffm9kRCY+zaQAc3ley0iCVh5/4qa2t4Ns1is+icrxrw==</SIGNATURE_INFO></CONTENT></CISCO_WT_REHOST_A
RTIFACT></CISCO_WT_ARTIFACTS> ubr10012-1#
```

صيخرتلا قباوب ىلع صيخرتلا لقن بلط: 2 قوطخلا

داعا صيخرت" ديدحتل ">" قوف رقناو، "قزهجال" نم زاهجا ددحو، بيولا عقوم عدع <https://slexui.cloudapps.cisco.com/SWIFT/LicensingUI/Quickstart#> يلا لقتنا صيخرتلا لقن بطلوليجستلل (1 قوطخلا يف وه امك more ردال جارخا نم) زاهجا دامتعا تانايب وصلو "...فيضملا

Product License Registration

Help Settings

Show: All Licenses for Yuen Tak Lau

PAKs or Tokens Licenses Devices Transactions History

Get Licenses	Move Licenses	Add Devices	Download Licenses	Email Selected Licenses	Export to CSV	Show Filters
Device	Family	Features	Quantity			
<input type="checkbox"/>	UDI Product ID:UBR-MC3GX60V UDI Serial Number:	UBR MC20x20/3G60/PRE5/3GSPA	DS_License	123		
<input type="checkbox"/>	UDI Product ID:UBR-MC20X20V UDI Serial Number:	UBR MC20x20/3G60/PRE5/3GSPA	US_License	35		
<input type="checkbox"/>	UDI Product ID:UBR-MC20X20V UDI Serial Number:	UBR MC20x20/3G60/PRE5/3GSPA	US_License	20		
<input type="checkbox"/>	UDI Product ID:UBR-MC20X20V UDI Serial Number:	UBR MC20x20/3G60/PRE5/3GSPA	DS_License	20		
<input type="checkbox"/>	UDI Product ID:C891FW-E-K9 UDI Serial Number:	800 Fixed	DS_License	120	+1	
<input type="checkbox"/>	UDI Product ID:C891FW-E-K9 UDI Serial Number:	800 Fixed	MEM-8XX-512U1GB	1		
<input type="checkbox"/>	UDI Product ID:C891FW-E-K9 UDI Serial Number:	800 Fixed	advipservices	1		

كعب صاخلا CCO فيرعت فلم يلا زاهجا فضاو "قزهجا ففاضلا" رقنا CCO فيرعت فلم يف زاهجا يرت نكت مل اذا

Initiate a Rehost

On this page, you can transfer specific licenses from one device to another that were previously registered with your Cisco.com profile or by others in your organization.
How do I ...

- Specify License Source
- Specify Target & Options
- Review

Source Device Selection

Next

Transactions

Licenses

search n

1 UBR-MC3GX60V CAT143

1.1

2 UBR-MC20X20V CAT143

2.1

Next

Select the product type

Credentials:

```

/hwErFI054Iz4DSfPdWUeiBrGziv9/D9fK6NZ2
/v1vOePYZTRehZiUkOJPleZWf8I7qRKZiBcHLXonc95qO1w==</CIPHER_DATA>
</CORE_DATA><SIGNATURE_INFO
encoding="BASE64">AAEAAgALAAAsAVAECAQnWYWA7F1UKowpIFYRGInxVEf2ThwAA
AAAAAAAAAAAAABImmNxd3wI3ESvX6TCYfi8ffm9kRCY+zaQAc3leY0iCVh5/4qa2t4Ns1i
S+icrww==</SIGNATURE_INFO></CONTENT></CISCO_WT_REHOST_ARTIFACT>
</CISCO_WT_ARTIFACTS>

```


OK Cancel

بيولا ةحفص يف نرتقملا صيخرتلا يرتس، زاهجا ففاضلا دعب

صيخرتلا لقن ردصم ددح 2.1 قوطخلا

ملقن ديوت يذلا صيخرتلا ددح

2. قوطخلا يف اهيلع تلمص يذلا زاهجا دامتعا تانايبب صنلا عبرم الم

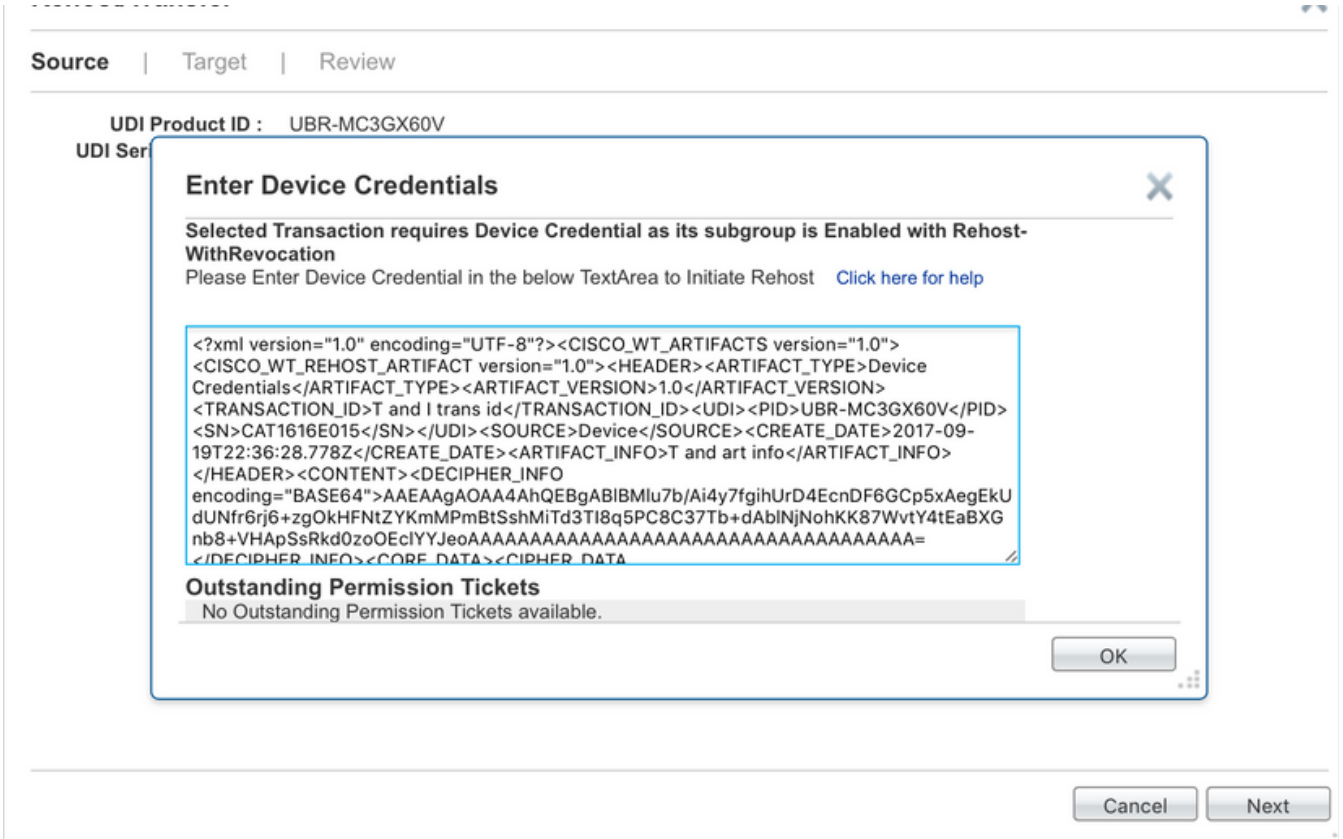


"يلائمها" قوف رون

صخيخرتلا لقن فده ددح 2.2 قوطخلا

ردصلما طخلا قواطب نم اهلون ديوت يتلا صخيخرتلا دادعأ ةيبعتب مق، "انبيعت دارملا ةيملكلا" يف.

صخيخرتلا يقبستس لقنلا دعب 8/0 ةيخرفلا ءحتفلا ىلا DSx2US صخيخرت لقن ب موونس 8/1 ةيخرفلا ءحتفلل صخيخرت 72DSX60US لكاه، لاشملا اذه يف 70DSx58US ةيخرفلا ءحتفلا ىلا 8/1.

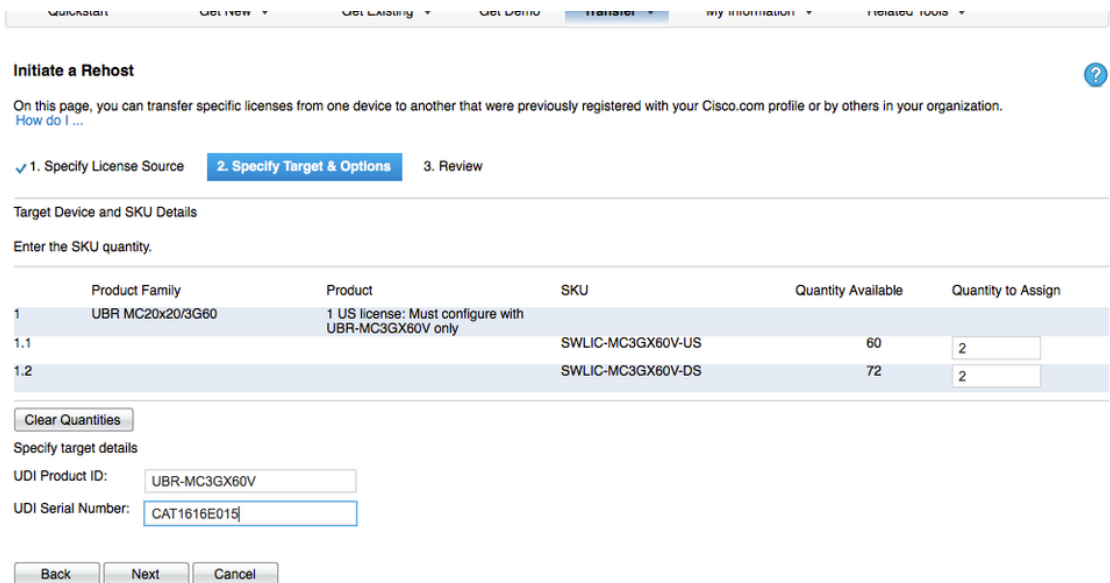

"يلائمها" قوف رون

صيخرتلا لقنل نذال قركنت ءاشناب مق 2.3 قوطخلا

Initiate a Rehost

On this page, you can transfer specific licenses from one device to another that were previously registered with your Cisco.com profile or by others in your organization. [How do I ...](#)

✓ 1. Specify License Source ✓ 2. Specify Target & Options **3. Review**

	Serial Number	Product ID
1 Source	CAT1435E0TZ	UBR-MC3GX60V
Target	CAT1616E015	UBR-MC3GX60V

	SKU Name	Quantity
1.1	SWLIC-MC3GX60V-DS	2
1.2	SWLIC-MC3GX60V-US	2

Your License Key will be emailed within the hour to these email addresses and connected with the specified end user.

* Send To:

* End User:

* License Agreement: I agree with the Terms of the License [View License Agreement...](#)

ينورتكفلا لاندريب ناو نع ىلا ينورتكفلا لاندريب لاسرا متهي. "لاسرا" رزلا قوف رنقلا دعب نذال قنك رادصا متهي.

تفوتتم ىرخا ءليسوي وا TFTP مادختساب CMTS ىلا، ينورتكفلا لاندريب نم، نذال قركنت صيخرت فلم خسن:

```
ubr10012-1#copy tftp://10.66.94.155/CAT1435E0TZ_20130704171351238.lic disk0:
```

```
Destination filename [CAT1435E0TZ_20130704171351238.lic]?
```

```
Accessing tftp://10.66.94.155/CAT1435E0TZ_20130704171351238.lic...
```

```
Loading CAT1435E0TZ_20130704171351238.lic from 10.66.94.155 (via GigabitEthernet1/1/0): !
```

```
[OK - 8872 bytes]
```

LC رصم ىلع صيخرتلا ءاغل: 3 قوطخلا

Cisco IOS رماوا مادختساب فيضمالا ءداع ءيلمع ءدبل مده تانوذال قركنت مدختسا

"صيخرتلا لاطبلا" رمال مادختساب رصملا زاهجلا ىلع تانوذال قركنت قيبطت.

لقنل فاك تقوب جامرلل زاهجلا ىلع اموي 60 امتدم جامس قرتغل صيخرت تيبثت اضي متهي. ءاغللا ىلع ليلد ىلا ريشت فيضم ءداع قركنت رصملا زاهجلا رفوي لىذ دعب ههجولا زاهجلا ىلا صيخرتلا.

فدطلل ديدجلا صيخرتلا فلم ءاشنال فيضمالا ءداع قركنت مادختسا متهي.

فضاضتسالا ءداع قركنت ىلع لوصحلل ءالعل رولكذملا "صيخرتلا ءاغل" ءارج راركت كنكمي، (ءلاجل مده يف "disk0:rt") فضاضتسالا ءداع قركنت دقف ءلاخ يف.

```
ubr10012-1#license revoke disk0:CAT1435E0TZ_20130704171351238.lic disk0:rt Following Permanent license(s) will be revoked from this device Feature Name: DS_License : Count = 72 Feature Name: US_License : Count = 60 Following Permanent license(s) will be installed on this device Feature Name: US_License : Count = 58 Feature Name: DS_License : Count = 70 Following Extension license(s) will be installed on this device Feature Name: US_License : Count = 60 Feature Name: DS_License : Count = 72 PLEASE READ THE FOLLOWING TERMS CAREFULLY. INSTALLING THE LICENSE OR LICENSE KEY PROVIDED FOR ANY CISCO PRODUCT FEATURE OR USING SUCH PRODUCT FEATURE CONSTITUTES YOUR FULL ACCEPTANCE OF THE FOLLOWING TERMS. YOU MUST NOT PROCEED FURTHER IF YOU ARE NOT WILLING TO BE BOUND BY ALL THE TERMS SET FORTH HEREIN. You hereby acknowledge and agree that the product
```

feature license is terminable and that the product feature enabled by such license may be shut down or terminated by Cisco after expiration of the applicable term of the license (e.g., 30-day trial period). Cisco reserves the right to terminate or shut down any such product feature electronically or by any other means available. While alerts or such messages may be provided, it is your sole responsibility to monitor your terminable usage of any product feature enabled by the license and to ensure that your systems and networks are prepared for the shut down of the product feature. You acknowledge and agree that Cisco will not have any liability whatsoever for any damages, including, but not limited to, direct, indirect, special, or consequential damages related to any product feature being shutdown or terminated. By clicking the "accept" button or typing "yes" you are indicating you have read and agree to be bound by all the terms provided herein. ACCEPT? (yes/[no]): yes Rehost ticket saved to disk0:rt ubr10012-1#show license detail subslot 8/1 Index: 1 Feature: DS_License Version: 1.0 License Type: Evaluation License State: Active, In Use Evaluation total period: 8 weeks 4 days Evaluation period left: 8 weeks 3 days Expiry date: Sep 02 2013 06:41:34 License Count: 72/72/0 (Active/In-use/Violation) License Priority: High Store Index: 3 Store Name: Primary License Storage Index: 2 Feature: DS_License Version: 1.0 License Type: Permanent License State: Inactive License Count: 70/0/0 (Active/In-use/Violation) License Priority: Medium Store Index: 1 Store Name: Primary License Storage Index: 3 Feature: DS_License Version: 1.0 License Type: Evaluation License State: Inactive Evaluation total period: 8 weeks 4 days Evaluation period left: 1 week 2 days License Count: 72/0/0 (Active/In-use/Violation) License Priority: Low Store Index: 1 Store Name: Evaluation License Storage Index: 4 Feature: US_License Version: 1.0 License Type: Evaluation License State: Active, In Use --More-- % RPC failed to slot 17 Evaluation total period: 4 days Evaluation period left: 8 weeks 3 days Expiry date: Sep 02 2013 06:46:34 License Count: 60/60/0 (Active/In-use/Violation) License Priority: High Store Index: 2 Store Name: Primary License Storage Index: 5 Feature: US_License Version: 1.0 License Type: Permanent License State: Inactive License Count: 58/0/0 (Active/In-use/Violation) License Priority: Medium Store Index: 0 Store Name: Primary License Storage Index: 6 Feature: US_License Version: 1.0 License Type: Evaluation License State: Inactive Evaluation total period: 8 weeks 4 days Evaluation period left: 8 weeks 4 days License Count: 60/0/0 (Active/In-use/Violation) License Priority: Low Store Index: 0 Store Name: Evaluation License Storage ubr10012-1#

صيخرتلا قباوب ولع فدهلا LC ل دي دج صيخرت ولع لوصحلا: 4 قوطخلا

ىلا عجرا .ةهوجل زاوجل UDI ولع ففاضلالاب "....قنمآلا ففاضتسال اداع لامكإ > صيخرتلا لؤن > قزهجال" رايختاب صيخرتلا لؤن لخدم ةادأ يف ففاضتسال اداع قرفذت لخدأ فيلاتلا قروصل:

PAKs or Tokens	Licenses	Devices	Transactions History
Get Licenses ▼	Move Licenses ▼	Add Devices	Download Licenses
<input type="checkbox"/>	Device	Rehost selected licenses...	nily
<input type="checkbox"/>	UDI Serial	Rehost from failed device(RMA)...	GW-10 DS384
	UDI Product	Complete secure rehost...	
		Share licenses... >	

فبفضملا اداع قرفذت نم صنلا جارختسا

```
ubr10012-1#more disk0:rt <?xml version="1.0" encoding="UTF-8"?><CISCO_WT_ARTIFACTS
version="1.0"><CISCO_WT_REHOST_ARTIFACT version="1.0"><HEADER><ARTIFACT_TYPE>Rehost
Artifact</ARTIFACT_TYPE><ARTIFACT_VERSION>1.0</ARTIFACT_VERSION><TRANSACTION_ID>00DD93AAAC</TRAN
SACTION_ID><UDI><PID>UBR-
MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Device</SOURCE><CREATE_DATE>2013-07-
04T13:41:34.151Z</CREATE_DATE><CISCO_REHOST_CHANGES><CISCO_REHOST_ADD><CISCO_WT_LICENSE
```


version="1.0"><FEATURE_NAME>US_License</FEATURE_NAME><FEATURE_VERSION>1.0</FEATURE_VERSION><UDI>
<PID>UBR-MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Cisco HQ</SOURCE><CREATE_DATE>2013-07-
05T00:13:44.000Z</CREATE_DATE><LICENSE_LINE_HASH
hashAlgo="SHA1">v/mLxNULGRGMruR/vu09b2IRd2w=</LICENSE_LINE_HASH><TYPE>EXTENSION</TYPE><EXPIRATIO
N><DAYS>60</DAYS></EXPIRATION><EULA>YES</EULA><COUNT>60</COUNT></CISCO_WT_LICENSE></CISCO_REHOST
_ADD><CISCO_REHOST_ADD><CISCO_WT_LICENSE
version="1.0"><FEATURE_NAME>DS_License</FEATURE_NAME><FEATURE_VERSION>1.0</FEATURE_VERSION><UDI>
<PID>UBR-MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Cisco HQ</SOURCE><CREATE_DATE>2013-07-
05T00:13:44.000Z</CREATE_DATE><LICENSE_LINE_HASH
hashAlgo="SHA1">vXiItxKb5jUhxKsJvOsdobszcyg=</LICENSE_LINE_HASH><TYPE>EXTENSION</TYPE><EXPIRATIO
N><DAYS>60</DAYS></EXPIRATION><EULA>YES</EULA><COUNT>72</COUNT></CISCO_WT_LICENSE></CISCO_REHOST
_ADD><CISCO_REHOST_REMOVE><CISCO_WT_LICENSE
version="1.0"><FEATURE_NAME>DS_License</FEATURE_NAME><FEATURE_VERSION>1.0</FEATURE_VERSION><UDI>
<PID>UBR-MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Cisco HQ</SOURCE><CREATE_DATE>2010-11-
25T07:51:48.000Z</CREATE_DATE><LICENSE_LINE_HASH
hashAlgo="SHA1">GG9Lxrd1VJd0ihBN8FxbiV+y4f0=</LICENSE_LINE_HASH><TYPE>PERMANENT</TYPE><COUNT>72<
/COUNT></CISCO_WT_LICENSE></CISCO_REHOST_REMOVE><CISCO_REHOST_REMOVE><CISCO_WT_LICENSE
version="1.0"><FEATURE_NAME>US_License</FEATURE_NAME><FEATURE_VERSION>1.0</FEATURE_VERSION><UDI>
<PID>UBR-MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Cisco HQ</SOURCE><CREATE_DATE>2010-11-
25T07:52:01.000Z</CREATE_DATE><LICENSE_LINE_HASH
hashAlgo="SHA1">djuYPaGEO/YcP/jdZdLBIpERW8=</LICENSE_LINE_HASH><TYPE>PERMANENT</TYPE><COUNT>60<
/COUNT></CISCO_WT_LICENSE></CISCO_REHOST_REMOVE><CISCO_REHOST_ADD><CISCO_WT_LICENSE
version="1.0"><FEATURE_NAME>US_License</FEATURE_NAME><FEATURE_VERSION>1.0</FEATURE_VERSION><UDI>
<PID>UBR-MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Cisco HQ</SOURCE><CREATE_DATE>2013-07-
05T00:13:44.000Z</CREATE_DATE><LICENSE_LINE_HASH
hashAlgo="SHA1">Z16GLxkzY5soZX+lff80dXud70Q=</LICENSE_LINE_HASH><TYPE>PERMANENT</TYPE><COUNT>58<
/COUNT></CISCO_WT_LICENSE></CISCO_REHOST_ADD><CISCO_REHOST_ADD><CISCO_WT_LICENSE
version="1.0"><FEATURE_NAME>DS_License</FEATURE_NAME><FEATURE_VERSION>1.0</FEATURE_VERSION><UDI>
<PID>UBR-MC3GX60V</PID><SN>CAT1435E0TZ</SN></UDI><SOURCE>Cisco HQ</SOURCE><CREATE_DATE>2013-07-
05T00:13:44.000Z</CREATE_DATE><LICENSE_LINE_HASH
hashAlgo="SHA1">/6XdchgOaVgYv9HFcDUtsuzqMDY=</LICENSE_LINE_HASH><TYPE>PERMANENT</TYPE><COUNT>70<
/COUNT></CISCO_WT_LICENSE></CISCO_REHOST_ADD></CISCO_REHOST_CHANGES></HEADER><CONTENT><DECIPHER_
INFO
encoding="BASE64">AAEAAGAOAA4AhQEBgABlBmH/Q5r7IwMdRbAS/JAFyDQEKGwQkgLtrFwFdZa1cKxv3eZF/WVGvcBUBc
WkYMB5ULk/RAA0BkVdecbCoHbpe2LNaTVbI1zBAKW/B6iPNqIwIbGzfUTNsFkV3hKtVPBayWiG4boAAAAAAAAAAAAAAAAA
AAAAAAAAAAAAAAAAA=</DECIPHER_INFO><CORE_DATA><CIPHER_DATA
encoding="BASE64">AAEAAGAPAA8RtAAPABAanu6WfSp4fjmEfsILXTPN3nG/7QCtE2Saa+L9N3qAiqCF5QTlorKYqN8NTk
BZnYdSoDs003+n0Ek9c5kzTzxnbtK2Qw+qtbtAgS4L5ZwgM1WC5v8+muTuyAFefMglgXuG6rsoosn+7vkvaf02Au2I+wLvvg
Tl9BYVMxrZixyk+aZYWL32z6GHF2P013xXLQk+nPovyB9Hy7/o8xBaVDZ+zYb2hUIB8osfvyqyJP0S4u9V4UWr22z2Vx1s
+GBw528i/tf3xB1+c3DtAWQfcAaPk5WPuB+KEYbJvhs/uSXqxWaQpDKxvQow5Im5+js4od5/Whtk0cq+OBLEXDGG7eubr+ra
azeP+7ULUN+zSY5yCNOe0wfJv1c4n/bQaAAX8a38+KzKndJL8cI7LkyUgNxiv1KugcaQYjaDstiWxanQ7ok87eVNMCTsck2Gq
Uxfow4n1KWYDTW6ZOA3LzXwF+9uJZNzSTifbFrwE5r1slynPGbtLD0AmHpfKPAzTuXadjrJoMLNwc+w52TK25dHhrRqWn4Pc
fwj5ce0hovPa6+XtsiTP+x/63xRf+OBi5iihoCBAUm+mhn6xy2uhHDIiPK1AeY/no7E6Cyh7QS9gP9wFyGyBJVq7n7qmGJG
ctdDZkTl9Q34RUDycvvrtrQnyf3nbOL3Nox5PxY7zomxP2LldJ7A3+EsXFE06aw/c4Y9Ggb1gl1Gfb6IAM9/HZwZh4fYWWvC
LoZDl1lCiBTVWlFwIGX49WTZqp9A//EMyOxcmEbbPEBIyifID19fRvJecVK8q39MsDY+V1R/li12idGFJtiU1hLUQnoPYRip
fpdSo4P5T+QxT6GIBSstXy55D1WLtEalcw18o9h6XLlnUySTMZBmHMH1MzevOgKRTaxJfMlHbTKiU11NboVdbUKclc0PPEy
ely9XX19Z0LlTYNazAe4wbnxouDbsQ99WuxYpPr8TRd+ab8vKX3DUFxu+pyznPVzcymLtlkw2ZtsFzk4VjqU3xHBaZhhz2R
bdQckwlnkBB9+9e4eZ6wVOC29pVZBrBA8mh6Bt7H3dwj1LJNmpdegeZTgnr7+dHbATppbVeFfZe06wJ1jmM/EzRs/7/1mA01
uXUd6WUSjsyzUTIEyFtMVwfb1un9uyMzoSzQbCerCz3vHQdi/dy8iQbXwGyJPKhjHhbBjiKN6+plUXHzRGvr0r09v/kIdTLn
fkBFgXPOoCRIUmbUZ/ULimzibTf0PfqwQ98r42dQwXgN4UPybKoR6/pQcPX287GVsB/5zpIvWR9544B+1Dvo+cCeuVA/60W
J3UFvqoCA9YNM6b+B6A4mZvBT78S+j+r+prNfMBzhnyD9OyOOpY5JocOEJfkdMSvDT78G+acfeqzRm76Ny4N4YbKVI4kUA06
PS0fQrsvK1hHUAu00yluVnqaD3OX/SH8C97HCN1hmXUydz9ZfabAq49jairvba7fLHyHFY56RaQUhjck08v70CXyy+3zVWF9
Ce6YmAAjeTqVIE4Q6hZqXQbvLOUbl+YHoSVaUIfQ3LaJDi9phIrDlfpL9bYaCDDDCgarbj8Xh/CT+6qit1bXikoVSMlJ/xHD
EP9FFbL9oQQ0U90I4J6Hqcn/f0SD4wjiS86Rz6+EE6kNNG00FhVxQZQsZfABsHy6PFXF4sH2lr333ILEiAxLypwUiANfkTU
ulf94rpdMKubQbPtjah1BnS1tCka3ANK5XomDcmJ379K119zHs+s4B+I6/Dbb4kvZKUA++UPyzu/AxhlXOXGodRI419lvjtD
+rr3/kIJo0FkX3b1sx5qIdxgNsZmAG3ijUIxcMQmEnsJ7+/1zV7GCGfM900E29BFqCvLzat0MKRKPu2aWM+LpOXvr9ybwjn0
Y4hIDR/3tnAYFo85ZAHtDOOdyEHMaqx38fZuFHQ0vGKA+XZzhZy2qDG1SsAzN39V1DsDThkbgm5hM9seUHLvWin9QEsFzpe
bI6ENWIEz8vhlYwtfJZ5v/8KeBydSeTvYr9lr0+02zSNfdrMmguldG104ZQ60358AnR7EBtN57WAYCrNJswyFySKSKQtHiZh
KVLXMxiboxDwJcVquT8sLjk60iRtPtoboTRVHNCDBTardMonhHiy5ZY6DIKhg7DN/1noOAPwNY8K4BZhtPyzb3P9BGg+tAiyt
Tzm0ulz/ktAweled7IU311RvS7wR3Wvxh7WTwiQG8e4fj+FioTz90XBnBabl+7V53KHbcgXRC4w3wJmH804Gwe2UDVuyARFE
6uSbeZvf3FQitViC03h/gnGcvWtV6ghsOzwm7spxz2VNORK1KZRn+FmDPrTPBJeu6YN+VAFXVc27fJ/10phJiRdomUW/VJgG
YGXZxC0wAZOm9Mdht4W/nSsupcZQROiOB4EPP06jnj6Ij5iNowSjGDFQ0rIz9wTe06qvI33uunyq/jih8+g7qqwpzXncc70
gQ2hAO2Kynp4GjX5aUALbxs00diMjT2JUAH2aMoi7ZAqE9izk8WYpEzWdsD1GALfIedJEfQvUDFFewZDxEA4+JxhHT0ybuK
j8KCZKMT0jhIOG6UgMUR0rwlo/YAC3RSjVDCYieW2MpirnFJDS5TbQ6ua8YbVpdJn+b4wTfsl29fv/mSPj3mZQCsF9k7M+

72Jy2b29Bqz/G0ZJB6+7+hXQRYVzB8XciS9bnPBWmt3JSKugotK65dqUTVoE9c+kPkmZ/hAUkST6FukqiZRE4mJYmgbJJyXM
YcHJkv5HrUaJ8xfE8+gJT4OgBhaV2X6W2Yl22vVeV+epGPxU8VzBdQcltDoE6TU5YPqV8Pb7J/Z7KHF+QkcClq9lZKCV7ob
9H4xvuBKsSGHs0HKI3/gzgrkM8fvaxWDC3RJK7C1iqd84Yl7DxToCSmaFWymKaoRvK+iYxs1E6k4FdKrVobLvdIm+jZTcfuW
BD389nBuGmiDfVwIf5/DPuTJpXbppPrCjCZzwwUJF1K+ZjNjO9HLonYomtP49T45+0uFBfd8w63rgTtx39N3iteJkEievSR
hkyB4ziL/gl6oB9ssb/OYEMJoc+BIjuxLExyIonl4qN/xlB2Vm7AcfH6uOagaT/qTm+xsEe5OZDivuv4cr2zKdbQUiVXky1k
bfZGJdOR41kh2eOeWYMKbHI9UipZ3mEgknBm+ZE6AUwYlRbZP3JrxUfNoXI73zIkCVZidzBYPVEKcBHxTRWnbXXqzx4kKn0
TOigchAdyOhgfsE1sgWDCtRBreXHP3qt5syFSA7pydhTspK3BLMiWSuRzW9uH0bMJF8LURvnJD4hI1D1hLmFP4TDOv5bo2Mj
CgQmUSKaMfBulXdB/OVawWrmdqXU/W4JIQUt96JNIC14BIZXtM2e8zWaziw4g83F8ND7v3fIFrvaReQL7K7Q+pZn7BbIPNG6
A5pMSJ79zChz+Da8JxZ5hxPhxjzt+SpXZ3Tz0SLP49B6WL6dtiOcbIh854eKEDQRHwtDUMMtayfdIBsureERzmUDLXHT73V
/+PIFMEkxwv6dDsr81qbsOyMT47DcCrcJwEvxxWDS2Px3OyuzA79Feps1vmKoudhm8Ik4zXuJfbDNdf00uV/P001EQASUiuT
pllm/1/YQ/3fdOnxtm823/n+FXksa4GX0ji+9qr7GmsEDo/sxPql0p4Ha+epmoYmiTKAJW7i9r+XLMTdpMXKriVgKIx6qydB
C5TGcKomeaAKVULkvHvCF801/NyUdaSVg2cMcm7wWWarOrwHcjF7Wy/KccbXOcgirYjgzXlU2REza+RRln+xy802IQDDaNBk
7ED6W1Dy9MKPknJc6vTJ+kf1bap0ag+CmOGdGsgWJVRIMEk7UBJagChpP+eLPTmk6s7du9WLMVegBRMqIttqHhVodZt01J
Q1HGZfDvrGndd0V4kqDB0p28C0Y+Jci/V09waVfWHXsowL0hFXerFRYNNRvToXIdXug3uwKgVsl7QIKdWz3cKDbOCbbzR0V1
/YdewkOBWYbqxZ6dIeGCKmYnXk2KJhkxz1QkkEw5JLvpYIPcR70iLVWr/nEH+CtWCG0fRiWVRPDFuCXU2Hrmq7hBv2c9+Fi6
V2TmWXHxrMBS3CflzTo06V1bLOpt1G75b76D/ntzaCbco30/UtGkRvOZhj3pwUd/oj4exSQ9SJrpashlYmGL9nAVzOMOoI3
p34LOyL3Y165zEEDuGQcsVd0ESxHf+81+7PwsY96+p5V70+vi10Jp4ia0BOgtDb2gic/gpxeKqCIyK6qaRwJ6kIJRoFuaoVb
xBiZlU4Xmb818bMm/zQDonWOZFHvjYukuqKdnbf20o2CY+Sf6HV3IMcrTOMLL9xdeJbHJZHC7Y/PU7w4JOT6boDHFHV5Y
q2je90Dn5HzU/3wrXpvmLwbixVSDhphcdCEvKE8zUZuM0YHnn5uGn0YECiiQX4r2i7dBy7elocqeMFEMQLVoOS0jt0tZgO/
Is/J8hXJHv8xkRCszVUYJBTRDb22vmpv5rbR805KQ8sBfxvILHbXQaj8Clu9Th6nRKbcEqGsDR1BQ941m4/aMyZe891tqe1l
uuJuIs7qXf00GKTBl+SliWw0kzI5z8vRobFTNGzifO/7qRCjad2+xf3dyR4zswJ28GZcUee1ni3DWX/devKhpI4F1a+fTv1
EquDrkrYZdTAaxvGBjJqWPZCKK/32X1GTlWcBv9xNqSHY31VME02FFWg1k/519RK5WAvB00a0oii7QYXiUQ3S5Znp2YUvRy
e7jGq12zhixzorOD9W1DzGrVLjPfmWlaQ/hhv3SnCLrJ/Z45FLYJzWk6lQDGRan21d6MYnUgzwX033+Zx4K159WgoGapGEfo
Qn56eolqE5ehaPCCWX09pJt1gTjtRR8e47iEX/fZ7rkYUfWxqBlBYyGP14WTMv1Q7N3VqyT6UIYj2Y028/SCUDKlhhKqPRi
wvJo3Hnb3jIokILNZnefu5tjFpU5quPV6Y2C1e1LfgUoHUIHTW/ap5Xlsbiu3uL1/QpmmFPmFeJjJ3axOAYVo0s7pRmIWRo9
EvVy7LFEELHnZoSyR2jIV1vx0wCCwB/tLPDDi9twcOERdoMM+WFPCAZZEeBI7LfzZYT6DjCmGbdg2C2wdoVNqENIT2P61nV
zQIJTEJf1KtV7rVWHBaS9CesJxlXlnc1mJU6+lgFm9+a8QhEQvYx/4U4B54EYiXH2P3dxNhbzemdROI1uMjM3mF0ZK9zbWn
PTuEN87JTrQ1+UwXHKsA/zPGROGjmcDyQIDeVm76HUDkgm7oQ0c4qD88LNKzc0UbkzwbJwTp9xymawjX9AnUe3hOQR1WVN
Lm9D6p4db5JSasUwBuxbB8obn/YLwB1Fi03bVO/tWSEdy/BWG9w6N2NcX4P+I1mmV9tOYOQv741VbuC9YufbNyOzaFWY6qt
exCODtmNbvUFIpcYznUbAYWeHzUbgwzAb1EtW6LPwKYpElkRsorXWL4p72NDK49w5kfBsYGwRd5C+/iJvzF9nnh5mBd5bg51
ZTDiNB/aLd1M7QnkzAKI+42h1wWqBR/nmTfON9cPQY4U8VepkliI2BHoZMW5IeQaRh1D1n0EpIa7hp/yl0Hln1eRJaBxo2Nz
CY8bQN61KVfXM+3/XC8D/M8bYn4zybUf3NmbQy+ES7p/AwRbwhdEhc3biHpKm0TdAdJalkzaH8rOadqsenLWuWXVnHzIWgWb
uuUca5hTWfeAz0CuJAZDme+ETTSihYcfBIZcoMuKfrJvqMdRRLId6w/1LYCCuAogxNTXzDYqjd79uJjNn/n5Mn/D7jOztWd+
5POtDC7g11qh64zok+hKfropP2fuzU9wUkZqahjMG7/A5/IVGhn7y5k6MLx5IZDYRkKxZyV0lhoGEOjIpmDowkymZVml2kL
HQOrmmEE+y0TMwu74YyDapxCqguA3MckE6i/PGtpIW9+JhKTW8tgMr7Irv1SsdLIIiO2UVpa0aadEbnAtZP3y2i9YHCTbuJ
8kuBlw8t4mJMYe/ayR8EOw1+90</CIPHER_DATA></CORE_DATA><SIGNATURE_INFO
encoding="BASE64">AAEAAgALAAAsAVAECAQlAYiZn2o1/b/XEYyF3681aOv/kIQAAAAAAAAAAAAAAAAAE/cnMwLdddnDg807K
ZDqj7n5UvftxqDacwXmHnecgM3yfHlctTmyWC01Cdm9Mtt8g==</SIGNATURE_INFO></CONTENT></CISCO_WT_REHOST_A
RTIFACT></CISCO_WT_ARTIFACTS> ubr10012-1#

ةفاضتسالا ةداعإ تامولعم لخدأ :4.1 ةوطخلا

جتنملا عون: "SafeNet"

حفدلا جتنملا فرععم: <UDI جتنم فرععم>

ل يلسلسنلا مقرلا <UDI: <Target SN>

هالغأ وه امك فيضنملا ةداعإ ةرفذنت نم جرختسمل صرنلا لخدأ "فيضنملا ةداعإ ةرفذنت" لوقحلا يف.

"يلانلا" قوف رونانث

Complete Secure Rehost/Transfer



1. Enter Rehost Ticket/Key | 2. Review

Select the Product Type:

Safenet

Enter a Rehost Ticket required to generate the license for the new device.

* UDI Product ID:

* UDI Serial Number:

* Rehost Ticket:

```
<?xml version="1.0" encoding="UTF-8"?><CISCO_WT_ARTIFACTS
version="1.0"><CISCO_WT_REHOST_ARTIFACT version="1.0">
<HEADER><ARTIFACT_TYPE>Device
Credentials</ARTIFACT_TYPE>
<ARTIFACT_VERSION>1.0</ARTIFACT_VERSION>
<TRANSACTION_ID>T and I trans id</TRANSACTION_ID><UDI>
```

Cancel

Next

فدەلە LC ل ص ي خرت فلم ءاشن: 4.2 قوطلال

يئورتكفالال ديريبلال ربع ص ي خرت فلم يقلتت فوس. "ص ي خرت علع لوصحلا" قوف رونا

Upload Rehost Ticket to Finish Rehost

Use this page to complete the final step of the secure license transfer process. [How do I ...](#)



✓ 1. Enter Rehost Ticket/Key

2. Review

	Serial Number	Product ID
1 Source	CAT1435E0TZ	UBR-MC3GX60V
Target	CAT1616E015	UBR-MC3GX60V

SKU	Quantity	More Information	Feature
1.1 SWLIC-MC3GX60V-DS	2	1 DS license: Must configure with UBR-MC3GX60V only	DS_License
1.2 SWLIC-MC3GX60V-US	2	1 US license: Must configure with UBR-MC3GX60V only	US_License

Your License Key will be emailed within the hour to these email addresses and connected with the specified end user.

*Send To:

daszhang@cisco.com



*End User:

Zhang, Dashuai



*License Agreement:

I agree with the Terms of the License

[View License Agreement...](#)

Back

Get License

Cancel

فدهال LC ىلع ديدج صيخرت تيبتت : 5 ةوطخلال

CMTS ىل صيخرتال فلم خسنال : 5.1 ةوطخلال

uBR10K نم هيلال لوصولان كم ي TFTP مداخل ىل ىنورتكالال كديرب نم صيخرتال فلم خسنال

TFTP مداخل نم uBR10K ىل صيخرتال فلم خسنال

```
ubr10012-1#copy tftp://10.66.94.155/ CAT1616E015_20130704172627009.lic disk0:
```

```
Destination filename [CAT1616E015_20130704172627009.lic]?
```

```
Accessing tftp://10.66.94.155/CAT1616E015_20130704172627009.lic...
```

```
Loading CAT1616E015_20130704172627009.lic from 10.66.94.155 (via GigabitEthernet1/1/0): !
```

```
[OK - 2237 bytes]
```

```
2237 bytes copied in 0.556 secs (4023 bytes/sec)
```

```
ubr10012-1#
```

صيخرتال تيبتت لبق يلال صيخرتال ةلال نم ققحت : 5.2 ةوطخلال فدهال LC ىلع ديدجال

ديدجال صيخرتال فلم قيبطت لبق 8/0 هيرفلا ةحتغلا ىلع يلال صيخرتال ةلال نم ققحت

```
ubr10012-1#show license detail subslot 8/0
```

```
Index: 1      Feature: DS_License      Version: 1.0
```

```
License Type: Permanent
```

```
License State: Active, In Use License Count: 60/60/0 (Active/In-use/Violation) License  
Priority: Medium Store Index: 0 Store Name: Primary License Storage Index: 2 Feature: DS_License
```

Version: 1.0 License Type: Evaluation License State: Inactive Evaluation total period: 8 weeks 4 days Evaluation period left: 8 weeks 4 days License Count: 72/0/0 (Active/In-use/Violation) License Priority: None Store Index: 1 Store Name: Evaluation License Storage Index: 3 Feature: US_License Version: 1.0 License Type: Permanent License State: Active, In Use License Count: 16/16/0 (Active/In-use/Violation) License Priority: Medium Store Index: 1 Store Name: Primary License Storage Index: 4 Feature: US_License Version: 1.0 License Type: Evaluation License State: Inactive Evaluation total period: 8 weeks 4 days Evaluation period left: 8 weeks 4 days License Count: 60/0/0 (Active/In-use/Violation) License Priority: None Store Index: Name: Evaluation License Storage ubr10012-1#

فدهلا LC ىلع دي دج صي خرت تي بئثت: 5.3 قوطخلا

دي دجلا صي خرتلا تي بئثت:

```
ubr10012-1#license install disk0:CAT1616E015_20130704172627009.lic
```

```
Installing licenses from "disk0:CAT1616E015_20130704172627009.lic"
```

```
Installing...Feature:US_License...Successful:Supported
```

```
Installing...Feature:DS_License...Successful:Supported
```

```
2/2 licenses were successfully installed 0/2 licenses were existing licenses 0/2 licenses were failed to install
```

تي بئثتلا دعب صي خرتلا قلا ح نم ققحت: 5.4 قوطخلا

62/18: ىلا ددغلا ريغتتي 2x2 متفاضتس! قداع! تدمت يذلا صي خرتلا تي بئثت دعب 8/0 ل show license detail رمألا لي غتت ب قق

```
ubr10012-1#
```

```
show license detail subplot 8/0
```

```
Index: 1 Feature: DS_License Version: 1.0
```

```
License Type: Permanent
```

```
License State: Active, In Use License Count: 62/62/0 (Active/In-use/Violation) License Priority: Medium Store Index: 3 Store Name: Primary License Storage Index: 2 Feature: DS_License Version: 1.0 License Type: Permanent License State: Inactive License Count: 60/0/0 (Active/In-use/Violation) License Priority: Medium Store Index: 0 Store Name: Primary License Storage Index: 3 Feature: DS_License Version: 1.0 License Type: Evaluation License State: Inactive Evaluation total period: 8 weeks 4 days Evaluation period left: 8 weeks 4 days License Count: 72/0/0 (Active/In-use/Violation) License Priority: None Store Index: 1 Store Name: Evaluation License Storage Index: 4 Feature: US_License Version: 1.0 License Type: Permanent License State: Active, In Use License Count: 18/18/0 (Active/In-use/Violation) License Priority: Medium Store Index: 2 Store Name: Primary License Storage Index: 5 Feature: US_License Version: 1.0 License Type: Permanent License State: Inactive License Count: 16/0/0 (Active/In-use/Violation) License Priority: Medium Store Index: 1 Store Name: Primary License Storage Index: 6 Feature: US_License Version: 1.0 License Type: Evaluation License State: Inactive Evaluation total period: 8 weeks 4 days Evaluation period left: 8 weeks 4 days License Count: 60/0/0 (Active/In-use/Violation) License Priority: None Store Index: 0 Store Name: Evaluation License Storage ubr10012-1#
```

ةمچرتل هذه لوج

ةللأل تاي نقتل نم ةومجم مادختساب دن تسمل اذه Cisco تچرت
ملاعلاء انءم ءي ف ني مدختسمل معد و تحم مي دقتل ءي رشبل او
امك ءق قء نوك ت نل ءي آل ءمچرت لصف أن ءظحال م ءرءي . ءصاأل مءتبل ب
Cisco ءلخت . فرءم مچرت مءم دق ءي تل ءي فارتحال ءمچرتل عم لاعل او
ىل إءمءءء ءوچرلاب ءصوء و تءمچرتل هذه ءقءن ءءءل وءس م Cisco
Systems (رفوتم طبارل) ءلصل ءل ءل ءل ءل دن تسمل